



CONDITION REPORT



Report No:
2017298257
DATE
14/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	14/09/2026		M57 Pretoria Road - 1619
Inspection Date	14/09/2026		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	
Manufacturer	SUZUKI	Registration Number	LD48LKGP
Model	S-PRESSO 1.0 GL+ MT [2022-ON]	Register Number	
VIN	MA3RFL61S00426915	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	
Color	WHITE	Power / Displacement	
Year Model	2023	Paint Finish	C - COMMON
Km Reading	100,881 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA3RFL61S00426915



CONDITION REPORT



Report No:

2017298257


DATE

14/09/2026

Damage

Repair Way

Parcel Tray Missing	Replace
Side Mirror Left Paintwork • Scratched	Repair
Side Mirror Right Paintwork • Scratched	Repair
Bonnet Paintwork • Chipmarks	Repair
Rear Fender Left Dented	Repair
Rear Fender Right Paintwork • Scratched	Repair
Door Rear Left Paintwork • Scratched	Repair
Windscreen Cracked	Replace
Bolt(s) / Nut(s) Front Wheel Left Missing	Replace
CV Joint(s) Boot(s) Front Left (inner/outer) Damaged	Replace
Starter motor noisy	Repair
Radio electronics malfunction	Repair

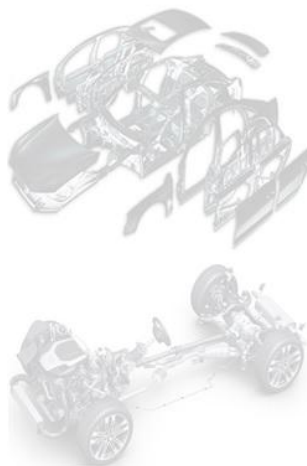

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	1.93	2.39	-	
Rear	1.1	1.26	-	
Emergency / Parking	0.72	1.09	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	165/70R14	81S	MRF	ZVTV	V	4622	5 mm
Front Right	165/70R14	81S	MRF	ZVTV	V	4622	6 mm
Rear Left	165/70R14	81S	MRF	ZVTV	V	4622	1 mm
Rear Right	165/70R14	81S	MRF	ZVTV	V	4622	1 mm
Spare	165/70R14	81S	MRF	ZVTV	V	0000	9 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA3RFL61S00426915



CONDITION REPORT



Report No:
2017298257
DATE
14/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ABS	C1157-1C	POWER SUPPLY VOLTAGE ABNORMAL	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ON THE BODY, INTERIOR, EXTERIOR, AND MECHANICAL PARTS. SIGNS OF SPRAY WORK DONE ON BODY PANELS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA3RFL61S00426915



CONDITION REPORT



Report No:
2017298257
DATE
14/09/2026



FRONT RIGHT CORNER



REAR LEFT CORNER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE LEFT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA3RFL61S00426915



CONDITION REPORT



Report No:
2017298257
DATE
14/09/2026



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



MANUAL GEAR LEVER



LF TYRE TREAD



RF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA3RFL61S00426915



CONDITION REPORT



Report No:
2017298257
DATE
14/09/2026



LR TYRE TREAD



RR TYRE TREAD



ENGINE 1



ENGINE 2



CHASSIS



CHASSIS 2

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA3RFL61S00426915



CONDITION REPORT



Report No:
2017298257
DATE
14/09/2026



OIL CAP AND DIPSTICK



COOLANT RESERVOIR




SPARE WHEEL



LICENSE DISC



VIN PLATE OR STICKER

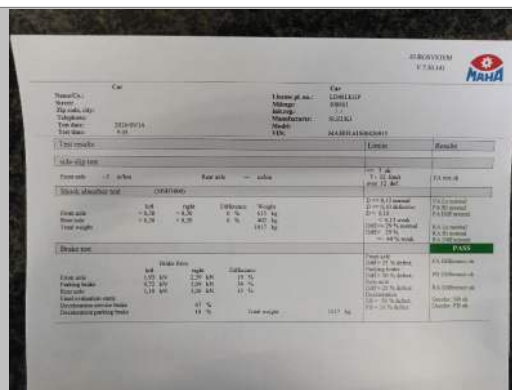

SHOCK AND BRAKE TEST REPORT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: MA3RFL61S00426915




CONDITION REPORT



Report No:
2017298257
DATE
14/09/2026

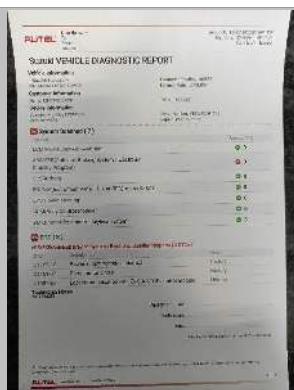

DIAGNOSTIC TEST REPORT

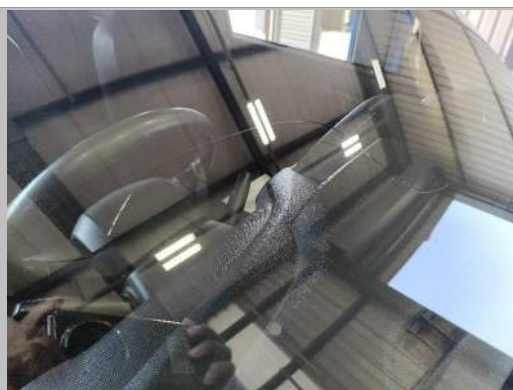


Windscreen



Windscreen



Side Mirror Left

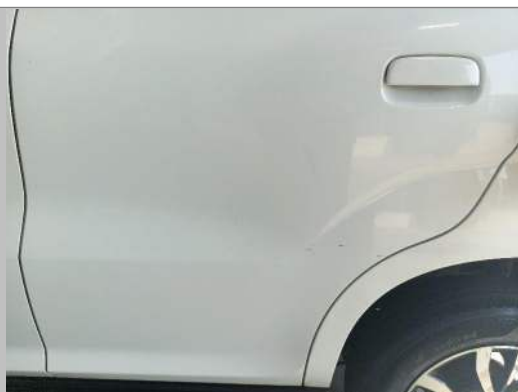

Door Rear Left



Rear Fender Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA3RFL61S00426915



CONDITION REPORT



Report No:
2017298257
DATE
14/09/2026



Parcel Tray



Rear Fender Right



Side Mirror Right



Bonnet



Bolt(s) / Nut(s) Front Wheel Left



CV Joint(s) Boot(s) Front Left (inner/outer)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA3RFL61S00426915



CONDITION REPORT



Report No:
2017298257
DATE
14/09/2026



CV Joint(s) Boot(s) Front Left (inner/outer)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA3RFL61S00426915