



CONDITION REPORT



Report No:
2017278397
DATE
31/07/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	31/07/2026		M57 Pretoria Road - 1619
Inspection Date	31/07/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	SUZUKI	Registration Number	JZN887EC
Model	CELERIO 1.0 GL 5-DR [2022-ON]	Register Number	
VIN	MA3TFC62S00148906	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/07/2026
Color	WHITE	Power / Displacement	
Year Model	2022	Paint Finish	M - METALLIC
Km Reading	45,643 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA3TFC62S00148906



CONDITION REPORT



Report No:

2017278397

DATE

31/07/2026



Damage

Repair Way

Headlight Left Damaged	Repair
Headlight Right Damaged	Repair
Side Mirror Left Damaged	Repair
Side Mirror Right Paintwork • Scratched	Repair
Front Bumper Damaged	Repair
Bonnet Residual Traces of Repair	Repair
Front Fender Left Damaged	Repair
Front Fender Right Dented	Repair
Rear Fender Left Paintwork • Scratched	Repair
Rear Fender Right Dented	Repair
Door Front Left Paintwork • Scratched	Repair
Door Rear Left Paintwork • Scratched	Repair
Door Rear Right Paintwork • Scratched	Repair
Rear bumper Damaged	Repair
Tyre Rear Left Smooth	Replace
Rim Front Left Deformed	Repair
Radiator Cross Member Deformed	Repair
Front tyre size differs	Replace.

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	1.6	1.6	-	
Rear	1.4	1.4	-	
Emergency / Parking	0.8	0.9	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	175/65R15	84H	Michelin	Primacy	V	2015	3 mm
Front Right	T135/70R15	99M	Jk tyre	Temporary	V	2420	3 mm
Rear Left	175/60R15	81H	Yokohama	Bluearth	V	1122	0 mm
Rear Right	175/60R15	81H	Hilo	Genesys	V	0000	4 mm
Spare	175/60R15	81H	Yokohama	Bluearth	V	0000	4 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
 www.dekraauto.co.za

VIN: MA3TFC62S00148906



CONDITION REPORT



Report No:
2017278397
DATE
31/07/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ABS	C1157-1C	POWER SUPPLY VOLTAGE ABNORMAL	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Residual traces of poor repair on body panels. Signs of spray work done on body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA3TFC62S00148906



CONDITION REPORT




Report No:
2017278397
DATE
31/07/2026

Vehicle:		Make:		Model:	
Registration:		VIN:		Year:	
Test Date:		Test Time:		Test Location:	
Test Result:		Test Status:		Test Notes:	
Shock and Brake Report					
Front Left:		Front Right:		Rear Left:	
Rear Right:		Steering:		Brakes:	
Shock absorber:		Shock absorber:		Shock absorber:	
Front Left:		Front Right:		Rear Left:	
Rear Right:		Steering:		Brakes:	
Shock absorber:		Shock absorber:		Shock absorber:	
Front Left:		Front Right:		Rear Left:	
Rear Right:		Steering:		Brakes:	
Shock absorber:		Shock absorber:		Shock absorber:	

Shock and brake report

Vehicle:		Make:		Model:	
Registration:		VIN:		Year:	
Test Date:		Test Time:		Test Location:	
Test Result:		Test Status:		Test Notes:	
Diagnostic Test Report					
Engine:		Transmission:		Brakes:	
Steering:		Suspension:		Wheels/Tyres:	
Electrical:		Air Conditioning:		Interior:	
Exterior:		Paint/Bodywork:		Safety:	
Front Left:		Front Right:		Rear Left:	
Rear Right:		Steering:		Brakes:	
Shock absorber:		Shock absorber:		Shock absorber:	
Front Left:		Front Right:		Rear Left:	
Rear Right:		Steering:		Brakes:	
Shock absorber:		Shock absorber:		Shock absorber:	

Diagnostic test

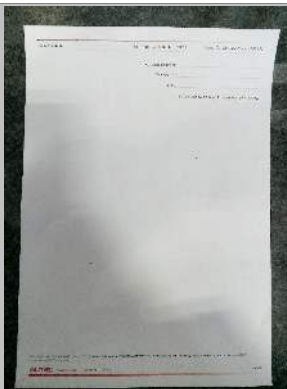

Diagnostic test



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA3TFC62S00148906



CONDITION REPORT



Report No:
2017278397
DATE
31/07/2026



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual transmission



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA3TFC62S00148906



CONDITION REPORT




Report No:
2017278397
DATE
31/07/2026



90 DEGREE LEFT




LF TYRE TREAD

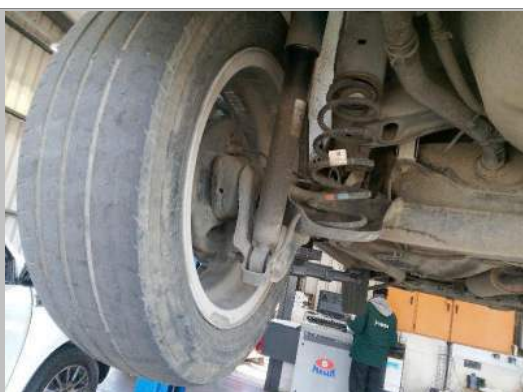

LR TYRE TREAD



RR TYRE TREAD

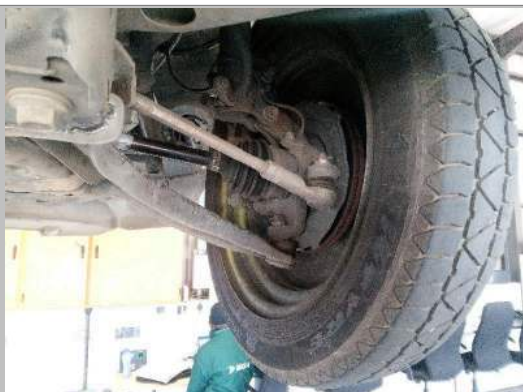

RF TYRE TREAD



Sparewheel

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA3TFC62S00148906



CONDITION REPORT



Report No:
2017278397
DATE
31/07/2026



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS



REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA3TFC62S00148906



CONDITION REPORT



Report No:
2017278397
DATE
31/07/2026



Coolant reservoir



oil cap and dipstick



R/F fender liner missing



Sparewheel well dent



Sparewheel well dent



Radio LCD damage

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA3TFC62S00148906



CONDITION REPORT



Report No:
2017278397
DATE
31/07/2026



Front Fender Right



Side Mirror Right



Door Rear Right



Rear Fender Right



Rear bumper



Rear bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA3TFC62S00148906



CONDITION REPORT



Report No:
2017278397
DATE
31/07/2026



Rear bumper



Rear bumper



Rear Fender Left



Door Rear Left



Door Front Left



Side Mirror Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA3TFC62S00148906




CONDITION REPORT



Report No:
2017278397
DATE
31/07/2026




Side Mirror Left

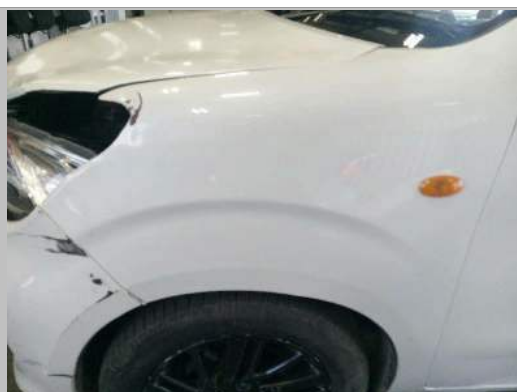

Front Fender Left



Bonnet

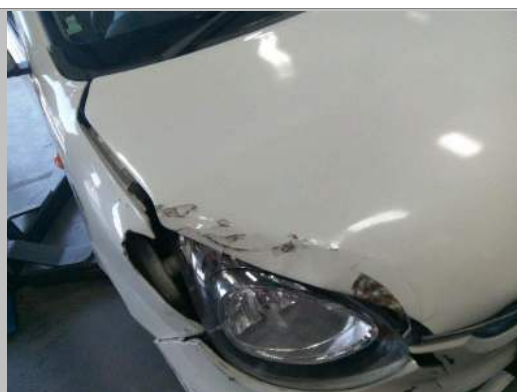

Bonnet



Bonnet



Headlight Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA3TFC62S00148906



CONDITION REPORT



Report No:
2017278397
DATE
31/07/2026



Headlight Left



Headlight Right



Headlight Right



Radiator Cross Member



Radiator Cross Member



Radiator Cross Member

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA3TFC62S00148906



CONDITION REPORT



Report No:

2017278397

DATE

31/07/2026



Radiator Cross Member



Radiator Cross Member



Radiator Cross Member



Front Bumper



Front Bumper



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA3TFC62S00148906



CONDITION REPORT



Report No:
2017278397
DATE
31/07/2026



Front Bumper



Rear bumper



Rear bumper



Rim Front Left



Radiator Cross Member



Radiator Cross Member

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA3TFC62S00148906



CONDITION REPORT



Report No:
2017278397
DATE
31/07/2026



Radiator Cross Member



Tyre Rear Left



Bonnet



Bonnet

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA3TFC62S00148906