

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	23/04/2025		M57 Pretoria Road - 1619
Inspection Date	23/04/2025		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	
Manufacturer	SUZUKI	Registration Number	KS25PBGP
Model	CELERIO	Register Number	
VIN	MA3TFC62S00151192	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/07/2025
Color	WHITE	Power / Displacement	
Year Model		Paint Finish	M - METALLIC
Km Reading	69,169 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Side Mirror Left Damaged	Replace
Front Bumper Damaged	Repair
C • Pillar Right Paintwork • Scratched	Repair
Front Fender Left Paintwork • Scratched	Repair
Front Fender Right Residual Traces of Repair	Repair
Rear Fender Left Damaged	Repair
Door Front Left Dented	Repair
Door Front Right Residual Traces of Repair	Repair
Rear bumper Damaged	Repair
Tyre Front Left Smooth	Replace
Body exterior	Signs of spray work done on some body panels
Body exterior	Minor dents scratches stone chips on some body pan
Body exterior	Residual traces of repair work done on some body p



Brakes

Brake Test Results

	Left	Right	Axle Weight [KG]	Deceleration [m/s ²]
	Braking Force [KN]	Braking Force [KN]		
Front	1.5	1.5	-	
Rear	0.99	0.99	-	
Emergency / Parking	0.6	0.8	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	165/70R14	81s	Bridgestone	---	V	1022	0 mm
Front Right	165/70R14	81s	Bridgestone	Ecopia	V	1022	4 mm
Rear Left	165/70R14	81s	Bridgestone	Ecopia	V	1022	5 mm
Rear Right	165/70R14	81s	Bridgestone	Ecopia	V	1022	2 mm
Spare	165/70R14	81S	Bridgestone	Ecopia	V	0000	1 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

Inspection Conditions

No Test Drive
 Rain at time of inspection
 Vehicle doesn't start
 Battery Flat
 Engine number – not possible to verify engine number (not visible without dismantling)
 Inspection conditions for the vehicle inspection were sufficient

Concluding Remarks


THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician


Trevino Julius

This document was created electronically and is valid without signature.


General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

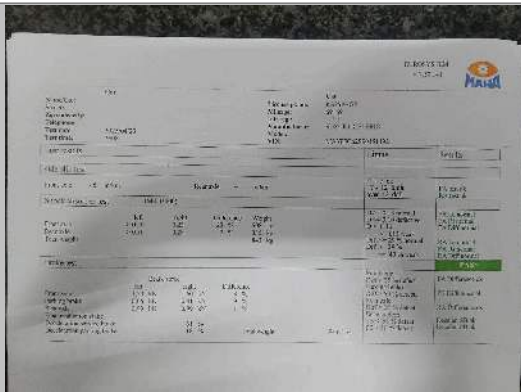

Shock and brake report

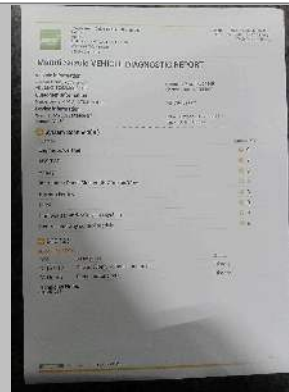

Diagnostic test

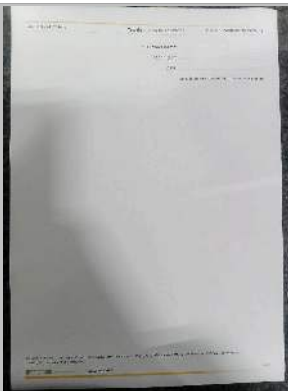

Diagnostic test



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Sparewheel



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS



Rear end



Oil cap



Coolant reservoir



Door Front Right



C • Pillar Right



Door Front Left



Front Fender Left



Water level



Water level



Front Fender Right




Door Front Right



Tyre Front Left



Rear bumper

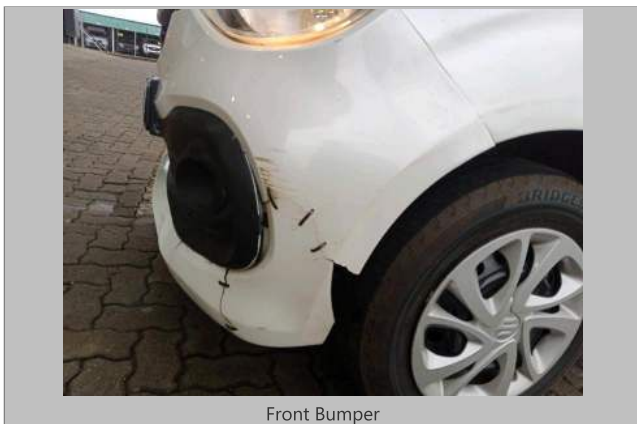

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA3TFC62S00151192