



## CONDITION REPORT

Report No: 201620418

DATE  
18/12/2023

MFC Auction House  
M57 Pretoria Rd, Glenmarais, KEMPTON PARK  
Gauteng

DEKRA MFC  
M57 Pretoria Rd - 1619  
KEMPTON PARK - GT  
08610 33572

**Assignment**

Client	MFC Auction House	Inspection Location	MFC
Requested Date	18/12/2023		M57 Pretoria Road - 1619
Inspection Date	18/12/2023		Kempton Park - GT

**Vehicle Data**

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	FORD	Registration Number	JJ93YMGP
Model	FIGO	Register Number	
VIN	MAJFXMTKFKY11155	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	31/12/2023
Color	WHITE	Power / Displacement	
Year Model		Paint Finish	C - COMMON
Km Reading	162,255 KM	Fuel	PETROL
Cab / Body Type	SEDAN	Transmission	MANUAL

**Vehicle Options & Accessories****Items**

## VEHICLE INSPECTION



Damage	Repair Way
Engine Wiring Defective	Repair
Park Light Front Left Defective	Repair
Park Light Front Right Defective	Repair
Fog Light Front Left Defective	Repair
Fog Light Front Right Defective	Repair
Front Bumper Paintwork • Scratched	Repair
Front Fender Left Dented	Repair
Rear Fender Left Dented	Repair
Windscreen Cracked	Replace
Ball Joint(s) Front Axle Left Damaged	Replace
Rim Front Right Dented	Repair





## CONDITION REPORT

Report No: 201620418

DATE  
18/12/2023**Brakes****Brake Test Results**

	Left	Right	Axle Weight [KG]	Deceleration [m/s <sup>2</sup> ]
	Braking Force [kN]	Braking Force [kN]		
Front	2.7	3.3	-	
Rear	1.3	1.3	-	
Emergency / Parking	1.2	1.7	-	

**Tyres and Rims****Tyre Specification & Measurement**

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	175/65R14	82T	Dunlop	Sport	V	2623	5 mm
Front Right	175/65R14	82T	Dunlop	Sport	V	2623	5 mm
Rear Left	175/65R14	82H	Apollo	Alnac	V	2319	2 mm
Rear Right	175/65R14	82H	Apollo	Alnac	V	2319	1 mm
Spare	175/65R14	82H	Apollo	Alnac	V	//////	1 mm

\* Tyre Legend: V=Virgin, R=Recap

**Diagnostic**

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

**Inspection Conditions**

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

**Comments**

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Body • Exterior: Minor dents scratches and stone chips on some body panels. Signs of spray work done on some body panels.

**Concluding Remarks**

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

**Technician**

Trevino Julius

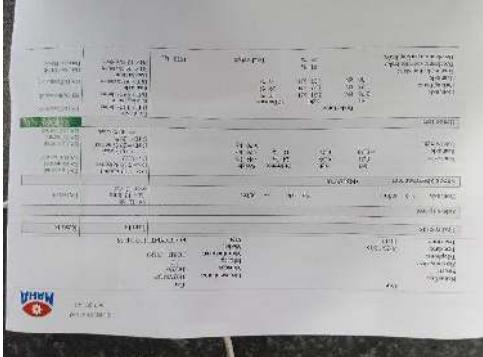
This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



## CONDITION REPORT

Report No: 201620418

DATE  
18/12/2023

Shock and brake



Diagnostic test



Diagnostic test



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)





## CONDITION REPORT

Report No: 2016204186

DATE  
18/12/2023

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: MAJFXXMTFKY11155

4 / 10



## CONDITION REPORT

Report No: 2016204186

DATE  
18/12/2023

DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



## CONDITION REPORT

Report No: 2016204186

DATE  
18/12/2023

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: MAJFXXMTKFKY11155  
6 / 10



## CONDITION REPORT

Report No: 2016204186

DATE  
18/12/2023

LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Sparewheel



LICENSE DISC





## CONDITION REPORT

Report No: 2016204186

DATE  
18/12/2023



## CONDITION REPORT

Report No: 2016204186

DATE  
18/12/2023

VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS



Rear end



Manual



## CONDITION REPORT

Report No: 2016204186

DATE  
18/12/2023



## CONDITION REPORT

Report No: 2016204186

DATE  
18/12/2023

Expansion bottle



Oil cap and dipstick



Windscreen



Water level



Engine Wiring



Engine Wiring



## CONDITION REPORT

Report No: 2016204186

DATE  
18/12/2023

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)



## CONDITION REPORT

Report No: 2016204186

DATE  
18/12/2023

Engine Wiring



Engine Wiring



Ball Joint(s) Front Axle Left



Engine Wiring



Engine Wiring



Rim Front Right



## CONDITION REPORT

Report No: 2016204186

DATE  
18/12/2023



## CONDITION REPORT

Report No: 2016204186

DATE  
18/12/2023

Park Light Front Left



Park Light Front Right



Rear Fender Left



Front Fender Left



Front Bumper



Fog Light Front Left



## CONDITION REPORT

Report No: 2016204186

DATE  
18/12/2023



## CONDITION REPORT

Report No: 2016204186

DATE  
18/12/2023

Fog Light Front Right



## CONDITION REPORT

Report No: 2016204186

DATE  
18/12/2023

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)