



CONDITION REPORT

Report No: 2016287572

DATE
29/02/2024

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	29/02/2024		M57 Pretoria Road - 1619
Inspection Date	29/02/2024		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	FORD	Registration Number	KPP699MP
Model	FIGO	Register Number	
VIN	MAJGXXMTKGJT65165	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/08/2024
Color	SILVER	Power / Displacement	
Year Model		Paint Finish	M - METALLIC
Km Reading	152,144 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Front Bumper Damaged	Replace
Front Fender Right Paintwork • Scratched	Repair
Door Rear Left Dented	Repair
Rear bumper Paintwork • Scratched	Repair
Sill Panel Right Damaged	Repair
Windscreen Cracked	Replace
Tie Rod End right Damaged	Replace
Rim Rear Right Dented	Repair
Bolt(s) / Nut(s) Front Wheel Left Missing	Replace
Bolt(s) / Nut(s) Front Wheel Right Missing	Replace
Bolt(s) / Nut(s) Rear Wheel Left Missing	Replace
Bolt(s) / Nut(s) Rear Wheel Right Missing	Replace
Gearbox Oil Leak	Repair
Engine Noise Idling / Hunting	Repair
R/F tyre make and model not visible	Replace
Rear tyre size differs	Replace
Body exterior	Signs of spray work done on some body panels
Axle and suspension	Both front control arm bushes covered

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MAJGXXMTKGJT65165

1 / 10



CONDITION REPORT

Report No: 2016287572

DATE
29/02/2024

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.5	2.7	-	
Rear	1.6	1.7	-	
Emergency / Parking	1	1.4	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	185/70R14	88T	Dunlop	Sport	V	2617	1 mm
Front Right	185/70R14	88H	----	----	V	3622	1 mm
Rear Left	185/65R14	86H	Westlake	Radial	V	----	6 mm
Rear Right	195/65R14	89H	Barum	Brilliantis	V	1907	1 mm
Spare	175/65R14	82H	Royal Blac	Performance	V	//////7	1 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius


This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.




CONDITION REPORT


Report No: 2016287572

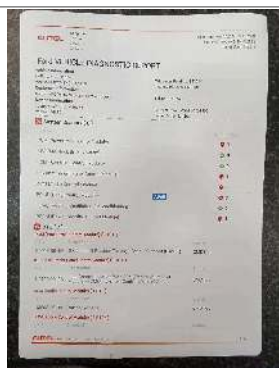DATE
29/02/2024

Diagnostic test

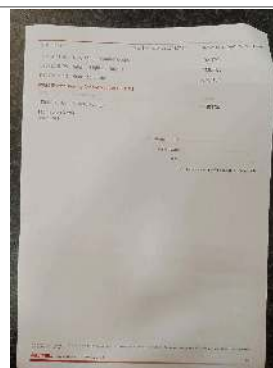

Diagnostic test

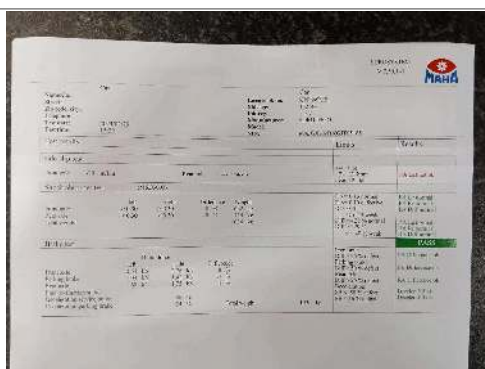

Shock and brake report



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



CONDITION REPORT

Report No: 2016287572

DATE
29/02/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MAJGXXMTKGJT65165
4 / 10



CONDITION REPORT

Report No: 2016287572

DATE
29/02/2024

DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MAJGXXMTKGJT65165

5 / 10



CONDITION REPORT

Report No: 2016287572

DATE
29/02/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MAJGXXMTKGJT65165
6 / 10




CONDITION REPORT

Report No: 2016287572

DATE
29/02/2024




LF TYRE TREAD

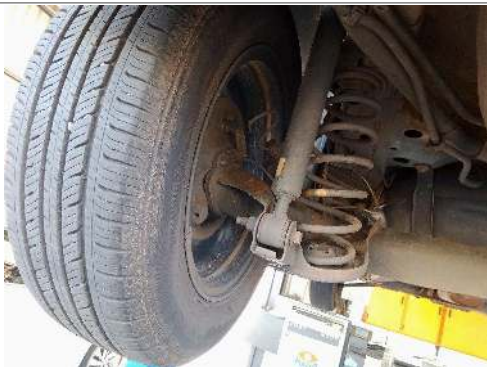

LR TYRE TREAD



RR TYRE TREAD

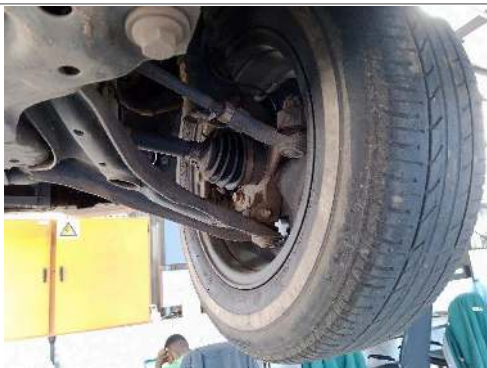

RF TYRE TREAD



Sparewheel



LICENSE DISC



CONDITION REPORT

Report No: 2016287572

DATE
29/02/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MAJGXXMTKGJT65165
8 / 10



CONDITION REPORT

Report No: 2016287572

DATE
29/02/2024

VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS



Rear end



R/F fender liner missing



CONDITION REPORT

Report No: 2016287572

DATE
29/02/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MAJGXXMTKGJT65165
10 / 10



CONDITION REPORT


Report No: 2016287572

DATE
29/02/2024

R/F headlight clip broken



Expansion bottle

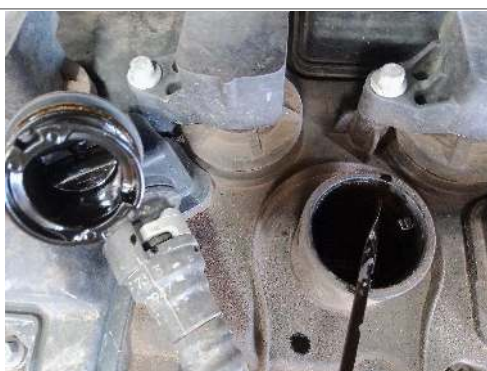

Oil cap and dipstick



Manual



Water level



Bolt(s) / Nut(s) Front Wheel Right



CONDITION REPORT

Report No: 2016287572

DATE
29/02/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016287572

DATE
29/02/2024

Tie Rod End right



Front Bumper



Front Bumper



Bolt(s) / Nut(s) Front Wheel Left



Door Rear Left



Bolt(s) / Nut(s) Rear Wheel Left



CONDITION REPORT

Report No: 2016287572

DATE
29/02/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016287572

DATE
29/02/2024

Front Fender Right



Rear bumper




Rear bumper



Rear bumper



Bolt(s) / Nut(s) Rear Wheel Right

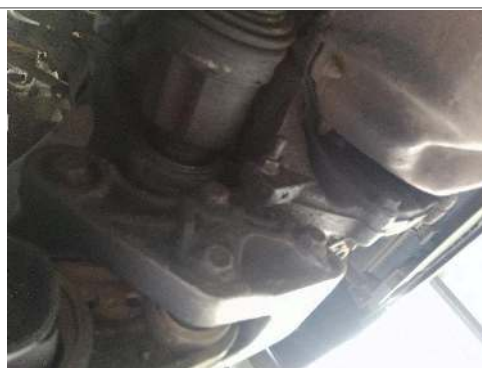

Gearbox



CONDITION REPORT

Report No: 2016287572

DATE
29/02/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016287572

DATE
29/02/2024


Gearbox



Rim Rear Right



Sill Panel Right

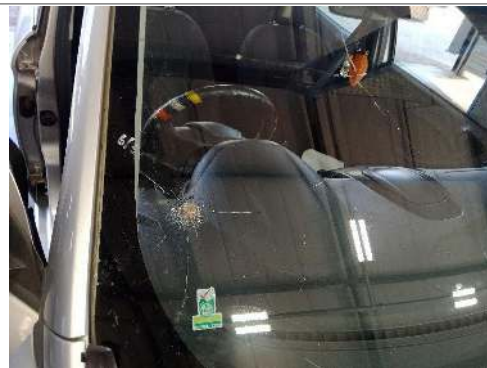

Windscreen

**CONDITION REPORT****Report No: 2016287572****DATE**
29/02/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za