



CONDITION REPORT



Report No:  
2017303157  
DATE  
25/09/2026

MFC Auction House  
M57 Pretoria Rd, Glenmarais, KEMPTON PARK  
Gauteng

DEKRA MFC  
M57 Pretoria Rd - 1619  
KEMPTON PARK - GT  
08610 33572



Assignment

|                 |                   |                     |                          |
|-----------------|-------------------|---------------------|--------------------------|
| Client          | MFC Auction House | Inspection Location | MFC                      |
| Requested Date  | 25/09/2026        |                     | M57 Pretoria Road - 1619 |
| Inspection Date | 25/09/2026        |                     | Kempton Park - GT        |

Vehicle Data

|                 |                                           |                         |                   |
|-----------------|-------------------------------------------|-------------------------|-------------------|
| Vehicle Type    | PASSENGER VEHICLE                         | Registered Owner        | MFC AUCTION HOUSE |
| Manufacturer    | HYUNDAI                                   | Registration Number     | FXJ312L           |
| Model           | ATOS 1.1 50KW MOTION 5-DR AMT [2021-2024] | Register Number         |                   |
|                 |                                           | Date Of First Licensing |                   |
| VIN             | MALAF51CYNM189931                         | Last COR                |                   |
| Engine Number   |                                           | License Expiry Date     |                   |
| Doors           | 5                                         | Power / Displacement    |                   |
| Color           | SILVER                                    | Paint Finish            | TWO COAT METALLIC |
| Year Model      | 2022                                      | Fuel                    | PETROL            |
| Km Reading      | 68,384 KM                                 | Transmission            | AUTOMATIC         |
| Cab / Body Type | HATCHBACK                                 |                         |                   |

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: MALAF51CYNM189931



## CONDITION REPORT



Report No:  
2017303157  
DATE  
25/09/2026



| Damage                     | Repair Way |
|----------------------------|------------|
| Windscreen Wiper Damaged   | Replace    |
| Tail Light Left Damaged    | Replace    |
| Seat Front Left Damaged    | Repair     |
| Seat Front Right Damaged   | Repair     |
| Front Bumper Damaged       | Repair     |
| Front Fender Right Damaged | Repair     |
| Rear Fender Right Damaged  | Repair     |
| Door Front Left Damaged    | Repair     |
| Door Front Right Damaged   | Repair     |
| Door Rear Left Damaged     | Repair     |
| Door Rear Right Damaged    | Repair     |
| Rear bumper Damaged        | Repair     |

## Brakes

## Brake Test Results

|                     | Left               | Right              |                  |                                  |
|---------------------|--------------------|--------------------|------------------|----------------------------------|
|                     | Braking Force [KN] | Braking Force [KN] | Axle Weight [KG] | Deceleration [m/s <sup>2</sup> ] |
| Front               | 1.93               | 1.71               | -                |                                  |
| Rear                | 1.43               | 1.36               | -                |                                  |
| Emergency / Parking | 0.41               | 1.5                | -                |                                  |

## Tyres and Rims

## Tyre Specification &amp; Measurement

|             | Size      | Load/Speed Index | Manufacture | Model  | Type* | Production Date | Tread Depth (mm) |
|-------------|-----------|------------------|-------------|--------|-------|-----------------|------------------|
| Front Left  | 165/70R14 | 81S              | MRF         | Radial | V     | 1721            | 2 mm             |
| Front Right | 165/70R14 | 81T              | MRF         | Radial | V     | 1522            | 2 mm             |
| Rear Left   | 155/80R13 | 79T              | MRF         | Radial | V     | 1122            | 3 mm             |
| Rear Right  | 165/70R14 | 81T              | MRF         | Radial | V     | 1522            | 2 mm             |

\* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: MALAF51CYNM189931



## CONDITION REPORT



Report No:

2017303157

DATE

25/09/2026

### Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

| No | System | Code     | Description              | Status |
|----|--------|----------|--------------------------|--------|
| 1  | AB     | B1116:00 | BATTERY VOLTAGE UNSTABLE |        |

### Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

### Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Minor dents and scratches and stone chips to body panels. Signs of repair work done to body panels. Poor alignment to somebody panels. Vehicle body in poor condition.

### Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

### Technician

Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: MALAF51CYNM189931



## CONDITION REPORT



Report No:  
2017303157  
DATE  
25/09/2026



FRONT RIGHT CORNER



REAR LEFT CORNER



90 DEGREE REAR



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE LEFT

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: MALAF51CYNM189931



## CONDITION REPORT



Report No:  
2017303157  
DATE  
25/09/2026



ODOMETER



DASHBOARD (W/ ENGINE RUNNING)



INTERIOR (FRONT DRIVER DOOR)



Automatic.



LF TYRE TREAD



LR TYRE TREAD

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: MALAF51CYNM189931



## CONDITION REPORT



Report No:  
2017303157  
DATE  
25/09/2026



RR TYRE TREAD



RF TYRE TREAD



Undercarriage front.



Undercarriage rear.



Oil cap and dipstick.



ENGINE 1

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: MALAF51CYNM189931



## CONDITION REPORT




Report No:  
2017303157  
DATE  
25/09/2026



VIN PLATE OR STICKER



LICENSE DISC

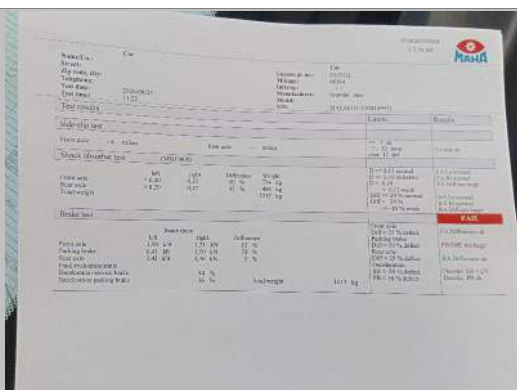

BRAKE TEST REPORT



DIAGNOSTIC REPORT



Water level



Front Bumper

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: MALAF51CYNM189931



## CONDITION REPORT



Report No:  
2017303157  
DATE  
25/09/2026



Front Bumper



Door Front Left



Door Rear Left



Rear bumper



Rear bumper



Door Rear Right

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: MALAF51CYNM189931



## CONDITION REPORT



Report No:  
2017303157  
DATE  
25/09/2026



Rear Fender Right



Front Fender Right



Door Front Right



Seat Front Right



Seat Front Left



Tail Light Left

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)


VIN: MALAF51CYNM189931



## CONDITION REPORT



Report No:  
2017303157  
DATE  
25/09/2026

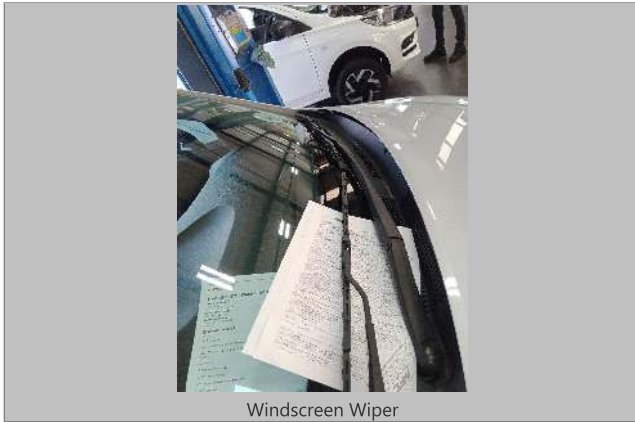

Windscreen Wiper

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: MALAF51CYNM189931