



CONDITION REPORT



Report No:
2017302371
DATE
22/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	22/09/2026		M57 Pretoria Road - 1619
Inspection Date	22/09/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	HYUNDAI	Registration Number	MN94SZGP
Model	I10 1.1 MOTION 5-DR [2011-2018]	Register Number	
VIN	MALAN51BLGM659586	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/01/2027
Color	SILVER	Power / Displacement	
Year Model	2015	Paint Finish	M - METALLIC
Km Reading	96,942 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALAN51BLGM659586



CONDITION REPORT



Report No:

2017302371

DATE


22/09/2026

Damage

Repair Way

Switch Electrical Window Winder front left Defective
 Front Bumper Damaged
 Door Front Right Dented
 Door Rear Right Dented
 Rear bumper Paintwork • Scratched
 Rim Front Left Deformed
 Rim Rear Left Deformed
 Rim Rear Right Deformed

Repair
 Repair
 Repair
 Repair
 Repair
 Repair
 Repair
 Repair

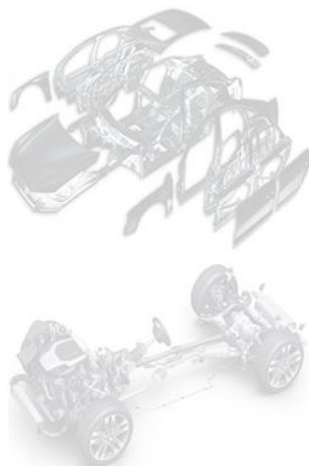

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.0	2.1	-	
Rear	0.9	1.2	-	
Emergency / Parking	0.9	1.2	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	165/60R14	75H	Dunlop	Sport	V	2521	1 mm
Front Right	165/60R14	75H	Dunlop	Sport	V	2521	3 mm
Rear Left	165/60R14	75H	Dunlop	Sport	V	2521	5 mm
Rear Right	165/60R14	75H	Dunlop	Sport	V	2521	6 mm
Spare	165/60R14	75T	Kumho	Solus	V	0000	6 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALAN51BLGM659586



CONDITION REPORT



Report No:
2017302371
DATE
22/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	AIRBAG	B1102	BATTERY VOLTAGE LOW	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Signs of spray work done on body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALAN51BLGM659586



CONDITION REPORT



Report No:
2017302371
DATE
22/09/2026

[illegible]

Shock and brake report

[illegible]

Diagnostics report

RUTEL REPAIR UTILITY TOOL

2016 HYUNDAI VEHICLE DIAGNOSTIC REPORT

VEHICLE INFORMATION

VIN: KMHND48D63U000000
 MAKE: HYUNDAI
 MODEL: ELANTRA
 YEAR: 2016
 ENGINE: 2.0L I4
 TRANSMISSION: 6-SPEED
 DRIVE: FWD

DIAGNOSTIC RESULTS

Engine

P0013 (Intake Valve Timing Control Solenoid Valve) - NG
 P0014 (Exhaust Valve Timing Control Solenoid Valve) - NG
 P0017 (Crankshaft Position Sensor) - OK
 P0018 (Crankshaft Position Sensor) - OK

Transmission

P0013 (Intake Valve Timing Control Solenoid Valve) - NG
 P0014 (Exhaust Valve Timing Control Solenoid Valve) - NG
 P0017 (Crankshaft Position Sensor) - OK
 P0018 (Crankshaft Position Sensor) - OK

Brake

P0013 (Intake Valve Timing Control Solenoid Valve) - NG
 P0014 (Exhaust Valve Timing Control Solenoid Valve) - NG
 P0017 (Crankshaft Position Sensor) - OK
 P0018 (Crankshaft Position Sensor) - OK

Steering

P0013 (Intake Valve Timing Control Solenoid Valve) - NG
 P0014 (Exhaust Valve Timing Control Solenoid Valve) - NG
 P0017 (Crankshaft Position Sensor) - OK
 P0018 (Crankshaft Position Sensor) - OK

Electrical

P0013 (Intake Valve Timing Control Solenoid Valve) - NG
 P0014 (Exhaust Valve Timing Control Solenoid Valve) - NG
 P0017 (Crankshaft Position Sensor) - OK
 P0018 (Crankshaft Position Sensor) - OK

Summary

Overall Status: NG
 Total Faults: 4
 Passed: 0
 Failed: 4

Diagnostics report



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALAN51BLGM659586



CONDITION REPORT



Report No:

2017302371

DATE

22/09/2026



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual transmission



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALAN51BLGM659586



CONDITION REPORT



Report No:
2017302371
DATE
22/09/2026



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Sparewheel

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALAN51BLGM659586



CONDITION REPORT



Report No:
2017302371
DATE
22/09/2026



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



REAR



CHASSIS

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALAN51BLGM659586



CONDITION REPORT



Report No:
2017302371
DATE
22/09/2026



Oil cap and dipstick



Coolant reservoir



Door Front Right



Door Rear Right



Front Bumper



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALAN51BLGM659586



CONDITION REPORT



Report No:

2017302371

DATE

22/09/2026



Front Bumper



Rear bumper



Rear bumper



Rear bumper



Rim Front Left



Rim Rear Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALAN51BLGM659586



CONDITION REPORT



Report No:
2017302371
DATE
22/09/2026



Rim Rear Right



Switch Electrical Window Winder front left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALAN51BLGM659586