



CONDITION REPORT



Report No:  
2017304174  
DATE  
28/09/2026

MFC Auction House  
M57 Pretoria Rd, Glenmarais, KEMPTON PARK  
Gauteng

DEKRA MFC  
M57 Pretoria Rd - 1619  
KEMPTON PARK - GT  
08610 33572



Assignment

|                 |                   |                     |                          |
|-----------------|-------------------|---------------------|--------------------------|
| Client          | MFC Auction House | Inspection Location | MFC                      |
| Requested Date  | 28/09/2026        |                     | M57 Pretoria Road - 1619 |
| Inspection Date | 28/09/2026        |                     | Kempton Park - GT        |

Vehicle Data

|                 |                                       |                         |              |
|-----------------|---------------------------------------|-------------------------|--------------|
| Vehicle Type    | PASSENGER VEHICLE                     | Registered Owner        | MFC          |
| Manufacturer    | HYUNDAI                               | Registration Number     | LG03SSGP     |
| Model           | GRAND I10 1.0 MOTION 5-DR [2020-2024] | Register Number         |              |
| VIN             | MALB251ALPM417948                     | Date Of First Licensing |              |
| Engine Number   |                                       | Last COR                |              |
| Doors           | 5                                     | License Expiry Date     | 30/06/2026   |
| Color           | WHITE                                 | Power / Displacement    |              |
| Year Model      | 2023                                  | Paint Finish            | TWO COAT UNI |
| Km Reading      | 72,188 KM                             | Fuel                    | PETROL       |
| Cab / Body Type | HATCHBACK                             | Transmission            | MANUAL       |

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: MALB251ALPM417948



## CONDITION REPORT



Report No:

2017304174

DATE

28/09/2026

## Damage

## Repair Way

|                                             |         |
|---------------------------------------------|---------|
| Engine Oil Sweat                            | Repair  |
| Air conditioner pipes Damaged               | Repair  |
| Windscreen Wiper Damaged                    | Replace |
| Seat Front Left Dirty                       | Repair  |
| Boot Carpet Damaged                         | Repair  |
| Side Mirror Right Damaged                   | Replace |
| Front Bumper Damaged                        | Repair  |
| Bonnet Paintwork • Chipmarks                | Repair  |
| Front Fender Left Residual Traces of Repair | Repair  |
| Rear Fender Right Damaged                   | Repair  |
| Door Front Left Dented                      | Repair  |
| Door Front Right Damaged                    | Repair  |
| Door Rear Right Damaged                     | Repair  |
| Rear bumper Paintwork • Scratched           | Repair  |
| Windscreen Cracked                          | Replace |
| Tyre Front Left Worn                        | Replace |
| Main Beam Right Damaged                     | Repair  |
| Chassis Damaged                             | Repair  |
| Belly plates Damaged                        | Replace |
| Radiator Cradle Damaged                     | Replace |
| Front bumper stiffener damaged              | Replace |

## Brakes

## Brake Test Results

|                     | Left               | Right              |                  |                                  |
|---------------------|--------------------|--------------------|------------------|----------------------------------|
|                     | Braking Force [KN] | Braking Force [KN] | Axle Weight [KG] | Deceleration [m/s <sup>2</sup> ] |
| Front               | 2.56               | 2.5                | -                |                                  |
| Rear                | 1.83               | 2.01               | -                |                                  |
| Emergency / Parking | 1.29               | 1.45               | -                |                                  |

## Tyres and Rims

## Tyre Specification &amp; Measurement

|             | Size       | Load/Speed Index | Manufacture | Model     | Type* | Production Date | Tread Depth (mm) |
|-------------|------------|------------------|-------------|-----------|-------|-----------------|------------------|
| Front Left  | 165/70 R14 | 81T              | Goodyear    | Assurance | V     | 0123            | 0 mm             |
| Front Right | 165/70 R14 | 81T              | Goodyear    | Assurance | V     | 0123            | 1 mm             |
| Rear Left   | 165/70 R14 | 81T              | Goodyear    | Assurance | V     | 0123            | 2 mm             |
| Rear Right  | 165/70 R14 | 81T              | Goodyear    | Assurance | V     | 0123            | 3 mm             |
| Spare       | 165/70 R14 | 81T              | Goodyear    | Assurance | V     | 0123            | 5 mm             |

\* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.  
 97 Willem Cruywagen Ave  
 Klerksoord, Pretoria, 0200  
 Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: MALB251ALPM417948

**CONDITION REPORT**

**Report No:**  
2017304174  
**DATE**  
28/09/2026

**Diagnostic**

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

**Inspection Conditions**

No Test Drive  
Battery Flat  
Engine number – not possible to verify engine number (not visible without dismantling)  
Inspection conditions for the vehicle inspection were sufficient

**Comments**

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. POOR RESIDUAL TRACES OF REPAIR ON BODY PANELS / BODY PANELS MISALIGNED / STONE CHIPS AND SPRAY WORK ON BODY PANELS / SIGNS OF IMPACT DAMAGE TO FRONT OF VEHICLE.

**Concluding Remarks**

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

**Technician**

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: MALB251ALPM417948



## CONDITION REPORT



Report No:  
2017304174  
DATE  
28/09/2026



FRONT RIGHT CORNER



REAR LEFT CORNER



90 DEGREE FRONT



90 DEGREE REAR



90 DEGREE RIGHT



90 DEGREE LEFT

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: MALB251ALPM417948



## CONDITION REPORT



Report No:  
2017304174  
DATE  
28/09/2026



INTERIOR (FRONT DRIVER DOOR)



Manual Transmission



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



VIN PLATE OR STICKER



LICENSE DISC

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: MALB251ALPM417948



## CONDITION REPORT



Report No:  
2017304174  
DATE  
28/09/2026



LF TYRE TREAD



RF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



Spare Wheel and Accessories



ENGINE 1

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: MALB251ALPM417948



## CONDITION REPORT



Report No:  
2017304174  
DATE  
28/09/2026



### Front chassis




Rear chassis




Oil cap and dipstick

[illegible]

Brake and shock absorber repor

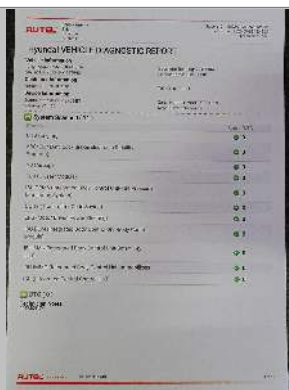

Diagnostic report page 1

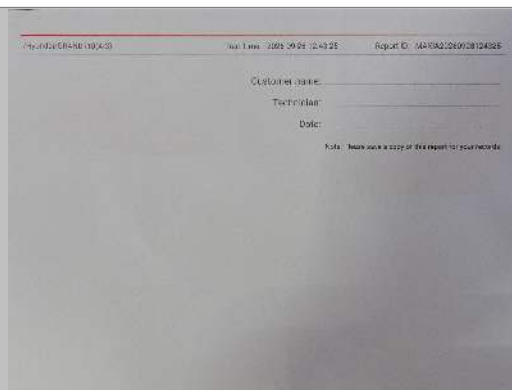

Diagnostic report page 2

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: MALB251ALPM417948



## CONDITION REPORT



Report No:  
2017304174  
DATE  
28/09/2026



Front bumper stiffener



Side Mirror Right



Windscreen



Boot Carpet



Seat Front Left



Windscreen Wiper

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: MALB251ALPM417948



## CONDITION REPORT



Report No:  
2017304174  
DATE  
28/09/2026



Rear Fender Right



Door Rear Right



Door Front Right



Bonnet



Bonnet



Front Fender Left

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: MALB251ALPM417948



## CONDITION REPORT



Report No:  
2017304174  
DATE  
28/09/2026



Door Front Left



Rear bumper



Rear bumper



Water level



Main Beam Right



Front Bumper

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: MALB251ALPM417948



## CONDITION REPORT



Report No:  
2017304174  
DATE  
28/09/2026



Front Bumper



Front Bumper



Belly plates



Tyre Front Left



Radiator Cradle



Radiator Cradle

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: MALB251ALPM417948



## CONDITION REPORT



Report No:  
2017304174  
DATE  
28/09/2026



Radiator Cradle



Engine



Air conditioner pipes



Main Beam Right



Chassis



Water level

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: MALB251ALPM417948

**CONDITION REPORT**

Report No:  
2017304174  
DATE  
28/09/2026



Windscreen Wiper

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: MALB251ALPM417948