



CONDITION REPORT



Report No:

2017304866

DATE

29/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	29/09/2026		M57 Pretoria Road - 1619
Inspection Date	29/09/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	
Manufacturer	HYUNDAI	Registration Number	LY30JFGP
Model	I10	Register Number	
VIN	MALB251ALSM558370	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/08/2026
Color	GREEN	Power / Displacement	
Year Model		Paint Finish	TWO COAT METALLIC
Km Reading	45,695 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALB251ALSM558370



CONDITION REPORT



Report No:

2017304866

DATE

29/09/2026

Damage

Repair Way

Headlight Left Damaged	Repair
Headlight Right Damaged	Repair
Front Bumper Damaged	Repair
Bonnet Damaged	Repair
Front Fender Left Damaged	Repair
Door Front Left Damaged	Repair
Door Front Right Damaged	Repair
Door Rear Left Damaged	Repair
Door Rear Right Damaged	Repair
Boot Lid / Hatch door Damaged	Repair
Rear bumper Damaged	Repair
Windscreen Damaged	Replace



Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.07	3.02	-	
Rear	1.62	1.72	-	
Emergency / Parking	1.14	1.4	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	165/70R14	81T	Goodyear	Assurance	V	1724	1 mm
Front Right	165/70R14	81T	Goodyear	Assurance	V	1724	2 mm
Rear Left	165/70R14	81T	Goodyear	Assurance	V	1624	2 mm
Rear Right	165/70R14	81T	Goodyear	Assurance	V	1724	2 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALB251ALSM558370



CONDITION REPORT



Report No:
2017304866
DATE
29/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	DTC (4)	B1102	BATTERY VOLTAGE LOW	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. SIGNS OF REPAIR WORK DONE TO BODY PANELS. POOR ALIGNMENT TO SOMEBODY PANELS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALB251ALSM558370



CONDITION REPORT



Report No:

2017304866

DATE

29/09/2026



FRONT RIGHT CORNER



REAR LEFT CORNER



90 DEGREE FRONT



90 DEGREE REAR



90 DEGREE RIGHT



90 DEGREE LEFT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALB251ALSM558370



CONDITION REPORT



Report No:

2017304866

DATE

29/09/2026



INTERIOR (FRONT DRIVER DOOR)



Manual.



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



VIN PLATE OR STICKER



LICENSE DISC

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALB251ALSM558370



CONDITION REPORT



Report No:

2017304866

DATE

29/09/2026



ENGINE 1




Undercarriage front.




Undercarriage rear.



Oil cap and dipstick.

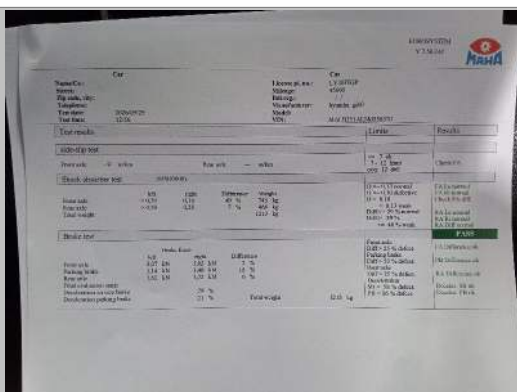

Brake test.

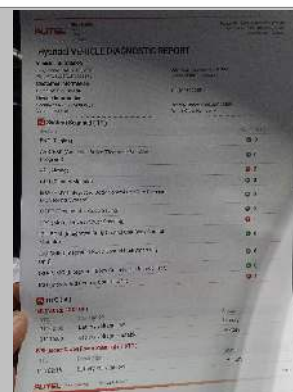

Diagnostic Report page 1

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALB251ALSM558370



CONDITION REPORT




Report No:

2017304866

DATE

29/09/2026

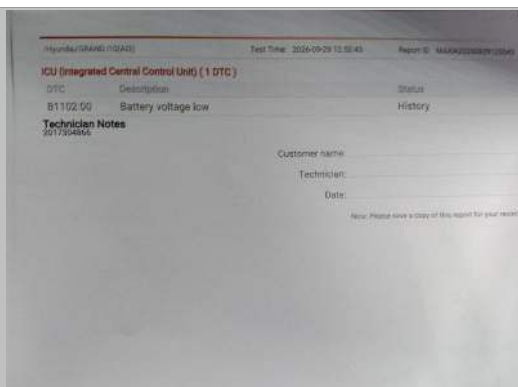

Diagnostic Report page 2



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Water level

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALB251ALSM558370



CONDITION REPORT



Report No:

2017304866

DATE

29/09/2026



Front Bumper



Front Bumper



Bonnet



Headlight Left



Headlight Right



Front Fender Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALB251ALSM558370



CONDITION REPORT



Report No:

2017304866

DATE

29/09/2026



Door Rear Left



Door Front Left



Rear bumper



Rear bumper



Boot Lid / Hatch door



Door Rear Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALB251ALSM558370



CONDITION REPORT



Report No:
2017304866
DATE
29/09/2026



Door Front Right



Windscreen

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALB251ALSM558370