



CONDITION REPORT



Report No:
2017304946
DATE
29/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	29/09/2026		M57 Pretoria Road - 1619
Inspection Date	29/09/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	HYUNDAI	Registration Number	KB40JBGP
Model	I20 1.2 MOTION 5-DR [2021-2024]	Register Number	
VIN	MALBG512LNM068877	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	
Color	WHITE	Power / Displacement	
Year Model	2021	Paint Finish	C - COMMON
Km Reading	112,135 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALBG512LNM068877



CONDITION REPORT




Report No:
2017304946
DATE
29/09/2026

Damage

Repair Way

Engine Oil Sweat	Repair
Seat Front Right Torn / Cut	Repair
Side Mirror Left Paintwork • Scratched	Repair
Front Bumper Paintwork • Scratched	Repair
Door Front Right Paintwork • Scratched	Repair
Boot Lid / Hatch door Paintwork • Dull	Repair
Rear bumper Paintwork • Scratched	Repair
Tyre Front Left Smooth	Replace
Body exterior	Signs of spray work done on body panels

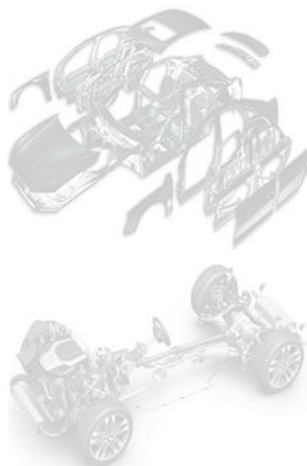

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.1	2.8	-	
Rear	1.9	1.8	-	
Emergency / Parking	1.2	1.3	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	185/65R15	88H	Bridgestone	Nexen	V	1221	0 mm
Front Right	185/65R15	88H	Nexen	Ecopia	V	1221	6 mm
Rear Left	185/65R15	88H	Double star	Maximu	V	4822	1 mm
Rear Right	185/65R15	92T	Nexen	Nblue	V	4024	6 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALBG512LNM068877



CONDITION REPORT



Report No:
2017304946
DATE
29/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	MOTOR DRIVEN POWER STEERING	C1102:16	BATTERY VOLTAGE LOW	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALBG512LNM068877



CONDITION REPORT



Report No:

2017304946

DATE

29/09/2026



FRONT RIGHT CORNER



REAR LEFT CORNER



90 DEGREE RIGHT



90 DEGREE LEFT



90 DEGREE REAR



90 DEGREE FRONT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALBG512LNM068877



CONDITION REPORT



Report No:
2017304946
DATE
29/09/2026



ODOMETER



DASHBOARD (W/ ENGINE RUNNING)



INTERIOR (FRONT DRIVER DOOR)



Manual transmission



LF TYRE TREAD



LR TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALBG512LNM068877



CONDITION REPORT



Report No:
2017304946
DATE
29/09/2026



RF TYRE TREAD



RR TYRE TREAD



No sparewheel



Oil cap and dipstick



Coolant reservoir



REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALBG512LNM068877



CONDITION REPORT



Report No:

Report No.
2017304946

DATE _____

29/09/2026



ENGINE 1



CHASSIS




ENGINE 2



VIN PLATE OR STICKER



LICENSE DISC

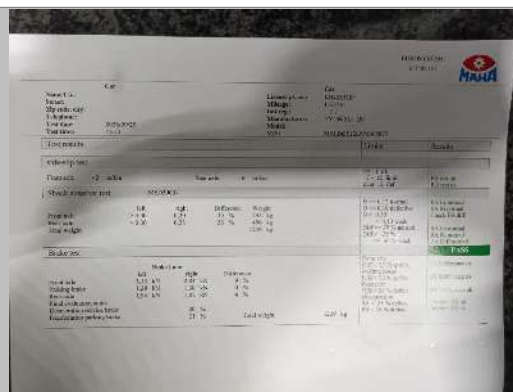

SHOCK AND BRAKE REPORT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALBG512LNM068877



CONDITION REPORT




Report No:


2017304946

DATE

29/09/2026

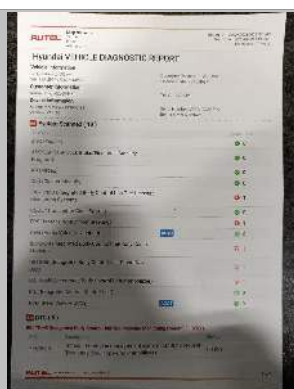

DIAGNOSTIC REPORT PAGE 1

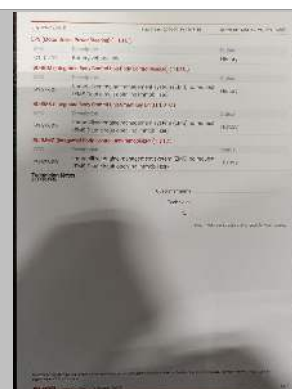

DIAGNOSTIC REPORT PAGE 2



Door Front Right



Seat Front Right



Rear bumper



Rear bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALBG512LNM068877



CONDITION REPORT



Report No:

2017304946

DATE

29/09/2026




Boot Lid / Hatch door



Side Mirror Left



Front Bumper

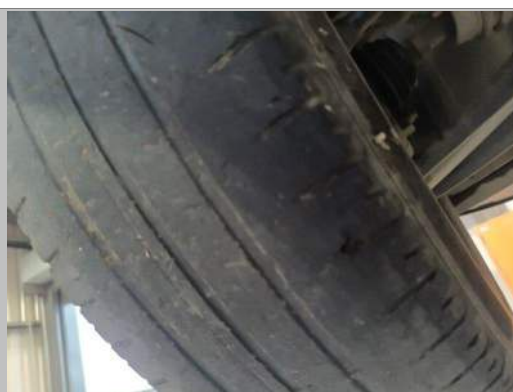

Tyre Front Left



Engine

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALBG512LNM068877