



CONDITION REPORT



Report No:
2017302490
DATE
23/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	23/09/2026		M57 Pretoria Road - 1619
Inspection Date	23/09/2026		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	
Manufacturer	HYUNDAI	Registration Number	LMJ455MP
Model	I20	Register Number	
VIN	MALBG512LTM378057	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	28/02/2027
Color	SILVER	Power / Displacement	
Year Model		Paint Finish	TWO COAT UNI
Km Reading	36,212 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALBG512LTM378057



CONDITION REPORT



Report No:

2017302490

DATE

23/09/2026

Damage

Repair Way

Seat Front Left Dirty	Repair
Seat Front Right Dirty	Repair
Seat Rear Dirty	Repair
Bonnet Paintwork • Chipmarks	Repair
Windscreen Cracked	Replace
Engine to silencer pipe Welded	Replace
Rear bumper stiffener damaged	Replace



Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.11	2.0	-	
Rear	1.76	1.43	-	
Emergency / Parking	1.49	1.39	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	185/65 R15	88H	Bridgestone	Ecopia	V	2525	4 mm
Front Right	185/65 R15	88H	Bridgestone	Ecopia	V	2525	4 mm
Rear Left	185/65 R15	88H	Bridgestone	Ecopia	V	2525	4 mm
Rear Right	185/65 R15	88H	Bridgestone	Ecopia	V	2525	4 mm
Spare	185/65 R15	88H	Bridgestone	Ecopia	V	2525	6 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALBG512LTM378057

**CONDITION REPORT**

Report No:
2017302490
DATE
23/09/2026

Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Minor dents and scratches on body panels

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALBG512LTM378057




CONDITION REPORT



Report No:
2017302490
DATE
23/09/2026

GALATIANS 3:1-14											
Name: _____										Date: _____	
Age: _____										Sex: _____	
Address: _____										City: _____	
Phone: _____										State: _____	
Occupation: _____										Religion: _____	
Marital Status: _____										Children: _____	
Education: _____										Income: _____	
Social Security Number: _____										Medical History: _____	
Current Medications: _____										Allergies: _____	
Family History: _____										Lifestyle: _____	
Current Health Status: _____										Recommendations: _____	
Signature: _____										Date: _____	

Brake and shock absorber report

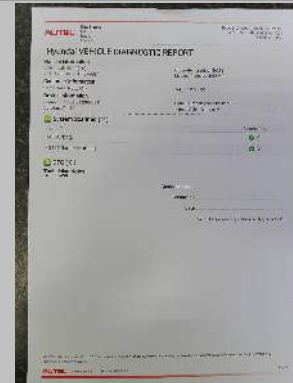

Diagnostic report



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALBG512LTM378057



CONDITION REPORT



Report No:

2017302490

DATE

23/09/2026



ODOMETER



Manual Transmission



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALBG512LTM378057



CONDITION REPORT



Report No:
2017302490
DATE
23/09/2026



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Spare Wheel and Accessories



LICENSE DISC

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALBG512LTM378057



CONDITION REPORT



Report No:

2017302490

DATE

23/09/2026



VIN PLATE OR STICKER



ENGINE 1



Front chassis



Rear chassis



Rear bumper stiffener



Oil cap and dipstick

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALBG512LTM378057



CONDITION REPORT



Report No:
2017302490
DATE
23/09/2026



Seat Rear



Seat Front Right



Seat Front Left



Windscreen



Bonnet



Bonnet

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALBG512LTM378057



CONDITION REPORT



Report No:
2017302490
DATE
23/09/2026



Water level



Engine to silencer pipe



Water level

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALBG512LTM378057