



CONDITION REPORT



Report No:
2017304144
DATE
28/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	28/09/2026		M57 Pretoria Road - 1619
Inspection Date	28/09/2026		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	HYUNDAI	Registration Number	JTJ408MP
Model	I20 1.2 MOTION 5-DR [2018-2021]	Register Number	
VIN	MALBM51BLKM549636	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	30/09/2026
Color	GREY	Power / Displacement	
Year Model	2019	Paint Finish	M - METALLIC
Km Reading	124,375 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALBM51BLKM549636



CONDITION REPORT



Report No:

2017304144

DATE

28/09/2026

Damage

Repair Way

Seat Rear Dirty	Repair
Front Bumper Paintwork • Scratched	Repair
Rear Fender Right Dented	Repair
Door Front Left Paintwork • Scratched	Repair
Door Rear Left Paintwork • Scratched	Repair
Rear bumper Damaged	Repair
Tyre Front Left Smooth	Replace



Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.7	3.3	-	
Rear	2.1	2.3	-	
Emergency / Parking	1.3	1.1	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	185/70R14	88H	Royal	Mile	V	4321	2 mm
Front Right	185/70R14	88H	Royal	Mile	V	4321	0 mm
Rear Left	185/70R14	88H	Royal	Mile	V	4321	3 mm
Rear Right	185/70R14	88T	Goodyear	Assurance	V	1518	2 mm
Spare	185/70R14	88H	Royal black	Mile	V	0000	6 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALBM51BLKM549636

**CONDITION REPORT**

Report No:
2017304144
DATE
28/09/2026

Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Residual traces of poor repair on body panels. Signs of spray work done on body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALBM51BLKM549636



CONDITION REPORT



Report No:
2017304144
DATE
28/09/2026

Vehicle Information			
Brand/Model	Year	Engine/Power	Color
Hyundai i20	2017	1.4L 100kW	Black
Registration	Test Date	Test Mileage	Test Station
3TJ 468	28/09/2026	12,500	DEKRA
Shock and Brake Report			
Wheel	Direction	Findings	Remarks
Front Left	Steering	100% OK	Good
Front Right	Steering	100% OK	Good
Rear Left	Steering	100% OK	Good
Rear Right	Steering	100% OK	Good
Front Left	Braking	100% OK	Good
Front Right	Braking	100% OK	Good
Rear Left	Braking	100% OK	Good
Rear Right	Braking	100% OK	Good

Shock and brake report

Hyundai Vehicle Diagnostic Report	
Vehicle ID	3TJ 468
Engine/Power	1.4L 100kW
Transmission	5-Speed Manual
Drive Type	Front Wheel Drive
Test Date	28/09/2026
Test Station	DEKRA
Diagnostic Results	
Engine	100% OK
Transmission	100% OK
Brake System	100% OK
Steering System	100% OK
Lighting System	100% OK
Washers/Wipers	100% OK
Exhaust System	100% OK
Chassis/Frame	100% OK
Body/Exterior	100% OK
Interior/Seating	100% OK
Electrical System	100% OK
Overall Condition	100% OK

Diagnostics report



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALBM51BLKM549636



CONDITION REPORT



Report No:
2017304144
DATE
28/09/2026



ODOMETER



Manual transmission



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: MALBM51BLKM549636



CONDITION REPORT



Report No:
2017304144
DATE
28/09/2026

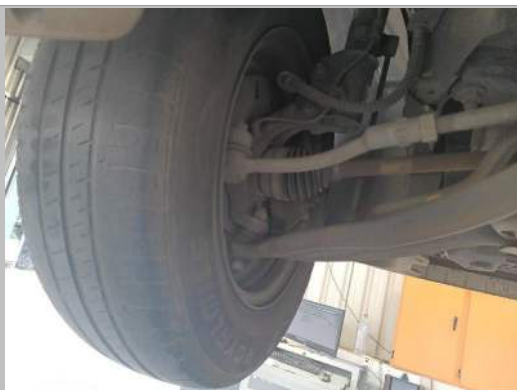

LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Sparewheel



LICENSE DISC

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALBM51BLKM549636



CONDITION REPORT



Report No:
2017304144
DATE
28/09/2026



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS



REAR



Coolant reservoir

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALBM51BLKM549636



CONDITION REPORT




Report No:


2017304144

DATE

28/09/2026

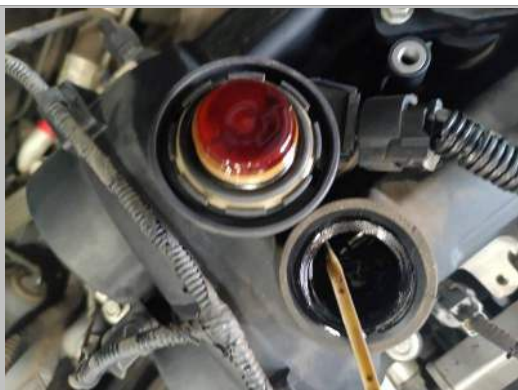

Oil cap and dipstick

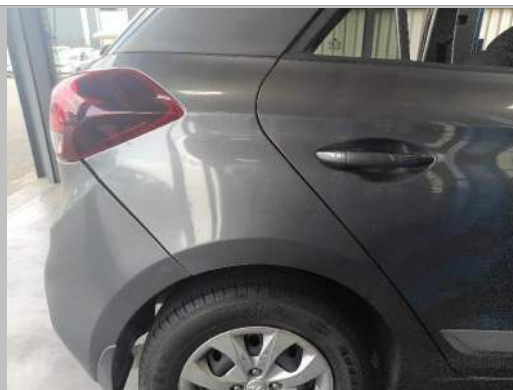

Rear Fender Right



Door Rear Left



Door Front Left



Front Bumper



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALBM51BLKM549636



CONDITION REPORT




Report No:

2017304144

DATE

28/09/2026

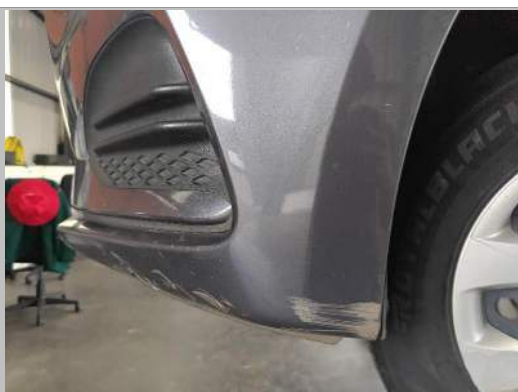

Front Bumper



Tyre Front Left



Rear bumper



Rear bumper



Rear bumper




Rear bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALBM51BLKM549636

**CONDITION REPORT**

Report No:
2017304144
DATE
28/09/2026

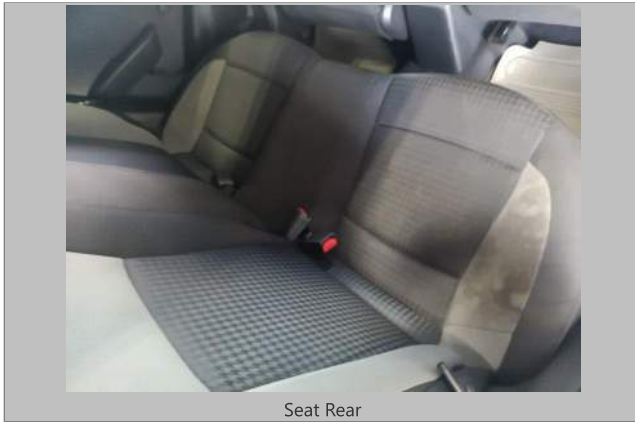

Seat Rear

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALBM51BLKM549636