



CONDITION REPORT



Report No:

2017304875

DATE

29/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	29/09/2026		M57 Pretoria Road - 1619
Inspection Date	29/09/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	
Manufacturer	HYUNDAI	Registration Number	KB23VZGP
Model	VENUE 1.0 88KW TGDI MOTION INFOTAINMENT [2020-2023]	Register Number	
VIN	MALFB81ALMM169828	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	30/04/2027
Color	SILVER	Power / Displacement	
Year Model	2021	Paint Finish	M - METALLIC
Km Reading	76,612 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALFB81ALMM169828



CONDITION REPORT



Report No:

2017304875

DATE

29/09/2026

Damage

Repair Way

Windscreen Wiper Worn	Replace
Front Bumper Residual Traces of Repair	Repair
Front Fender Left Dented	Repair
Front Fender Right Residual Traces of Repair	Repair
Rear Fender Left Dented	Repair
Door Front Right Paintwork • Scratched	Repair
Door Rear Right Paintwork • Scratched	Repair
Rear bumper Paintwork • Scratched	Repair
Windscreen Cracked	Replace
Spare Tyre Smooth	Replace
Rim Front Right Deformed	Repair
Warning lights illuminated	Repair



Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.6	2.7	-	
Rear	1.8	1.8	-	
Emergency / Parking	1.4	1.4	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	195/65R15	91H	Goodyear	Assurance	V	0221	6 mm
Front Right	195/65R15	91H	Goodyear	Assurance	V	0221	0 mm
Rear Left	195/65R15	91H	Goodyear	Assurance	V	02221	3 mm
Rear Right	195/65R15	91H	Goodyear	Assurance	V	0221	3 mm
Spare	185/65R15	91H	Goodyear	Assurance	V	0000	0 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALFB81ALMM169828



CONDITION REPORT



Report No:

2017304875

DATE

29/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	MOTOR DRIVEN POWER STEERING	C1102:16	BATTERY VOLTAGE LOW	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. BODY EXTERIOR - SIGNS OF SPRAY WORK DONE ON BODY PANELS / BOTTOM OF ENGINE IS FULLY COVERED

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALFB81ALMM169828



CONDITION REPORT



Report No:

2017304875

DATE

29/09/2026



FRONT RIGHT CORNER



REAR LEFT CORNER



90 DEGREE FRONT



90 DEGREE REAR



90 DEGREE RIGHT



90 DEGREE LEFT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALFB81ALMM169828



CONDITION REPORT



Report No:
2017304875
DATE
29/09/2026



INTERIOR (FRONT DRIVER DOOR)



Manual transmission



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



VIN PLATE OR STICKER



LICENSE DISC

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALFB81ALMM169828



CONDITION REPORT



Report No:

2017304875

DATE

29/09/2026



ENGINE 1



ENGINE 2



CHASSIS



REAR



Oil cap and dipstick



Expansion bottle

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALFB81ALMM169828



CONDITION REPORT



Report No:
2017304875
DATE
29/09/2026




LF TYRE TREAD



RF TYRE TREAD




LR TYRE TREAD

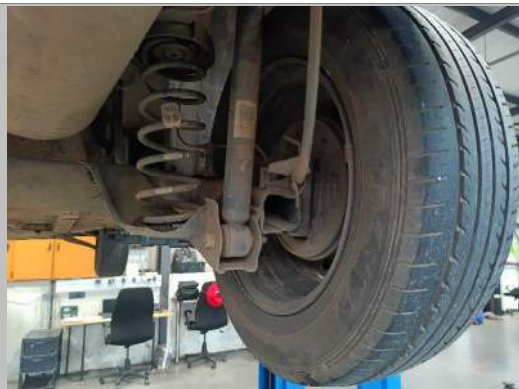

RR TYRE TREAD



Sparewheel

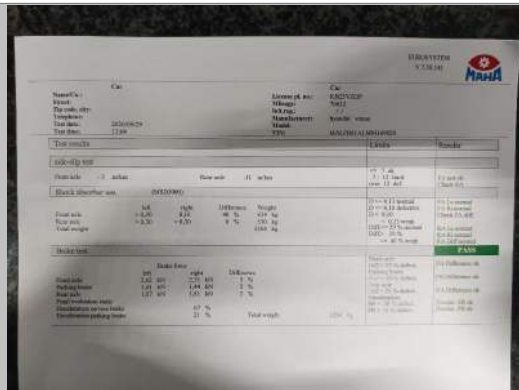

Shock and brake report

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: MALFB81ALMM169828




CONDITION REPORT




Report No:
2017304875
DATE
29/09/2026

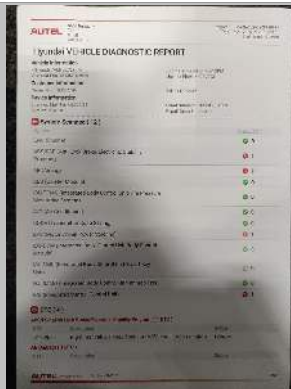

Diagnostics report

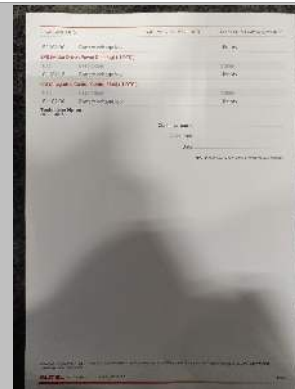

Diagnostics report

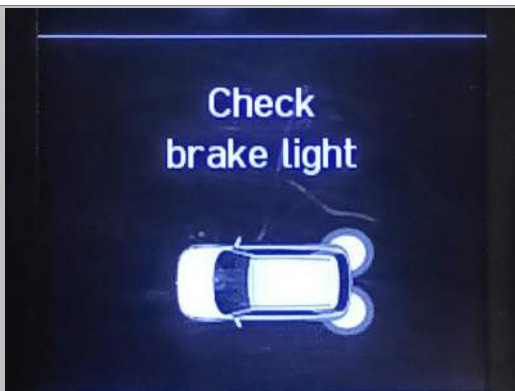

Warning lights illuminated



Warning lights illuminated



Front Fender Right



Door Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALFB81ALMM169828




CONDITION REPORT



Report No:
2017304875
DATE
29/09/2026



Door Rear Right

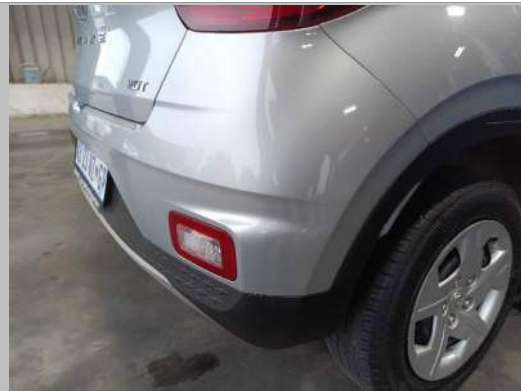

Rear bumper



Rear bumper



Rear Fender Left



Spare Tyre



Front Fender Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALFB81ALMM169828



CONDITION REPORT



Report No:

2017304875

DATE

29/09/2026



Windscreen



Windscreen Wiper



Rim Front Right



Front Bumper



Front Bumper



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALFB81ALMM169828