



CONDITION REPORT



Report No:
2017303145
DATE
25/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	25/09/2026		M57 Pretoria Road - 1619
Inspection Date	25/09/2026		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	
Manufacturer	HYUNDAI	Registration Number	JY75HZGP
Model	VENUE 1.0 TGD I FLUID [2019-2023]	Register Number	
VIN	MALFC81ALLM101977	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	
Color	BLUE	Power / Displacement	
Year Model	2021	Paint Finish	TWO COAT METALLIC
Km Reading	164,158 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALFC81ALLM101977



CONDITION REPORT



Report No:

2017303145

DATE

25/09/2026

Damage

Repair Way

Seat Front Right Torn / Cut	Repair
Steering Wheel Trim Torn / Cut	Repair
Front Bumper Paintwork • Scratched	Repair
Bonnet Paintwork • Chipmarks	Repair
Front Fender Right Paintwork • Scratched	Repair
Door Front Left Dented	Repair
Door Rear Left Dented	Repair
Door Rear Right Paintwork • Scratched	Repair
Boot Lid / Hatch door Paintwork • Scratched	Repair
Windscreen Cracked	Replace
CV Joint(s) Boot(s) Front Left (inner/outer) Damaged	Replace
Body exterior	Signs of spray work done on body panels
Body exterior	Minor dents scratches stone chips on body panels
Engine	Bottom of engine is fully covered



Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.1	2.4	-	
Rear	1.8	1.5	-	
Emergency / Parking	1.2	1.5	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	215/60R16	95V	Bridgestone	Turanza	V	0718	2 mm
Front Right	215/60R16	95V	Bridgestone	Turanza	V	0718	3 mm
Rear Left	205/60R16	92H	Dunlop	Sport	V	2622	1 mm
Rear Right	215/60R16	95V	Dunlop	Ensava	V	3519	1 mm
Spare	195/65R15	91H	Hankook	Kinergy	V	0000	6 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALFC81ALLM101977



CONDITION REPORT



Report No:
2017303145
DATE
25/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	AIRBAG	B1102:00	BATTERY VOLTAGE LOW	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO AGE AND MILEAGE OF VEHICLE NORMAL WEAR AND TEAR ON INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALFC81ALLM101977



CONDITION REPORT



Report No:
2017303145
DATE
25/09/2026




Manual transmission

Car				Car			
Name/Ch:				Client/pt. no.:			
Street:				Address:			
City/State/Post:				City/State/Post:			
Tel/fax:				Tel/fax:			
E-mail:				E-mail:			
VIN:				VIN:			
1. Test results				2. Results			
3. Shock absorber test				4. Results			
5. Brake test				6. Results			

Shock and brake report



Diagnostics report

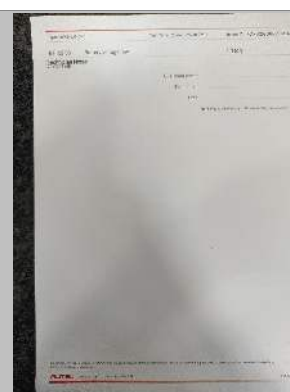

Diagnostics report



Sparewheel



Oil cap and dipstick

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALFC81ALLM101977



CONDITION REPORT



Report No:

2017303145

DATE

25/09/2026



Expansion bottle



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALFC81ALLM101977



CONDITION REPORT



Report No:

2017303145

DATE

25/09/2026



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALFC81ALLM101977



CONDITION REPORT



Report No:
2017303145
DATE
25/09/2026




RR TYRE TREAD




RF TYRE TREAD



LICENSE DISC

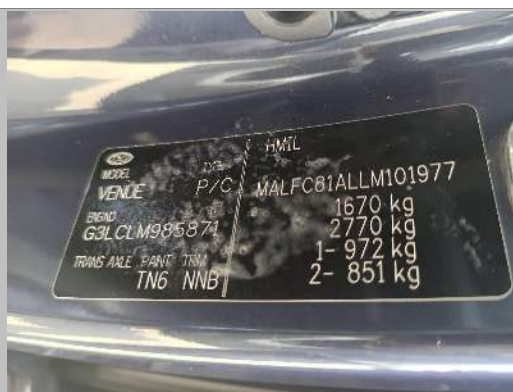

VIN PLATE OR STICKER

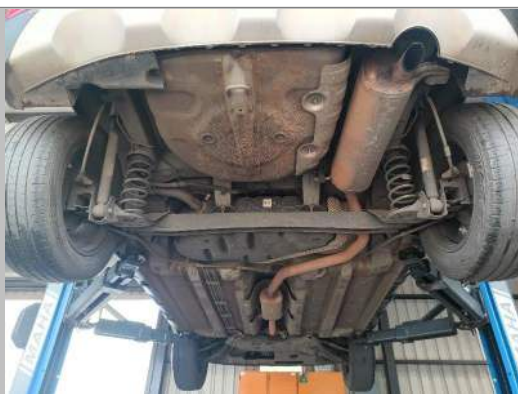

REAR



ENGINE 1

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALFC81ALLM101977



CONDITION REPORT



Report No:
2017303145
DATE
25/09/2026



CHASSIS



ENGINE 2



Seat Front Right



Steering Wheel Trim



Front Fender Right



Door Rear Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALFC81ALLM101977



CONDITION REPORT



Report No:
2017303145
DATE
25/09/2026




Boot Lid / Hatch door



Door Rear Left



Door Front Left

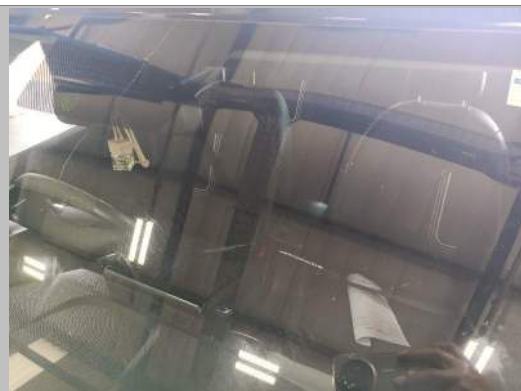

Windscreen



Bonnet



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALFC81ALLM101977



CONDITION REPORT



Report No:
2017303145
DATE
25/09/2026



Front Bumper



CV Joint(s) Boot(s) Front Left (inner/outer)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALFC81ALLM101977