



CONDITION REPORT



Report No:

2017303182

DATE

25/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	25/09/2026		M57 Pretoria Road - 1619
Inspection Date	25/09/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	TATA	Registration Number	HNK317L
Model	TIAGO	Register Number	
VIN	MAT626601SKR89587	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/12/2026
Color	WHITE	Power / Displacement	
Year Model		Paint Finish	TWO COAT UNI
Km Reading	29,813 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MAT626601SKR89587



CONDITION REPORT



Report No:

2017303182


DATE

25/09/2026

Damage

Repair Way

Seat Front Left Dirty	Repair
Seat Front Right Dirty	Repair
Seat Rear Dirty	Repair
Number Plate Rear Defective	Replace
Side Mirror Right Damaged	Repair
Grill Damaged	Replace
Bonnet Paintwork • Chipmarks	Repair
Front Fender Left Dented	Repair
Inner Boot Floor Pan and Spare Wheel Well Damaged	Repair
Windscreen Cracked	Replace
Deceleration parking brake defective	Repair

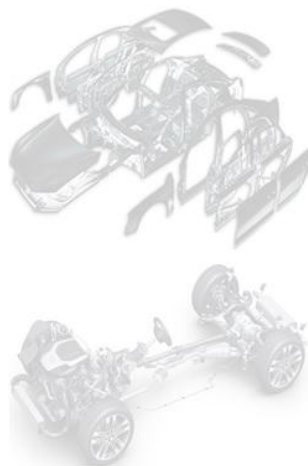

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.37	2.35	-	
Rear	1.36	1.52	-	
Emergency / Parking	0.82	1.05	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	175/65 R14	86T	Apollo	Amazer	V	4425	3 mm
Front Right	175/65 R14	86T	Apollo	Amazer	V	4525	3 mm
Rear Left	175/65 R14	86T	Apollo	Amazer	V	4525	5 mm
Rear Right	175/65 R14	86T	Apollo	Amazer	V	4425	4 mm
Spare	155/80 R13	79T	Annaite	Annaite	V	0126	6 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: MAT626601SKR89587



CONDITION REPORT



Report No:
2017303182
DATE
25/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	EMS(ENGINE MANAGEMENT SYSTEM)	P0328-85	DTC DESCRIPTION NOT AVAILABLE	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Minor dents and scratches on body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MAT626601SKR89587



CONDITION REPORT



Report No:

Report No.
2017303182

DATE _____

25/09/2026

[illegible]

Brake and shock absorber report

[illegible]

Diagnostic report



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MAT626601SKR89587



CONDITION REPORT



Report No:

2017303182

DATE

25/09/2026



ODOMETER



Manual Transmission



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MAT626601SKR89587



CONDITION REPORT



Report No:

2017303182

DATE


25/09/2026




LF TYRE TREAD



LR TYRE TREAD

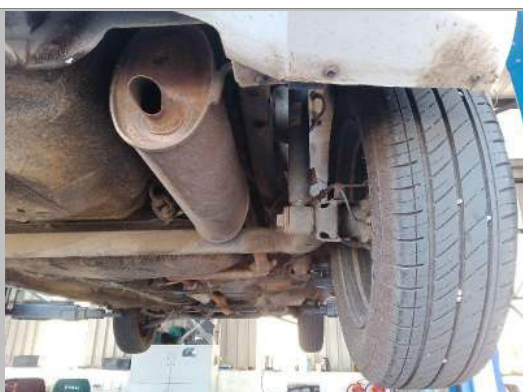

RR TYRE TREAD

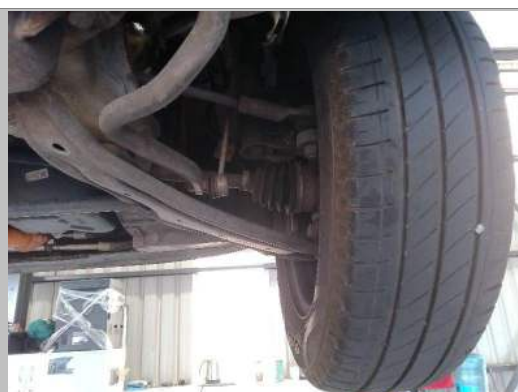

RF TYRE TREAD



Spare Wheel and Accessories



LICENSE DISC

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MAT626601SKR89587



CONDITION REPORT



Report No:
2017303182
DATE
25/09/2026



VIN PLATE OR STICKER



ENGINE 1



Front chassis



Rear chassis



Oil cap and dipstick



Seat Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MAT626601SKR89587



CONDITION REPORT



Report No:
2017303182
DATE
25/09/2026



Seat Rear



Bonnet



Bonnet



Windscreen



Front Fender Left



Seat Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MAT626601SKR89587



CONDITION REPORT



Report No:

2017303182

DATE

25/09/2026



Seat Rear



Number Plate Rear



Inner Boot Floor Pan and Spare Wheel Well



Side Mirror Right



Water level



Grill

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MAT626601SKR89587



CONDITION REPORT



Report No:
2017303182
DATE
25/09/2026



Inner Boot Floor Pan and Spare Wheel Well



Inner Boot Floor Pan and Spare Wheel Well



Water level

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MAT626601SKR89587