



CONDITION REPORT



Report No:
2017302363
DATE
22/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	22/09/2026		M57 Pretoria Road - 1619
Inspection Date	22/09/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	SUZUKI	Registration Number	KP95RFGP
Model	SWIFT 1.2i GA 5-DR [2018-2021]	Register Number	
VIN	MBHCZC63S00462931	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/07/2027
Color	SILVER	Power / Displacement	
Year Model	2019	Paint Finish	TWO COAT UNI
Km Reading	74,158 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: MBHCZC63S00462931



CONDITION REPORT



Report No:
2017302363
DATE
22/09/2026

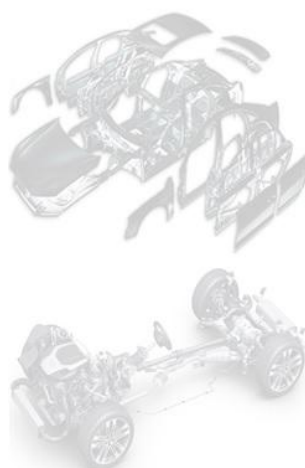

Damage	Repair Way
Windscreen Wiper Damaged	Replace
Bonnet Dented	Repair
B • Pillar Left Dented	Repair
B • Pillar Right Dented	Repair
C • Pillar Left Dented	Repair
C • Pillar Right Dented	Repair
Front Fender Left Residual Traces of Repair	Repair
Front Fender Right Residual Traces of Repair	Repair
Rear Fender Left Dented	Repair
Door Front Right Dented	Repair
Door Rear Left Dented	Repair
Boot Lid / Hatch door Dented	Repair
Rear bumper Paintwork • Scratched	Repair
Roof Dented	Repair
Windscreen Chipped	Repair
Shock Absorber Front Right Sweat	Replace
Shock Absorber Rear Right Sweat	Replace
Stabilizer Mounting Front Left Defective	Replace
Stabilizer Mounting Front Right Defective	Replace
Main Beam Right Residual Traces of Repair	Repair
Chassis Damaged	Repair
Sub Frame Damaged	Replace
Belly plates Damaged	Repair
Triangle Missing	Replace
Front bumper stiffener damaged	Replace

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.15	2.71	-	
Rear	1.25	1.48	-	
Emergency / Parking	0.94	0.99	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	165/80 R14	85T	Apollo	Amazer	V	3825	5 mm
Front Right	165/80 R14	85T	Apollo	Amazer	V	3825	5 mm
Rear Left	165/80 R14	85T	Apollo	Amazer	V	5126	3 mm
Rear Right	165/80 R14	85%T	Apollo	Amazer	V	5223	4 mm
Spare	T135/70 R15	99M	Jk tyre	Temporary	V	2219	4 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MBHCZC63S00462931



CONDITION REPORT



Report No:
2017302363
DATE
22/09/2026

Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Residual traces of repair on body panels. Body panels misaligned. Stone chips and spray work on body panels. Dents and scratches on body panels. Signs of hail damage on body panels. Signs of impact damage to front of vehicle.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MBHCZC63S00462931



CONDITION REPORT



Report No:
2017302363
DATE
22/09/2026

Vehicle Information			
Make/Model	Year	Engine/Power	Registration
Suzuki Swift	2017	1.2L 8000W	MBHCZC63S00462931
Chassis No.	Engine No.	Transmission	Color
123456789	987654321	Manual	White
Brake and Shock Absorber Report			
Front Right	Front Left	Rear Right	Rear Left
Brake Pads: 100%	Brake Pads: 100%	Brake Pads: 100%	Brake Pads: 100%
Shock Absorbers: 100%	Shock Absorbers: 100%	Shock Absorbers: 100%	Shock Absorbers: 100%
Steering: 100%	Steering: 100%	Steering: 100%	Steering: 100%
Wheels/Tyres: 100%	Wheels/Tyres: 100%	Wheels/Tyres: 100%	Wheels/Tyres: 100%
Overall Condition: 100%	Overall Condition: 100%	Overall Condition: 100%	Overall Condition: 100%

Brake and shock absorber report

General Vehicle Diagnostic Report	
Engine	1.2L 8000W
Transmission	Manual
Brake System	100%
Shock Absorbers	100%
Steering	100%
Wheels/Tyres	100%
Overall Condition	100%

Diagnostic report



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MBHCZC63S00462931



CONDITION REPORT



Report No:

2017302363

DATE

22/09/2026



ODOMETER



Manual Transmission



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MBHCZC63S00462931



CONDITION REPORT



Report No:
2017302363
DATE
22/09/2026



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Spare Wheel Accessories



Spare Wheel

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MBHCZC63S00462931



CONDITION REPORT



Report No:

2017302363

DATE

22/09/2026



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



Front chassis



Rear chassis



Oil cap and dipstick

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MBHCZC63S00462931



CONDITION REPORT



Report No:

2017302363

DATE

22/09/2026



Front bumper stiffener



Front Fender Right



Boot Lid / Hatch door



Rear bumper



Rear bumper



Roof

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MBHCZC63S00462931



CONDITION REPORT



Report No:
2017302363
DATE
22/09/2026



Rear Fender Left



Door Rear Left



Front Fender Left



Windscreen Wiper



Bonnet



Door Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MBHCZC63S00462931



CONDITION REPORT



Report No:
2017302363
DATE
22/09/2026



Water level



Belly plates



Sub Frame



Sub Frame



Chassis



Chassis

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MBHCZC63S00462931



CONDITION REPORT



Report No:

2017302363

DATE

22/09/2026



Stabilizer Mounting Front Left



Stabilizer Mounting Front Right



Main Beam Right



Shock Absorber Front Right



Shock Absorber Rear Right



Water level

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MBHCZC63S00462931



CONDITION REPORT



Report No:
2017302363
DATE
22/09/2026



B • Pillar Right



C • Pillar Right



C • Pillar Left



B • Pillar Left



Windscreen

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MBHCZC63S00462931