



CONDITION REPORT



Report No:
2017305123
DATE
30/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	30/09/2026		M57 Pretoria Road - 1619
Inspection Date	30/09/2026		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	SUZUKI	Registration Number	HJK145L
Model	SWIFT 1.2i GA 5-DR [2021-2025]	Register Number	
VIN	MBHCZC63S00A72751	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/01/2027
Color	SILVER	Power / Displacement	
Year Model	2023	Paint Finish	TWO COAT UNI
Km Reading	97,417 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MBHCZC63S00A72751



CONDITION REPORT



Report No:

2017305123

DATE

30/09/2026

Damage

Repair Way

Engine Oil Leak	Repair
Radio/CD/USB Defective	Repair
Carpet Rear Damaged	Repair
Front Bumper Paintwork • Scratched	Repair
C • Pillar Right Damaged	Repair
Front Fender Left Dented	Repair
Front Fender Right Dented	Repair
Rear Fender Left Dented	Repair
Door Rear Left Defective	Repair
Rear bumper Damaged	Repair
Tyre Front Left Defective	Replace
Sub Frame Dented	Repair
Belly plates Damaged	Repair
Fuel Tank Damaged	Repair
Deceleration parking brake defective	Repair
Center exhaust cross member bracket damaged	Repair



Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.47	2.51	-	
Rear	1.2	1.41	-	
Emergency / Parking	0.83	0.92	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	165/80 R14	85T	Apollo	Amazer	V	4124	1 mm
Front Right	165/80 R14	85T	Apollo	Amazer	V	2922	1 mm
Rear Left	165/80 R14	85T	Apollo	Amazer	V	2622	1 mm
Rear Right	165/80 R14	85T	Apollo	Amazer	V	4224	2 mm
Spare	T135/70 R15	99M	Jk tyre	Temporary	V	2322	3 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: MBHCZC63S00A72751



CONDITION REPORT



Report No:
2017305123
DATE
30/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ABS/ESP(ANTI-LOCK BRAKING SYSTEM/ELECTRONIC STABIL	C1037	STEERING ANGLE SENSOR POWER SUPPLY VOLTAGE	

Inspection Conditions

No Test Drive
Rain at time of inspection
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Dents and scratches on body panels

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MBHCZC63S00A72751



CONDITION REPORT



Report No:
2017305123
DATE
30/09/2026

Vehicle Data		Vehicle Data	
Make/Model	Car	Year	2017
Registration	MBH	Engine	1.8L
Test date	2026/09/28	Test time	14:00
Test location	DEKRA	Test technician	MBH
Type results			
Brake and shock absorber		Brake and shock absorber	
Front left	OK	Front right	OK
Back left	OK	Back right	OK
Shock absorber			
Front left	OK	Front right	OK
Back left	OK	Back right	OK
Brake disc			
Front left	OK	Front right	OK
Back left	OK	Back right	OK
Brake pads			
Front left	OK	Front right	OK
Back left	OK	Back right	OK
Brake fluid			
Front left	OK	Front right	OK
Back left	OK	Back right	OK
Brake lines			
Front left	OK	Front right	OK
Back left	OK	Back right	OK
Brake master cylinder			
Front left	OK	Front right	OK
Back left	OK	Back right	OK
Brake booster			
Front left	OK	Front right	OK
Back left	OK	Back right	OK
Brake pedal			
Front left	OK	Front right	OK
Back left	OK	Back right	OK
Brake master cylinder			
Front left	OK	Front right	OK
Back left	OK	Back right	OK
Brake booster			
Front left	OK	Front right	OK
Back left	OK	Back right	OK
Brake pedal			
Front left	OK	Front right	OK
Back left	OK	Back right	OK

Brake and shock absorber report

Vehicle Data		Vehicle Data	
Make/Model	Car	Year	2017
Registration	MBH	Engine	1.8L
Test date	2026/09/28	Test time	14:00
Test location	DEKRA	Test technician	MBH
Type results			
Brake and shock absorber		Brake and shock absorber	
Front left	OK	Front right	OK
Back left	OK	Back right	OK
Shock absorber			
Front left	OK	Front right	OK
Back left	OK	Back right	OK
Brake disc			
Front left	OK	Front right	OK
Back left	OK	Back right	OK
Brake pads			
Front left	OK	Front right	OK
Back left	OK	Back right	OK
Brake fluid			
Front left	OK	Front right	OK
Back left	OK	Back right	OK
Brake lines			
Front left	OK	Front right	OK
Back left	OK	Back right	OK
Brake master cylinder			
Front left	OK	Front right	OK
Back left	OK	Back right	OK
Brake booster			
Front left	OK	Front right	OK
Back left	OK	Back right	OK
Brake pedal			
Front left	OK	Front right	OK
Back left	OK	Back right	OK

Diagnostic report page 1

Vehicle Data		Vehicle Data	
Make/Model	Car	Year	2017
Registration	MBH	Engine	1.8L
Test date	2026/09/28	Test time	14:00
Test location	DEKRA	Test technician	MBH
Type results			
Brake and shock absorber		Brake and shock absorber	
Front left	OK	Front right	OK
Back left	OK	Back right	OK
Shock absorber			
Front left	OK	Front right	OK
Back left	OK	Back right	OK
Brake disc			
Front left	OK	Front right	OK
Back left	OK	Back right	OK
Brake pads			
Front left	OK	Front right	OK
Back left	OK	Back right	OK
Brake fluid			
Front left	OK	Front right	OK
Back left	OK	Back right	OK
Brake lines			
Front left	OK	Front right	OK
Back left	OK	Back right	OK
Brake master cylinder			
Front left	OK	Front right	OK
Back left	OK	Back right	OK
Brake booster			
Front left	OK	Front right	OK
Back left	OK	Back right	OK
Brake pedal			
Front left	OK	Front right	OK
Back left	OK	Back right	OK

Diagnostic report page 2



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MBHCZC63S00A72751



CONDITION REPORT



Report No:

2017305123

DATE

30/09/2026



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual Transmission



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MBHCZC63S00A72751



CONDITION REPORT




Report No:
2017305123
DATE
30/09/2026




90 DEGREE LEFT



LF TYRE TREAD

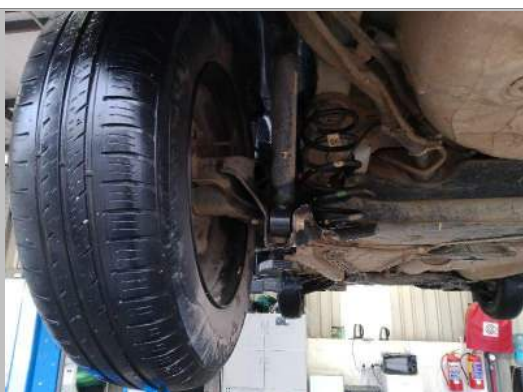

LR TYRE TREAD

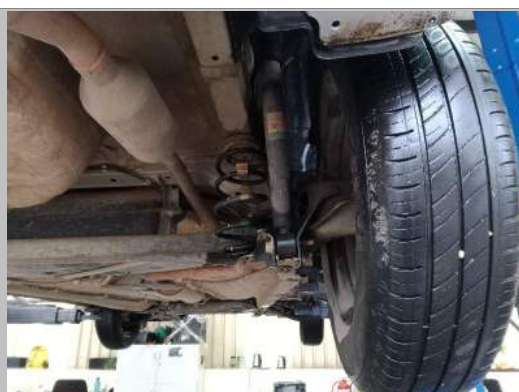

RR TYRE TREAD



RF TYRE TREAD



Spare wheel and Accessories

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MBHCZC63S00A72751



CONDITION REPORT



Report No:
2017305123
DATE
30/09/2026



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



Front chassis



Rear chassis



Oil cap and dipstick

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MBHCZC63S00A72751



CONDITION REPORT



Report No:

2017305123

DATE

30/09/2026



Center exhaust cross member br



C • Pillar Right



Carpet Rear



Rear bumper



Rear bumper



Rear Fender Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MBHCZC63S00A72751



CONDITION REPORT



Report No:

2017305123

DATE

30/09/2026



Door Rear Left



Door Rear Left



Front Fender Left



Front Fender Right



Radio/CD/USB



Water level

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MBHCZC63S00A72751



CONDITION REPORT



Report No:
2017305123
DATE
30/09/2026



Front Bumper



Front Bumper



Front Bumper



Belly plates



Belly plates



Engine

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MBHCZC63S00A72751



CONDITION REPORT



Report No:
2017305123
DATE
30/09/2026



Sub Frame



Sub Frame



Tyre Front Left



Fuel Tank



Water level

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MBHCZC63S00A72751