



CONDITION REPORT



Report No:
2017295914
DATE
08/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	08/09/2026		M57 Pretoria Road - 1619
Inspection Date	08/09/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	SUZUKI	Registration Number	MC60VLGP
Model	SWIFT 1.2 GL 5-DR [2024-ON]	Register Number	
VIN	MBHZCDESR00228062	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/03/2027
Color	WHITE	Power / Displacement	
Year Model	2025	Paint Finish	M - METALLIC
Km Reading	37,222 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: MBHZCDESR00228062



CONDITION REPORT



Report No:
2017295914
DATE
08/09/2026

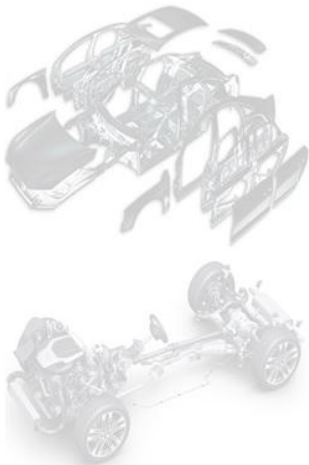

Damage	Repair Way
Front Bumper Paintwork • Scratched	Repair
Sill Panel Left Paintwork • Scratched	Repair

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.0	2.2	-	
Rear	1.2	1.7	-	
Emergency / Parking	0.9	1.2	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	165/80R14	85T	MRF	Ecotred	V	4224	5 mm
Front Right	165/80R14	85T	MRF	Ecotred	V	4324	5 mm
Rear Left	165/80R14	85T	MRF	Ecotred	V	4224	5 mm
Rear Right	165/80R14	85T	MRF	Ecotred	V	4227	5 mm
Spare	T135/70R15	99M	Jk tyre	Temporary	V	0000	6 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MBHZCDESR00228062



CONDITION REPORT



Report No:
2017295914
DATE
08/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ABS	C1161-07	PUMP MOTOR CIRCUIT	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Engine Compartment: Bottom of engine is fully covered.

Body • Exterior: Signs of spray work done on body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MBHZCDES00228062



CONDITION REPORT




Report No:
2017295914
DATE
08/09/2026

Car				Car			
Make/Model	Year	Engine (litre)	Power (kW)	Make/Model	Year	Engine (litre)	Power (kW)
Suzuki Swift	2017	1.2	55	Suzuki Swift	2017	1.2	55
Chassis no.	Engine no.	Registration	Colour	Chassis no.	Engine no.	Registration	Colour
MAHA	MAHA	MAHA	MAHA	MAHA	MAHA	MAHA	MAHA
Test results							
Visual inspection				Visual inspection			
Front axle	Left	Right	Diffusion	Front axle	Left	Right	Diffusion
Shock absorber test	2.00	2.00	2.00	Shock absorber test	2.00	2.00	2.00
Brake test	2.00	2.00	2.00	Brake test	2.00	2.00	2.00
Steering test	2.00	2.00	2.00	Steering test	2.00	2.00	2.00
Light test	2.00	2.00	2.00	Light test	2.00	2.00	2.00
Wash test	2.00	2.00	2.00	Wash test	2.00	2.00	2.00
Final weight	1.20	1.20	1.20	Final weight	1.20	1.20	1.20

Shock and brake

Car				Car			
Make/Model	Year	Engine (litre)	Power (kW)	Make/Model	Year	Engine (litre)	Power (kW)
Suzuki Swift	2017	1.2	55	Suzuki Swift	2017	1.2	55
Chassis no.	Engine no.	Registration	Colour	Chassis no.	Engine no.	Registration	Colour
MAHA	MAHA	MAHA	MAHA	MAHA	MAHA	MAHA	MAHA
Test results							
Visual inspection				Visual inspection			
Front axle	Left	Right	Diffusion	Front axle	Left	Right	Diffusion
Shock absorber test	2.00	2.00	2.00	Shock absorber test	2.00	2.00	2.00
Brake test	2.00	2.00	2.00	Brake test	2.00	2.00	2.00
Steering test	2.00	2.00	2.00	Steering test	2.00	2.00	2.00
Light test	2.00	2.00	2.00	Light test	2.00	2.00	2.00
Wash test	2.00	2.00	2.00	Wash test	2.00	2.00	2.00
Final weight	1.20	1.20	1.20	Final weight	1.20	1.20	1.20

Diagnostics report

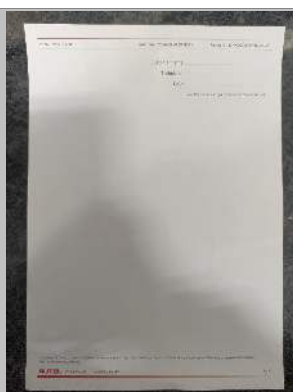

Diagnostics report



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MBHZCDES00228062



CONDITION REPORT



Report No:
2017295914
DATE
08/09/2026



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual transmission



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MBHZCDESR00228062



CONDITION REPORT



Report No:
2017295914
DATE
08/09/2026



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Sparewheel

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MBHZCDESR00228062



CONDITION REPORT



Report No:

2017295914

DATE

08/09/2026



LICENSE DISC



VIN PLATE OR STICKER




ENGINE 1



ENGINE 2



CHASSIS

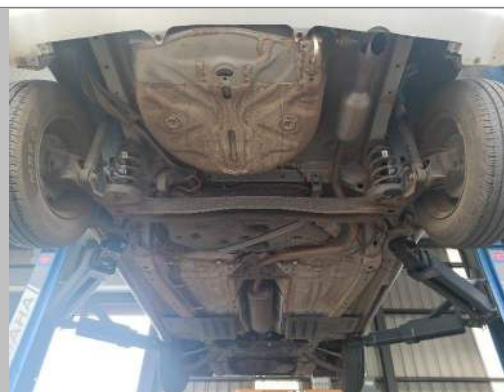

REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MBHZCDES00228062



CONDITION REPORT



Report No:
2017295914
DATE
08/09/2026



Oil cap and dipstick



Coolant reservoir



Front Bumper



Front Bumper



Sill Panel Left



Sill Panel Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MBHZCDESR00228062