



CONDITION REPORT



Report No:
2016919027
DATE
20/06/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	20/06/2025		M57 Pretoria Road - 1619
Inspection Date	20/06/2025		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	
Manufacturer	NISSAN	Registration Number	FSR481L
Model	MAGNITE TURBO 1.0T ACENTA PLUS 5-DR CVT [2021-ON]	Register Number	
		Date Of First Licensing	
VIN	MDHFBADD0Z0002148	Last COR	
Engine Number		License Expiry Date	31/12/2025
Doors	5	Power / Displacement	
Color	SILVER	Paint Finish	TWO COAT METALLIC
Year Model	2021	Fuel	PETROL
Km Reading	89,489 KM	Transmission	AUTOMATIC
Cab / Body Type	HATCHBACK		

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: MDHFBADD0Z0002148



CONDITION REPORT



Report No:
2016919027
DATE
20/06/2025

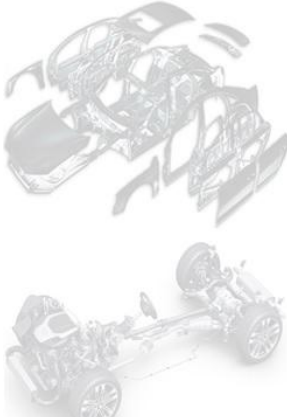	Damage	Repair Way
	Engine Management Lights Set	Repair
	Headlight Right Damaged	Replace
	Front Bumper Damaged	Repair
	Bonnet Damaged	Repair
	Front Fender Left Damaged	Repair
	Front Fender Right Damaged	Repair
	Rear Fender Left Damaged	Repair
	Rear Fender Right Damaged	Repair
	Door Front Left Damaged	Repair
	Door Front Right Damaged	Repair
	Door Rear Left Damaged	Repair
	Door Rear Right Damaged	Repair
	Boot Lid / Hatch door Damaged	Repair
	Rear bumper Damaged	Repair
	Shock Absorber Front Right Damaged	Replace
	Stabilizer Mounting Front Right Damaged	Replace
	Tyre Front Right Damaged	Replace
	Radiator Cross Member Damaged	Repair

Brakes

Brake Test Results

	Left	Right	Axle Weight [KG]	Deceleration [m/s ²]
	Braking Force [KN]	Braking Force [KN]		
Front	2.32	2.37	-	
Rear	1.43	1.34	-	
Emergency / Parking	0.92	0.79	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	195/60R16	89V	Annaite	Radial	V	0324	2 mm
Front Right	195/60R16	89V	Annaite	Radial	V	0324	2 mm
Rear Left	195/60R16	89H	MRF	Radial	V	2321	3 mm
Rear Right	195/60R16	89V	Ceat	Radial	V	3221	2 mm

* Tyre Legend: V=Virgin, R=Recap

**CONDITION REPORT**

Report No:
2016919027
DATE
20/06/2025

Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Interior: driver seat loose.
Body • Exterior: Minor dents and scratches and stone chips to some body panels. Signs of repair work done to somebody panels. Poor alignment to somebody panels. Vehicle body in poor condition.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: MDHFBADD0Z0002148




CONDITION REPORT




Report No:
2016919027
DATE
20/06/2025

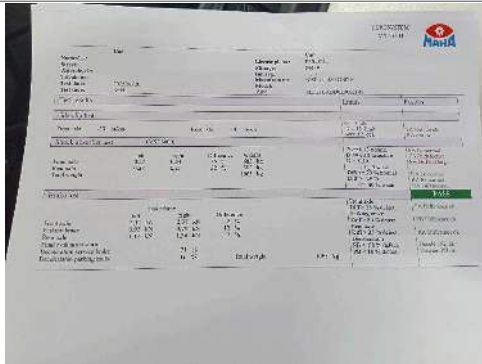


Brake test.

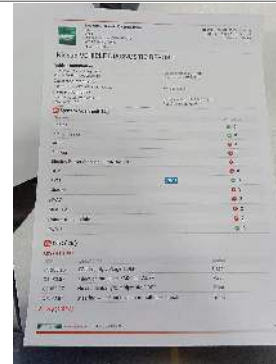

Diagnostic.

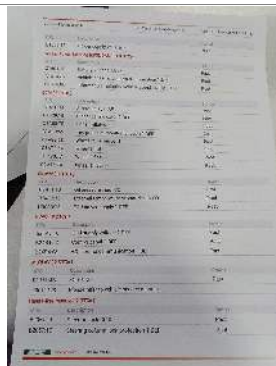

Diagnostic.

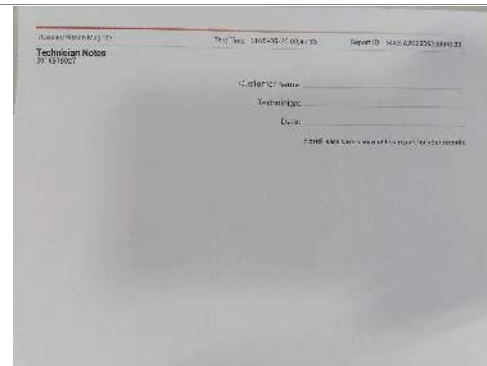

Diagnostic.



FRONT RIGHT CORNER



REAR LEFT CORNER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MDHFBADD0Z0002148



CONDITION REPORT



Report No:
2016919027
DATE
20/06/2025



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Automatic.



90 DEGREE FRONT



90 DEGREE RIGHT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MDHFBADD0Z0002148



CONDITION REPORT



Report No:
2016919027
DATE
20/06/2025



90 DEGREE REAR




90 DEGREE LEFT




LF TYRE TREAD



LR TYRE TREAD

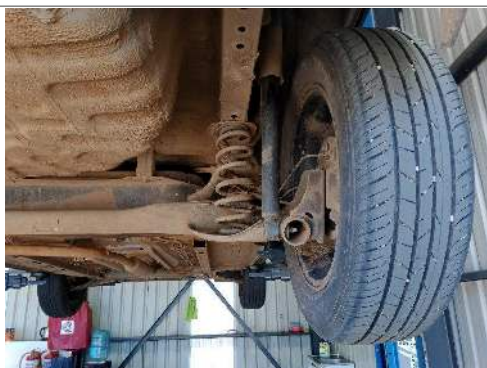

RR TYRE TREAD

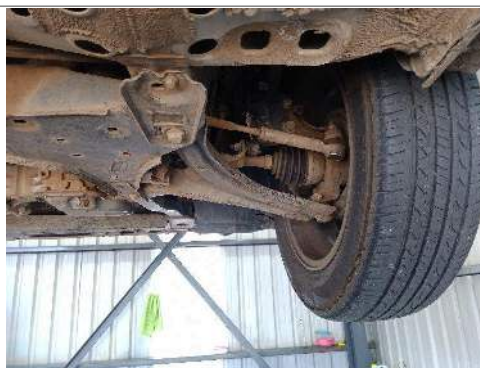

RF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MDHFBADD0Z0002148



CONDITION REPORT



Report No:
2016919027
DATE
20/06/2025



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



Undercarriage front.



Undercarriage rear.



Oil cap and dipstick.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MDHFBADD0Z0002148



CONDITION REPORT



Report No:
2016919027
DATE
20/06/2025



Water level



Front Bumper



Front Bumper



Bonnet



Front Fender Left



Rear Fender Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MDHFBADD0Z0002148



CONDITION REPORT



Report No:
2016919027
DATE
20/06/2025



Door Front Left



Door Rear Left



Boot Lid / Hatch door



Rear bumper



Rear bumper



Door Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MDHFBADD0Z0002148



CONDITION REPORT



Report No:
2016919027
DATE
20/06/2025



Door Rear Right



Rear Fender Right



Front Fender Right



Headlight Right



Engine Management Lights



Shock Absorber Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MDHFBADD0Z0002148



CONDITION REPORT



Report No:
2016919027
DATE
20/06/2025



Stabilizer Mounting Front Right



Radiator Cross Member



Tyre Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MDHFBADD0Z0002148