



CONDITION REPORT



Report No:
2017302016
DATE
22/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	22/09/2026		M57 Pretoria Road - 1619
Inspection Date	22/09/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	RENAULT	Registration Number	HL46XJGP
Model	KWID	Register Number	
VIN	MEEBBA00100569562	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/01/2025
Color	SILVER	Power / Displacement	
Year Model		Paint Finish	TWO COAT METALLIC
Km Reading	55,907 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00100569562



CONDITION REPORT



Report No:

2017302016

DATE

22/09/2026

Damage

Repair Way

Engine Oil Leak	Repair
Air conditioner pipes Damaged	Replace
Central Air Vent Damaged	Repair
Engine Management Lights Set	Repair
Tail Light Right Damaged	Repair
Headlight Right Damaged	Replace
Sun Visor Left Damaged	Replace
Door Panel Rear Left Damaged	Repair
Parcel Tray Damaged	Repair
Front Bumper Damaged	Repair
Bonnet Damaged	Repair
Front Fender Left Damaged	Repair
Front Fender Right Damaged	Repair
Rear Fender Left Damaged	Repair
Rear Fender Right Damaged	Repair
Door Front Left Damaged	Repair
Door Front Right Damaged	Repair
Door Rear Left Damaged	Repair
Door Rear Right Damaged	Repair
Boot Lid / Hatch door Damaged	Repair
Rear bumper Damaged	Repair
Sill Panel Left Damaged	Repair
Sill Panel Right Damaged	Repair
Windscreen Damaged	Repair
Spare Tyre Defective	Replace
Main Beam Left Damaged	Repair
Main Beam Right Damaged	Repair
Sub Frame Damaged	Replace
Engine to silencer pipe Damaged	Repair
Gearbox Damaged	Replace
CV Joint(s) Boot(s) Front Left (inner/outer) Damaged	Replace
Radiator Cross Member Damaged	Replace

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	1.24	1.6	-	
Rear	1.04	1.1	-	
Emergency / Parking	0.86	0.62	-	

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00100569562



CONDITION REPORT



Report No:
2017302016
DATE
22/09/2026

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	155/80R13	79T	Ceat	Radial	V	0118	2 mm
Front Right	155/80R13	79T	Dunlop	Sp	V	3623	2 mm
Rear Left	155/80R13	79T	Dunlop	Sp	V	3623	3 mm
Rear Right	155/80R13	79T	Ceat	Radial	V	5117	2 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	INJ	DTC009517	AIR TEMPERATURE SENSOR CIRCUIT SIGNAL OUTSIDE UPPE	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. 35 DTC'S AT TIME OF TESTING SEE DTC REPORT. Engine Compartment: Battery loose.
Body • Exterior: Minor dents and scratches and stone chips to body panels. Signs of repair work done to body panels. Poor alignment to somebody panels.
Vehicle body in poor condition.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: MEEBBA00100569562




CONDITION REPORT




Report No:
201730216
DATE
22/09/2026

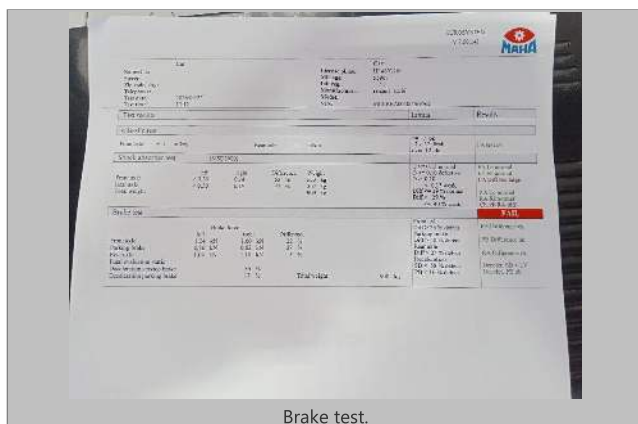


Brake test.

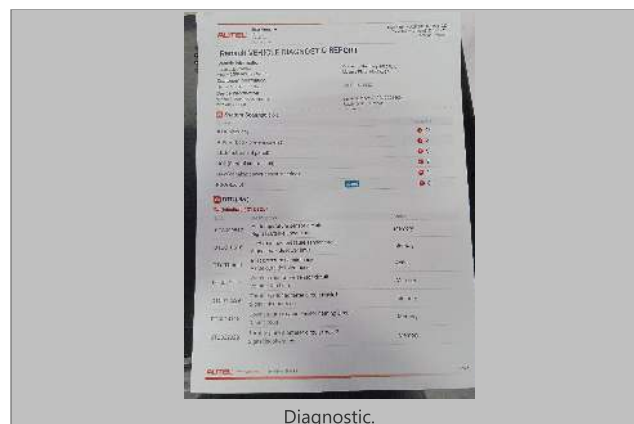

Diagnostic.

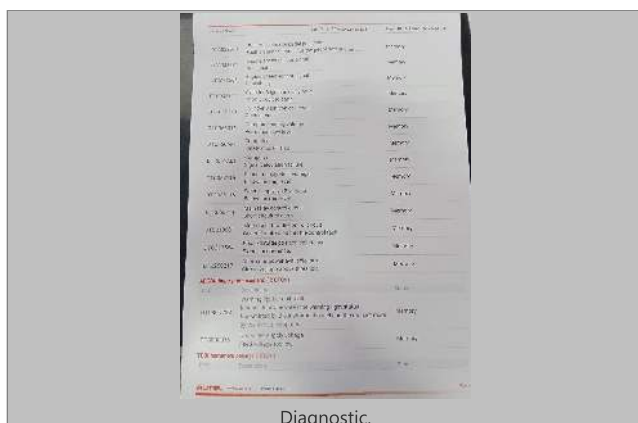

Diagnostic.

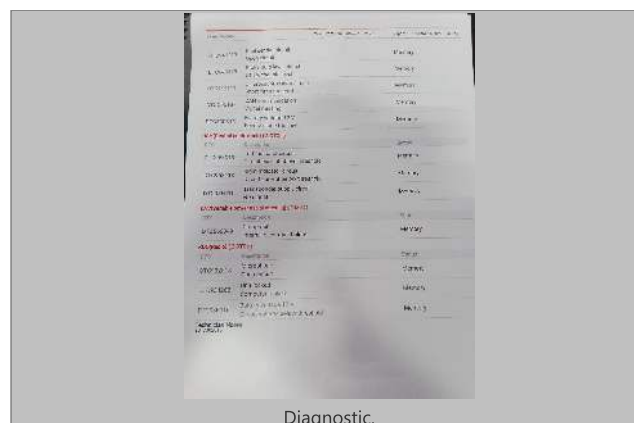

Diagnostic.



FRONT RIGHT CORNER



REAR LEFT CORNER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00100569562



CONDITION REPORT



Report No:
2017302016
DATE
22/09/2026



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual.



90 DEGREE FRONT



90 DEGREE RIGHT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00100569562



CONDITION REPORT



Report No:
2017302016
DATE
22/09/2026



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00100569562




CONDITION REPORT



Report No:
2017302016
DATE
22/09/2026



LICENSE DISC

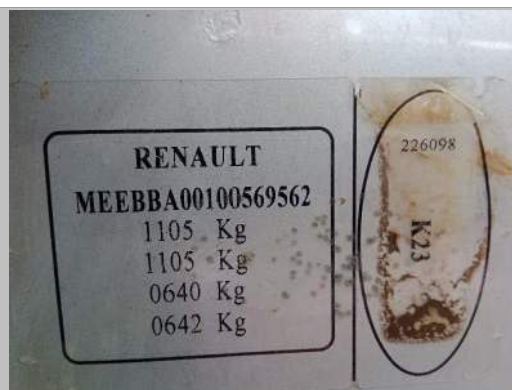

VIN PLATE OR STICKER



ENGINE 1



Undercarriage front.



Undercarriage rear.



Oil cap and dipstick.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: MEEBBA00100569562



CONDITION REPORT



Report No:
2017302016
DATE
22/09/2026

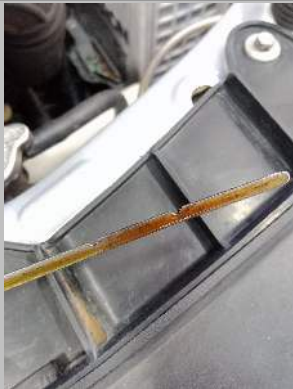

Oil cap and dipstick.



Water level



Headlight Right



Front Bumper



Front Bumper



Bonnet

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00100569562



CONDITION REPORT



Report No:
2017302016
DATE
22/09/2026



Front Fender Left



Door Front Left



Door Rear Left



Sill Panel Left



Rear Fender Left



Rear bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00100569562



CONDITION REPORT



Report No:
2017302016
DATE
22/09/2026



Rear bumper



Boot Lid / Hatch door



Door Rear Right



Door Front Right



Front Fender Right



Rear Fender Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00100569562



CONDITION REPORT



Report No:
2017302016
DATE
22/09/2026



Main Beam Right



Main Beam Left



Air conditioner pipes



Tail Light Right



Parcel Tray



Spare Tyre

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00100569562



CONDITION REPORT



Report No:
2017302016
DATE
22/09/2026



Door Panel Rear Left



Door Panel Rear Left



Windscreen



Sill Panel Right



Engine to silencer pipe



Engine to silencer pipe

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: MEEBBA00100569562



CONDITION REPORT



Report No:
2017302016
DATE
22/09/2026

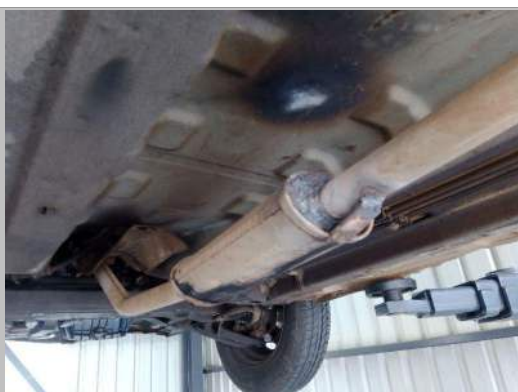

Engine to silencer pipe



Engine



Engine



CV Joint(s) Boot(s) Front Left (inner/outer)



Gearbox



Gearbox

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00100569562



CONDITION REPORT



Report No:
2017302016
DATE
22/09/2026



Radiator Cross Member



Sub Frame



Sun Visor Left



Central Air Vent



Engine Management Lights

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00100569562