



CONDITION REPORT



Report No:
2017302482
DATE
23/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	23/09/2026		M57 Pretoria Road - 1619
Inspection Date	23/09/2026		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	RENAULT	Registration Number	LH86FCGP
Model	KWID	Register Number	
VIN	MEEBBA00500845340	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/01/2026
Color	SILVER	Power / Displacement	
Year Model		Paint Finish	M - METALLIC
Km Reading	51,043 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00500845340



CONDITION REPORT



Report No:

2017302482

DATE

23/09/2026

Damage

Repair Way

Switch Electrical Window Winder rear left Defective	Repair
Door Handle Front Right Damaged	Replace
Door Lock Boot Lid Damaged	Replace
Parcel Tray Missing	Replace
Side Mirror Left Damaged	Replace
Front Bumper Paintwork • Scratched	Repair
Grill Damaged	Repair
Front Fender Left Damaged	Repair
Front Fender Right Paintwork • Scratched	Repair
Rear Fender Left Paintwork • Scratched	Repair
Door Front Left Paintwork • Scratched	Repair
Door Front Right Dented	Repair
Door Rear Left Paintwork • Scratched	Repair
Door Rear Right Paintwork • Scratched	Repair
Boot Lid / Hatch door Dented	Repair
Control Arm Bush(es) Front Axle Left Damaged	Replace
Tyre Front Left Smooth	Replace
Spare Tyre Excessive Wear & Tear	Replace
Rim Front Left Deformed	Repair
Radiator Cross Member Deformed	Repair
Boot does not close	Repair
L/R window does not close	Repair

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.2	2.2	-	
Rear	1.0	0.9	-	
Emergency / Parking	0.7	0.6	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	165/70R14	81T	Ceat	Fuelsmart	V	4123	0 mm
Front Right	165/70R14	81T	Autogrip	Plus	V	4123	5 mm
Rear Left	165/70R14	81R	Ceat	Temporary	V	1423	2 mm
Rear Right	165/70R14	81T	Autogrip	Plus	V	4123	3 mm
Spare	165/70R14	81T	Ceat	Fuelsmart	V	0000	0 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00500845340



CONDITION REPORT



Report No:
2017302482
DATE
23/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	INJECTION	DTC065711	MAIN RELAY CONTROL CIRCUIT SHORT CIRCUIT TO EARTH	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Signs of spray work done on body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: MEEBBA00500845340



CONDITION REPORT



Report No:
2017302482
DATE
23/09/2026

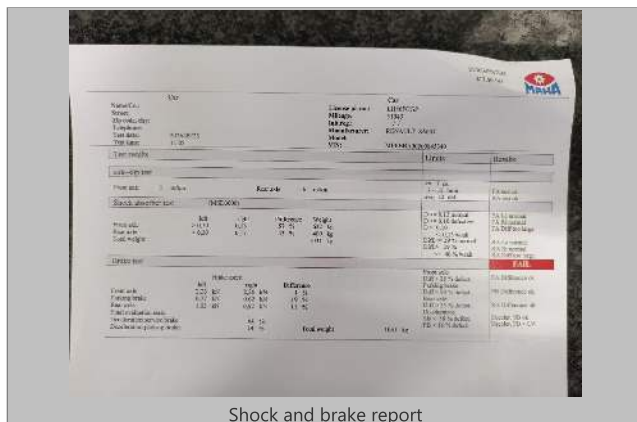


Shock and brake report



Diagnostics report



Diagnostics report

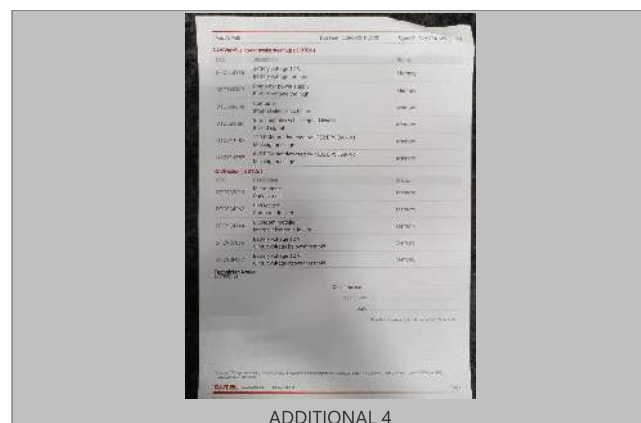

ADDITIONAL 4



FRONT RIGHT CORNER



REAR LEFT CORNER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00500845340



CONDITION REPORT




Report No:

2017302482

DATE

23/09/2026

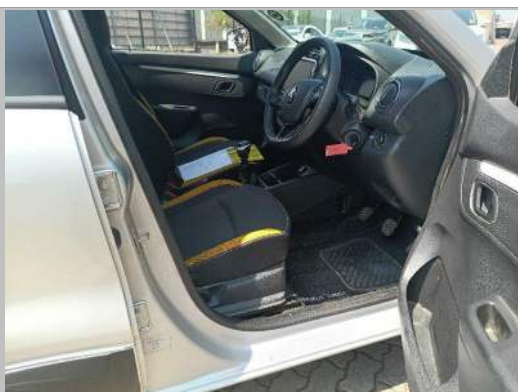

INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual transmission



90 DEGREE FRONT



90 DEGREE RIGHT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00500845340



CONDITION REPORT



Report No:
2017302482
DATE
23/09/2026




90 DEGREE REAR




90 DEGREE LEFT



LF TYRE TREAD

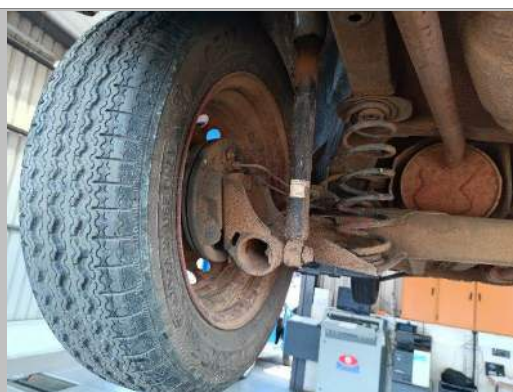

LR TYRE TREAD

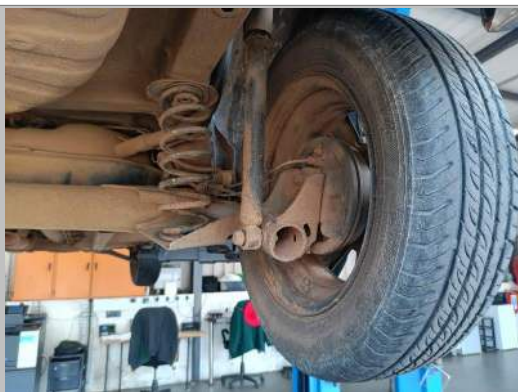

RR TYRE TREAD



RF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00500845340



CONDITION REPORT



Report No:

2017302482

DATE

23/09/2026



Sparewheel well



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00500845340



CONDITION REPORT



Report No:
2017302482
DATE
23/09/2026




REAR



Coolant reservoir



Oil cap

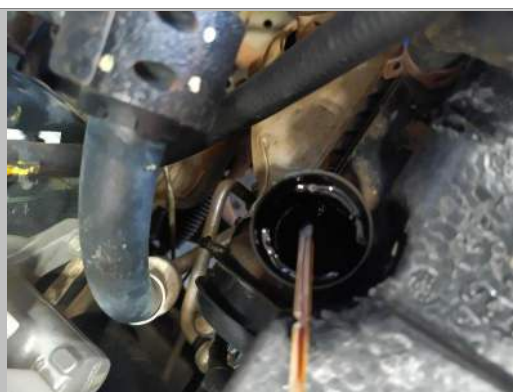

Dipstick



Door Handle Front Right



Door Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00500845340



CONDITION REPORT




Report No:

2017302482

DATE

23/09/2026

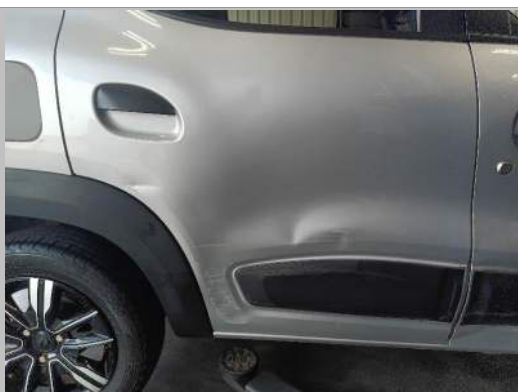

Door Rear Right



Boot Lid / Hatch door



Parcel Tray



Spare Tyre



Door Lock Boot Lid



Rear Fender Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00500845340



CONDITION REPORT



Report No:
2017302482
DATE
23/09/2026



Front Fender Right



Door Rear Left



Door Front Left



Side Mirror Left



Front Fender Left



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00500845340



CONDITION REPORT




Report No:
2017302482
DATE
23/09/2026



Front Bumper



Grill

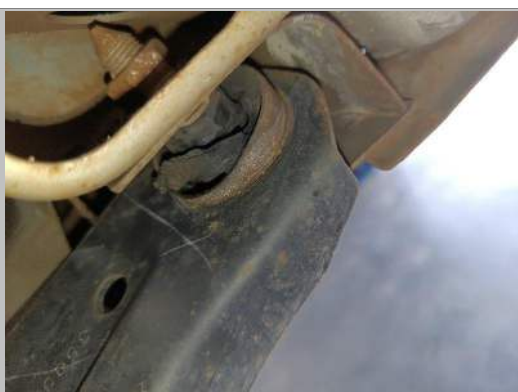

Control Arm Bush(es) Front Axle Left



Tyre Front Left



Rim Front Left



Radiator Cross Member

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00500845340



CONDITION REPORT



Report No:
2017302482
DATE
23/09/2026



Switch Electrical Window Winder rear left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00500845340