



CONDITION REPORT



Report No:
2017304181
DATE
28/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	28/09/2026		M57 Pretoria Road - 1619
Inspection Date	28/09/2026		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	RENAULT	Registration Number	LP04XSGP
Model	KWID	Register Number	
VIN	MEEBBA00900836639	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/01/2026
Color	GREEN	Power / Displacement	
Year Model	2024	Paint Finish	M - METALLIC
Km Reading	14,857 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00900836639



CONDITION REPORT



Report No:

2017304181

DATE

28/09/2026

Damage

Repair Way

Fan Belt Excessive Wear & Tear	Replace
Tail Light Left Damaged	Replace
Tail Light Right Damaged	Replace
Headlight Left Damaged	Replace
Seat Front Left Torn / Cut	Repair
Seat Rear Torn / Cut	Replace
Sun Visor Left Missing	Replace
Sun Visor Right Missing	Replace
Door Handle Front Right Damaged	Replace
Door Sealing Rubber Front Left Damaged	Replace
Door Sealing Rubber Rear Right Damaged	Replace
Parcel Tray Missing	Replace
Front Bumper Damaged	Repair
Bonnet Residual Traces of Repair	Repair
A • Pillar Left Welded	Repair
A • Pillar Right Residual Traces of Repair	Repair
C • Pillar Left Residual Traces of Repair	Repair
C • Pillar Right Residual Traces of Repair	Repair
Front Fender Left Residual Traces of Repair	Repair
Front Fender Right Residual Traces of Repair	Repair
Rear Fender Left Damaged	Repair
Rear Fender Right Residual Traces of Repair	Repair
Door Front Left Residual Traces of Repair	Repair
Door Front Right Residual Traces of Repair	Repair
Door Rear Left Damaged	Repair
Door Rear Right Residual Traces of Repair	Repair
Boot Lid / Hatch door Residual Traces of Repair	Repair
Roof Residual Traces of Repair	Repair
Windscreen Cracked	Replace
Parking Brake Performance Left / Right Difference out of legal range	Repair
Tie Rod End right Damaged	Replace
Wheel bearing Front Right Loose / Excessive Play	Replace
Tyre Front Right Excessive Wear & Tear	Replace
Spare Tyre Excessive Wear & Tear	Replace
Radiator Cross Member Deformed	Repair
Warning lights illuminated	Repair
Front tyre size differs	Replace
Some body panels misaligned	Repair
left front window does not close fully	Repair

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00900836639



CONDITION REPORT



Report No:
2017304181
DATE
28/09/2026

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.3	1.8	-	
Rear	1.5	1.3	-	
Emergency / Parking	0.9	0.6	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	175/40R14	84T	Goodyear	Efficient	V	1121	3 mm
Front Right	165/70R14	81R	Ceat	Temporary	V	0523	0 mm
Rear Left	165/70R14	81T	Ceat	Fuelsmart	V	0523	2 mm
Rear Right	165/70R14	81T	Ceat	Fuelsmart	V	0523	6 mm
Spare	185/60R14	82H	Fronway	Ecogreen	V	////////	0 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	INJECTION	DTC012029	THROTTLE POTENTIOMETER CIRCUIT TRACK 1 SIGNAL	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Residual traces of poor repair on all body panels. Signs of spray work done on body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00900836639



CONDITION REPORT



Report No:
2017304181
DATE
28/09/2026

Name/Car			
Car			
VIN: 3N1AB71D77L000000			
Year: 2017			
Make/Model: NISSAN X-TRAIL			
Engine: 2.0L			
Transmission: Automatic			
Mileage: 100,000 km			
Inspection Date: 28/09/2026			
Inspection Location: Pretoria			
Inspection Result: Pass			
Inspection Notes: All systems checked and found to be in good working order.			
Inspection Signature: [Signature]			
Inspection Stamp: [Stamp]			

Shock and brake report

Name/Car	
Car	
VIN: 3N1AB71D77L000000	
Year: 2017	
Make/Model: NISSAN X-TRAIL	
Engine: 2.0L	
Transmission: Automatic	
Mileage: 100,000 km	
Inspection Date: 28/09/2026	
Inspection Location: Pretoria	
Inspection Result: Pass	
Inspection Notes: All systems checked and found to be in good working order.	
Inspection Signature: [Signature]	
Inspection Stamp: [Stamp]	

Diagnostics

Name/Car	
Car	
VIN: 3N1AB71D77L000000	
Year: 2017	
Make/Model: NISSAN X-TRAIL	
Engine: 2.0L	
Transmission: Automatic	
Mileage: 100,000 km	
Inspection Date: 28/09/2026	
Inspection Location: Pretoria	
Inspection Result: Pass	
Inspection Notes: All systems checked and found to be in good working order.	
Inspection Signature: [Signature]	
Inspection Stamp: [Stamp]	


Diagnostics

Name/Car	
Car	
VIN: 3N1AB71D77L000000	
Year: 2017	
Make/Model: NISSAN X-TRAIL	
Engine: 2.0L	
Transmission: Automatic	
Mileage: 100,000 km	
Inspection Date: 28/09/2026	
Inspection Location: Pretoria	
Inspection Result: Pass	
Inspection Notes: All systems checked and found to be in good working order.	
Inspection Signature: [Signature]	
Inspection Stamp: [Stamp]	

Diagnostics report

Name/Car	
Car	
VIN: 3N1AB71D77L000000	
Year: 2017	
Make/Model: NISSAN X-TRAIL	
Engine: 2.0L	
Transmission: Automatic	
Mileage: 100,000 km	
Inspection Date: 28/09/2026	
Inspection Location: Pretoria	
Inspection Result: Pass	
Inspection Notes: All systems checked and found to be in good working order.	
Inspection Signature: [Signature]	
Inspection Stamp: [Stamp]	

Diagnostics report

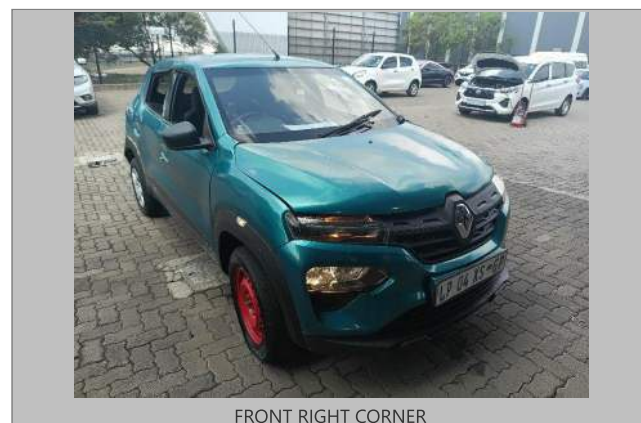

FRONT RIGHT CORNER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00900836639



CONDITION REPORT



Report No:
2017304181
DATE
28/09/2026



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual transmission



90 DEGREE FRONT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00900836639



CONDITION REPORT



Report No:

2017304181

DATE

28/09/2026



90 DEGREE RIGHT




90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD

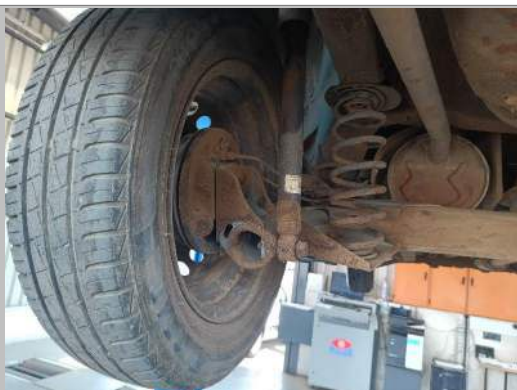

LR TYRE TREAD



RR TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00900836639



CONDITION REPORT



Report No:

2017304181

DATE

28/09/2026



RF TYRE TREAD



Sparewheel



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00900836639



CONDITION REPORT



Report No:
2017304181
DATE
28/09/2026




CHASSIS



REAR



Warning lights

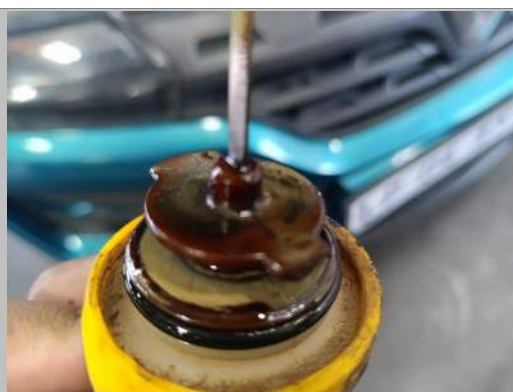

Oil cap



Coolant reservoir



Battery is loose

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00900836639



CONDITION REPORT



Report No:


2017304181

DATE

28/09/2026



L/F window

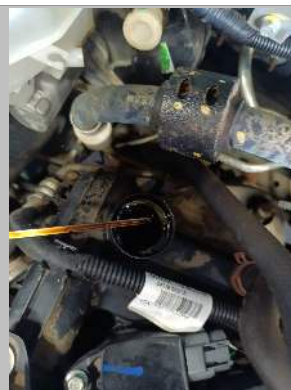

Dipstick

(M8D3900)				
Front axle	left	right	Difference	Weight
Rear axle	> 0,30	0,11	63 %	632 kg
Total weight	> 0,30	0,17	43 %	409 kg
Brake test				
	Brake force		Difference	
Front axle	left	right		
Parking brake	2,30 kN	1,83 kN	20 %	
Rear axle	0,92 kN	0,61 kN	34 %	
Final evaluation static	1,53 kN	1,38 kN	9 %	
Deceleration service brake			89 %	
Deceleration parking brake			15 %	Total weight

Parking Brake Performance



Front Fender Right



Windscreen



Door Front Right

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00900836639



CONDITION REPORT



Report No:
2017304181
DATE
28/09/2026



Door Handle Front Right



Door Front Right



Front Fender Right



A • Pillar Right



A • Pillar Right



A • Pillar Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00900836639



CONDITION REPORT



Report No:
2017304181
DATE
28/09/2026



Sun Visor Right



Sun Visor Left



A • Pillar Left



A • Pillar Left



Seat Front Left



A • Pillar Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00900836639



CONDITION REPORT



Report No:
2017304181
DATE
28/09/2026



A • Pillar Right



Door Sealing Rubber Rear Right



Seat Rear



Door Rear Right



Door Rear Right



Door Rear Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00900836639



CONDITION REPORT



Report No:

2017304181

DATE

28/09/2026




Roof



Roof



Roof

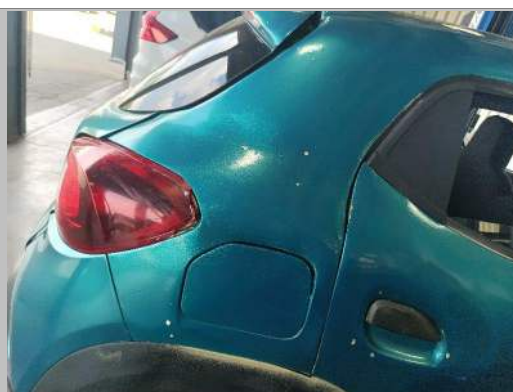

Rear Fender Right



Tail Light Right



Tail Light Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00900836639



CONDITION REPORT



Report No:

2017304181

DATE

28/09/2026



Boot Lid / Hatch door



Spare Tyre



C • Pillar Right



C • Pillar Right



C • Pillar Left



Parcel Tray

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00900836639



CONDITION REPORT



Report No:


2017304181

DATE

28/09/2026



Rear Fender Left

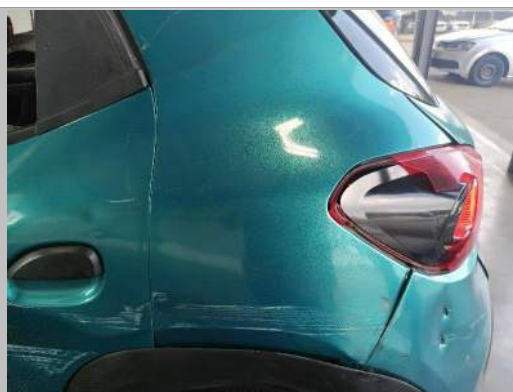

Rear Fender Left



Door Rear Left



Door Front Left



A • Pillar Left



A • Pillar Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00900836639



CONDITION REPORT



Report No:
2017304181
DATE
28/09/2026



A • Pillar Left



Door Front Left



Door Sealing Rubber Front Left



Door Sealing Rubber Front Left



Door Sealing Rubber Front Left



Front Fender Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00900836639



CONDITION REPORT



Report No:
2017304181
DATE
28/09/2026




Bonnet



Headlight Left




Tyre Front Right

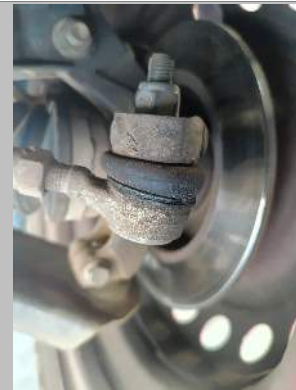

Tie Rod End right



Radiator Cross Member

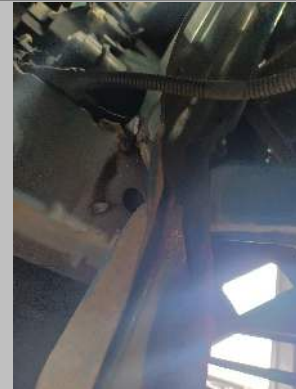

Radiator Cross Member

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00900836639



CONDITION REPORT



Report No:
2017304181
DATE
28/09/2026



Radiator Cross Member



Radiator Cross Member



Front Bumper



Front Bumper



Fan Belt

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00900836639