



CONDITION REPORT



Report No:

2017297669

DATE

11/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	11/09/2026		M57 Pretoria Road - 1619
Inspection Date	11/09/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	RENAULT	Registration Number	KK43KGGP
Model	KWID	Register Number	
VIN	MEEBBA00X00798614	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	
Color	RED	Power / Displacement	
Year Model		Paint Finish	M - METALLIC
Km Reading	40,374 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: MEEBBA00X00798614



CONDITION REPORT



Report No:
2017297669
DATE
11/09/2026

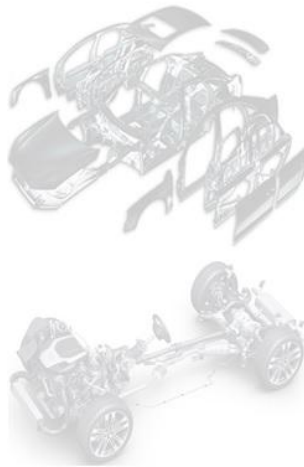

Damage	Repair Way
Headlight Left Damaged	Repair
Side Mirror Left Paintwork • Scratched	Repair
Side Mirror Right Paintwork • Scratched	Repair
Front Bumper Paintwork • Scratched	Repair
Front Fender Left Paintwork • Scratched	Repair
Front Fender Right Paintwork • Scratched	Repair
Rear Fender Right Paintwork • Scratched	Repair
Door Front Left Paintwork • Scratched	Repair
Door Front Right Paintwork • Scratched	Repair
Door Rear Left Dented	Repair
Door Rear Right Paintwork • Scratched	Repair
Boot Lid / Hatch door Dented	Repair
Rear bumper Paintwork • Scratched	Repair
Windscreen Cracked	Replace
Radiator Cradle Dented	Repair
Body exterior	Vehicle got minor scratches, stone chips and dents

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	1.9	2.2	-	
Rear	1.2	1.0	-	
Emergency / Parking	0.5	0.5	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	165/70R14	81T	Ceat	Fuel smart	V	4821	3 mm
Front Right	165/70R14	81T	Ceat	Fuel smart	V	4821	3 mm
Rear Left	165/70R14	81T	Ceat	Fuel smart	V	4721	3 mm
Rear Right	165/70R14	81T	Ceat	Fuel smart	V	4821	4 mm
Spare	165/70R14	81T	Kumho	Ecowing	V	0000	4 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00X00798614



CONDITION REPORT



Report No:

2017297669

DATE

11/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	MEMORY	DTC033531	ENGINE SPEED SENSOR SIGNAL NO SIGNAL	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE: NORMAL WEAR AND TEAR MARKS ON THE BODY, INTERIOR, AND MECHANICAL.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Andrick Wymers

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00X00798614



CONDITION REPORT



Report No:

2017297669

DATE

11/09/2026

Car				Car			
Year/Mod.	2015/10	Year/Mod.	2015/10	Year/Mod.	2015/10	Year/Mod.	2015/10
Make/Model	MAZDA	Make/Model	MAZDA	Make/Model	MAZDA	Make/Model	MAZDA
Engine	2.0	Engine	2.0	Engine	2.0	Engine	2.0
Transmission	Manual	Transmission	Manual	Transmission	Manual	Transmission	Manual
Color	Red	Color	Red	Color	Red	Color	Red
Registration	1234567	Registration	1234567	Registration	1234567	Registration	1234567
Inspection date	11/09/2026	Inspection date	11/09/2026	Inspection date	11/09/2026	Inspection date	11/09/2026
Inspected by	John Doe	Inspected by	John Doe	Inspected by	John Doe	Inspected by	John Doe
Location	123 Main St	Location	123 Main St	Location	123 Main St	Location	123 Main St
Weather	Sunny	Weather	Sunny	Weather	Sunny	Weather	Sunny
Time	10:00	Time	10:00	Time	10:00	Time	10:00
Inspector	John Doe	Inspector	John Doe	Inspector	John Doe	Inspector	John Doe
Signature	[Signature]	Signature	[Signature]	Signature	[Signature]	Signature	[Signature]
Stamp	[Stamp]	Stamp	[Stamp]	Stamp	[Stamp]	Stamp	[Stamp]

Shock and brake report

Car				Car			
Year/Mod.	2015/10	Year/Mod.	2015/10	Year/Mod.	2015/10	Year/Mod.	2015/10
Make/Model	MAZDA	Make/Model	MAZDA	Make/Model	MAZDA	Make/Model	MAZDA
Engine	2.0	Engine	2.0	Engine	2.0	Engine	2.0
Transmission	Manual	Transmission	Manual	Transmission	Manual	Transmission	Manual
Color	Red	Color	Red	Color	Red	Color	Red
Registration	1234567	Registration	1234567	Registration	1234567	Registration	1234567
Inspection date	11/09/2026	Inspection date	11/09/2026	Inspection date	11/09/2026	Inspection date	11/09/2026
Inspected by	John Doe	Inspected by	John Doe	Inspected by	John Doe	Inspected by	John Doe
Location	123 Main St	Location	123 Main St	Location	123 Main St	Location	123 Main St
Weather	Sunny	Weather	Sunny	Weather	Sunny	Weather	Sunny
Time	10:00	Time	10:00	Time	10:00	Time	10:00
Inspector	John Doe	Inspector	John Doe	Inspector	John Doe	Inspector	John Doe
Signature	[Signature]	Signature	[Signature]	Signature	[Signature]	Signature	[Signature]
Stamp	[Stamp]	Stamp	[Stamp]	Stamp	[Stamp]	Stamp	[Stamp]

Diagnostic report

Car				Car			
Year/Mod.	2015/10	Year/Mod.	2015/10	Year/Mod.	2015/10	Year/Mod.	2015/10
Make/Model	MAZDA	Make/Model	MAZDA	Make/Model	MAZDA	Make/Model	MAZDA
Engine	2.0	Engine	2.0	Engine	2.0	Engine	2.0
Transmission	Manual	Transmission	Manual	Transmission	Manual	Transmission	Manual
Color	Red	Color	Red	Color	Red	Color	Red
Registration	1234567	Registration	1234567	Registration	1234567	Registration	1234567
Inspection date	11/09/2026	Inspection date	11/09/2026	Inspection date	11/09/2026	Inspection date	11/09/2026
Inspected by	John Doe	Inspected by	John Doe	Inspected by	John Doe	Inspected by	John Doe
Location	123 Main St	Location	123 Main St	Location	123 Main St	Location	123 Main St
Weather	Sunny	Weather	Sunny	Weather	Sunny	Weather	Sunny
Time	10:00	Time	10:00	Time	10:00	Time	10:00
Inspector	John Doe	Inspector	John Doe	Inspector	John Doe	Inspector	John Doe
Signature	[Signature]	Signature	[Signature]	Signature	[Signature]	Signature	[Signature]
Stamp	[Stamp]	Stamp	[Stamp]	Stamp	[Stamp]	Stamp	[Stamp]

Diagnostic report



Spare wheel



Coolant bottle



Oil cap and dipstick

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00X00798614



CONDITION REPORT



Report No:
2017297669
DATE
11/09/2026



Manual



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00X00798614



CONDITION REPORT



Report No:

2017297669

DATE

11/09/2026



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00X00798614




CONDITION REPORT



Report No:
2017297669
DATE
11/09/2026



RR TYRE TREAD

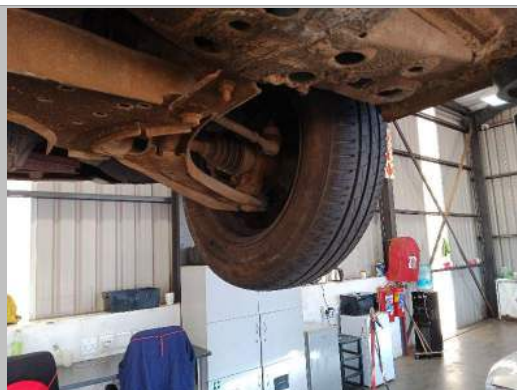

RF TYRE TREAD



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00X00798614



CONDITION REPORT



Report No:
2017297669
DATE
11/09/2026



CHASSIS



Windscreen



Water level



Headlight Left



Door Rear Right



Side Mirror Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00X00798614



CONDITION REPORT




Report No:

2017297669

DATE

11/09/2026

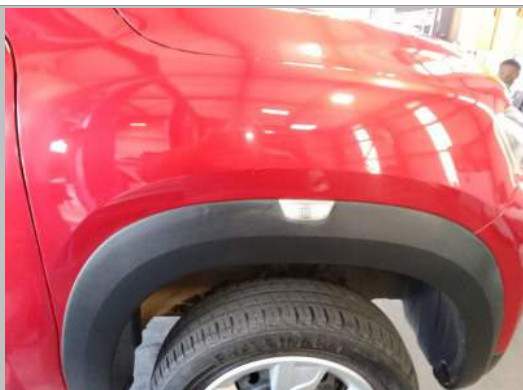

Front Fender Right



Front Bumper



Front Fender Left



Side Mirror Left



Door Front Left



Door Rear Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00X00798614



CONDITION REPORT



Report No:

2017297669

DATE

11/09/2026




Rear bumper



Rear bumper



Boot Lid / Hatch door

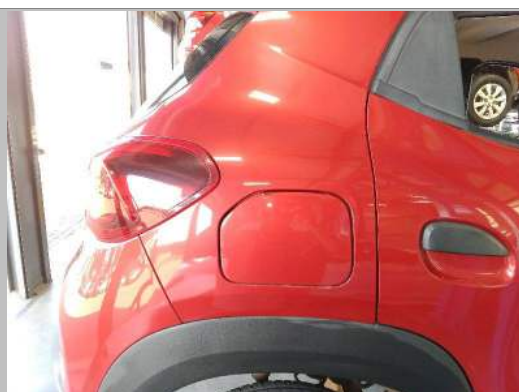

Rear Fender Right



Door Front Right



Radiator Cradle

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00X00798614