



CONDITION REPORT



Report No:
2017297320
DATE
10/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	10/09/2026		M57 Pretoria Road - 1619
Inspection Date	10/09/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	RENAULT	Registration Number	KYX255NW
Model	KIGER	Register Number	
VIN	MEEHBC00100083355	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	
Color	BLUE	Power / Displacement	
Year Model		Paint Finish	TWO COAT UNI
Km Reading	25,663 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: MEEHBC00100083355



CONDITION REPORT



Report No:
2017297320
DATE
10/09/2026

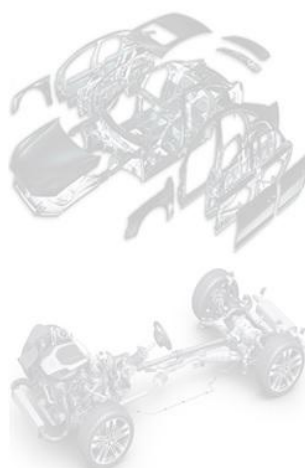

Damage	Repair Way
Engine Oil Leak	Repair
Engine Wiring Defective	Repair
Fan Belt Torn / Cut	Replace
Air conditioner pipes Damaged	Replace
Air Conditioner Insufficient	Replace
Indicator Light Front Right Damaged	Replace
Headlight Left Damaged	Replace
Headlight Right Damaged	Replace
Seat Front Left Dirty	Repair
Seat Front Right Dirty	Repair
Seat Rear Loose / Excessive Play	Repair
Interior Mirror Missing	Replace
Door Handle Front Left Damaged	Repair
Parcel Tray Missing	Replace
Boot Carpet Damaged	Repair
Side Mirror Left Paintwork • Scratched	Repair
Front Bumper Damaged	Repair
Grill Damaged	Replace
Bonnet Damaged	Repair
Front Fender Left Damaged	Repair
Front Fender Right Damaged	Repair
Rear Fender Left Dented	Repair
Door Front Left Damaged	Repair
Door Front Right Paintwork • Scratched	Repair
Door Rear Left Dented	Repair
Door Rear Right Damaged	Repair
Boot Lid / Hatch door Paintwork • Scratched	Repair
Rear bumper Paintwork • Scratched	Repair
Roof Dented	Repair
Windscreen Chipped	Repair
Control Arm Bush(es) Front Axle Left Cracked	Replace
Control Arm Bush(es) Front Axle Right Cracked	Replace
Chassis Dented	Repair
Engine to silencer pipe Damaged	Repair
Gearbox Oil Leak	Repair
CV Joint(s) Boot(s) Front Left (inner/outer) Damaged	Replace
CV Joint(s) Boot(s) Front Right (inner/outer) Damaged	Replace
Radiator Cradle Damaged	Replace
Engine Performance Insufficient	Repair
Engine Noise Idling / Hunting	Repair
Jack Missing	Replace
Wheel Spanner Missing	Replace
Warning lights illuminated on dashboard	Repair
Loose wiring inside of vehicle	Repair
Vehicle license disk missing	Replace
Spare Wheel missing	Replace
Foreign substance on oil cap	Repair
Oil leak on intercooler	Replace
Front bumper stiffener damaged	Replace
Engine and gearbox oil sumps damaged	Replace
Front left chassis leg extension damaged	Repair
Aircon condenser damaged	Replace

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEHBC00100083355



CONDITION REPORT



Report No:
2017297320
DATE
10/09/2026

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.72	2.56	-	
Rear	1.45	1.4	-	
Emergency / Parking	1.29	1.09	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	195/60 R16	89V	Ceat	Secure drive	V	5022	2 mm
Front Right	195/60 R16	89V	Ceat	Secure drive	V	5022	3 mm
Rear Left	195/60 R16	89V	Ceat	Secure drive	V	5022	5 mm
Rear Right	195/60 R16	89V	Ceat	Secure drive	V	4522	5 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ABG(AIRBAG/PRETENSIONERS)	DTC80D223	WARNING LIGHT CIRCUIT FAULT SIGNAL LOW	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Engine Compartment: Some bolts missing on bottom of engine.

Interior: Vehicle interior dirty and panels scratched.

Body • Exterior: Dents and scratches on body panels. Signs of impact damage to front of vehicle. Body panels misaligned

Undercarriage: Excessive engine and gearbox leak.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEHBC00100083355



CONDITION REPORT



Report No:

2017297320

DATE

10/09/2026

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEHBC00100083355



CONDITION REPORT



Report No:

2017297320

DATE _____

10/09/2026

[illegible]

Brake and shock absorber report

[illegible]

Diagnostic report page 1

[illegible]

Diagnostic report page 2



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEHBC00100083355



CONDITION REPORT



Report No:

2017297320

DATE

10/09/2026



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Automatic Transmission



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEHBC00100083355



CONDITION REPORT




Report No:
2017297320
DATE
10/09/2026



90 DEGREE LEFT



LF TYRE TREAD

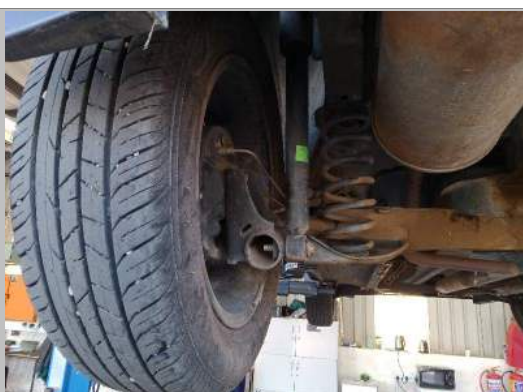

LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



No license disc

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEHBC00100083355



CONDITION REPORT



Report No:

2017297320

DATE

10/09/2026



VIN PLATE OR STICKER



ENGINE 1



Front chassis



Rear Chassis



Front bumper stiffener



Intercooler

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEHBC00100083355



CONDITION REPORT



Report No:
2017297320
DATE
10/09/2026



Triangle



Aircon condenser



Oil cap and dipstick



Loose wiring



Gearbox oil sump



Front left chassis leg extensi

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEHBC00100083355



CONDITION REPORT



Report No:
2017297320
DATE
10/09/2026



Engine oil sump



Interior Mirror



Air Conditioner



Seat Front Right



Seat Rear



Door Rear Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEHBC00100083355



CONDITION REPORT



Report No:

2017297320

DATE

10/09/2026



Door Front Right



Door Front Right



Front Fender Right



Bonnet



Grill



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEHBC00100083355



CONDITION REPORT



Report No:

2017297320

DATE

10/09/2026



Front Bumper



Front Bumper



Front Fender Left



Door Front Left



Side Mirror Left



Door Rear Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEHBC00100083355




CONDITION REPORT



Report No:
2017297320
DATE
10/09/2026



Door Handle Front Left

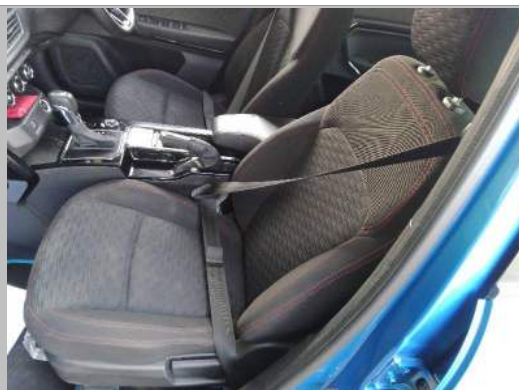

Seat Front Left



Boot Lid / Hatch door



Boot Lid / Hatch door



Rear bumper



Rear bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEHBC00100083355



CONDITION REPORT



Report No:
2017297320
DATE
10/09/2026



Parcel Tray



Boot Carpet



Roof



Rear Fender Left



Indicator Light Front Right



Headlight Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEHBC00100083355



CONDITION REPORT



Report No:
2017297320
DATE
10/09/2026




Headlight Right



Headlight Left



Headlight Left

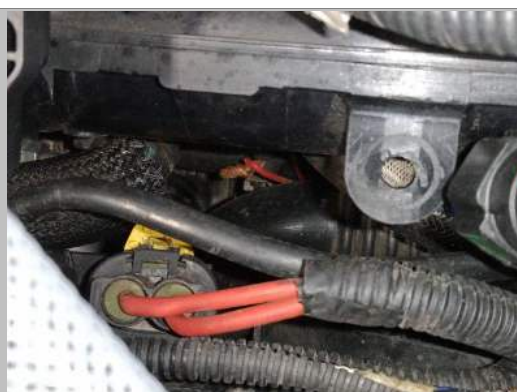

Engine Wiring



Control Arm Bush(es) Front Axle Right



Control Arm Bush(es) Front Axle Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEHBC00100083355



CONDITION REPORT



Report No:

2017297320

DATE

10/09/2026



Gearbox



Engine



CV Joint(s) Boot(s) Front Left (inner/outer)



CV Joint(s) Boot(s) Front Right (inner/outer)



Radiator Cradle



Fan Belt

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEHBC00100083355



CONDITION REPORT



Report No:
2017297320
DATE
10/09/2026



Chassis



Air conditioner pipes



Engine to silencer pipe



Windscreen



Water level

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEHBC00100083355