



CONDITION REPORT



Report No:
2017302489
DATE
23/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	23/09/2026		M57 Pretoria Road - 1619
Inspection Date	23/09/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	RENAULT	Registration Number	KG92NGGP
Model	KIGER	Register Number	
VIN	MEEHBC00200027778	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	
Color	BLUE	Power / Displacement	
Year Model		Paint Finish	M - METALLIC
Km Reading	97,835 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEHBC00200027778



CONDITION REPORT



Report No:

2017302489

DATE

23/09/2026

Damage

Repair Way

Switch Electrical Window Winder rear right Malfunction	Repair
Front Bumper Paintwork • Scratched	Repair
Bonnet Paintwork • Chipmarks	Repair
Front Fender Left Dented	Repair
Front Fender Right Paintwork • Scratched	Repair
Rear Fender Left Dented	Repair
Rear Fender Right Paintwork • Scratched	Repair
Door Front Left Dented	Repair
Door Front Right Dented	Repair
Door Rear Left Dented	Repair
Door Rear Right Dented	Repair
Boot Lid / Hatch door Paintwork • Scratched	Repair
Rear bumper Paintwork • Scratched	Repair
Shock Absorber Rear Left Leak	Replace
Shock Absorber Rear Right Leak	Replace



Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.5	2.1	-	
Rear	1.3	1.3	-	
Emergency / Parking	1.2	1.3	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	195/60R16	89H	Dunlop	Sp sport	V	3425	3 mm
Front Right	195/60R16	89H	Dunlop	Sp sport	V	3425	3 mm
Rear Left	195/60R16	89H	Zextour	Premium	V	2822	3 mm
Rear Right	195/60R16	89V	Ceat	Securadrive	V	3321	3 mm
Spare	185/65R15	88R	Ceat	Stepnee	V	////	4 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEHBC00200027778



CONDITION REPORT



Report No:
2017302489
DATE
23/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	MEMORY	DTC80D223	WARNING LIGHT CIRCUIT FAULT SIGNAL LOW	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Andrick Wymers

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEHBC00200027778



CONDITION REPORT



Report No:

2017302489

DATE

23/09/2026



FRONT RIGHT CORNER



REAR LEFT CORNER



90 DEGREE FRONT



90 DEGREE REAR



90 DEGREE LEFT



90 DEGREE RIGHT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEHBC00200027778



CONDITION REPORT



Report No:
2017302489
DATE
23/09/2026



ODOMETER



DASHBOARD (W/ ENGINE RUNNING)



INTERIOR (FRONT DRIVER DOOR)



Manual



Spare wheel



Expansion bottle

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEHBC00200027778



CONDITION REPORT



Report No:
2017302489
DATE
23/09/2026



Oil cap and dipstick



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



ENGINE 1

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEHBC00200027778



CONDITION REPORT



Report No:

2017302489

DATE

23/09/2026



ENGINE 2




CHASSIS



VIN PLATE OR STICKER



LICENSE DISC

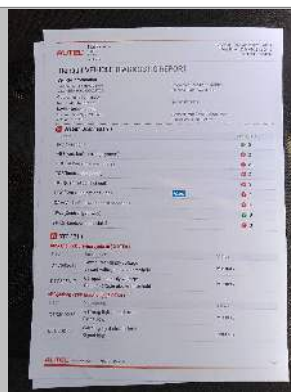

DIAGNOSTIC REPORT PAGE 1



DIAGNOSTIC REPORT PAGE 2

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: MEEHBC00200027778




CONDITION REPORT




Report No:
2017302489
DATE
23/09/2026

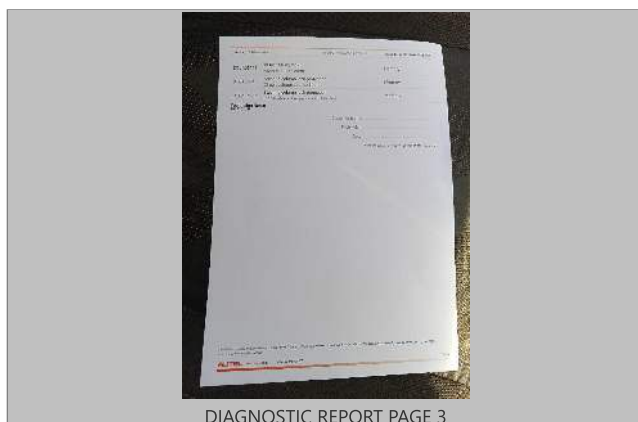


DIAGNOSTIC REPORT PAGE 3

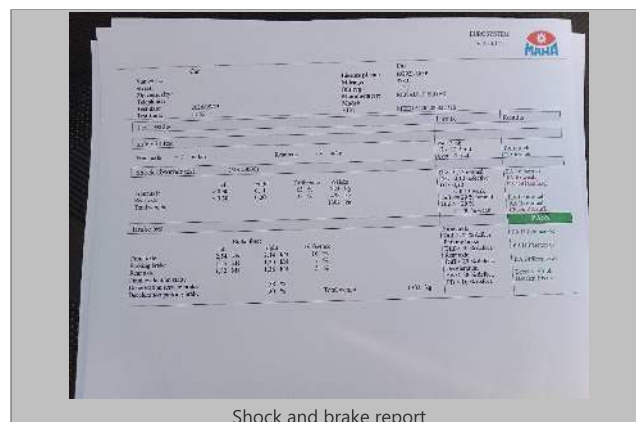


Shock and brake report

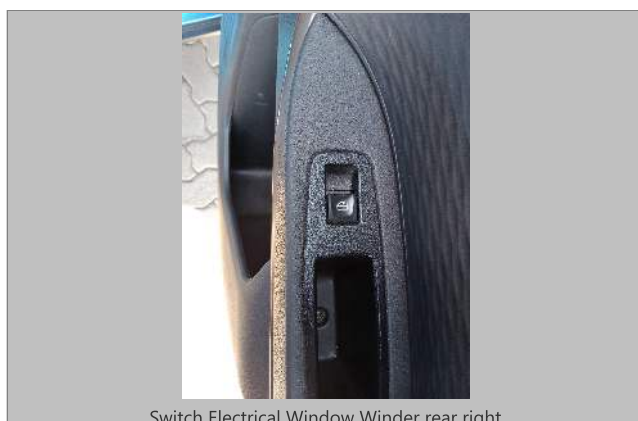

Switch Electrical Window Winder rear right

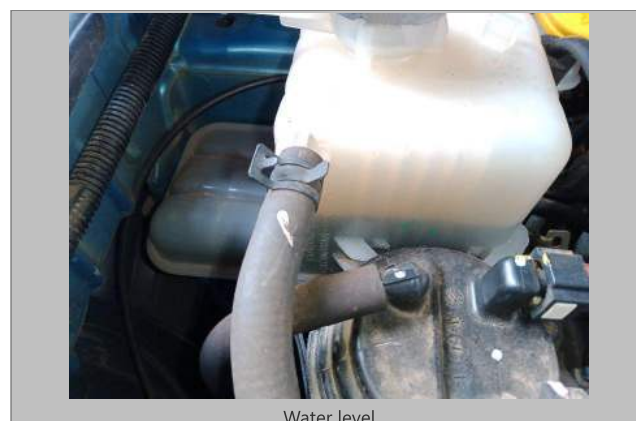

Water level

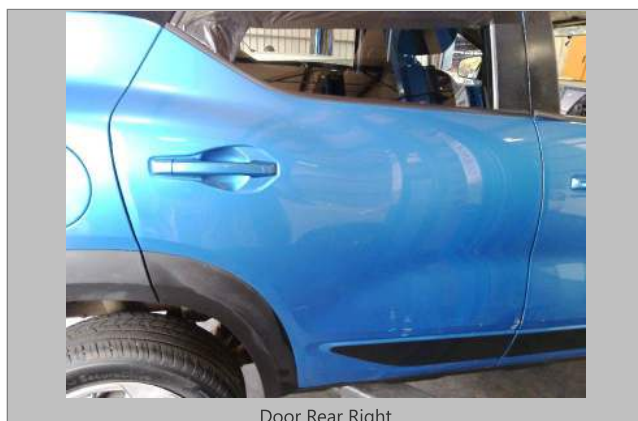

Door Rear Right



Door Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEHBC00200027778



CONDITION REPORT



Report No:
2017302489
DATE
23/09/2026



Front Fender Right



Front Bumper




Front Bumper



Bonnet



Front Fender Left

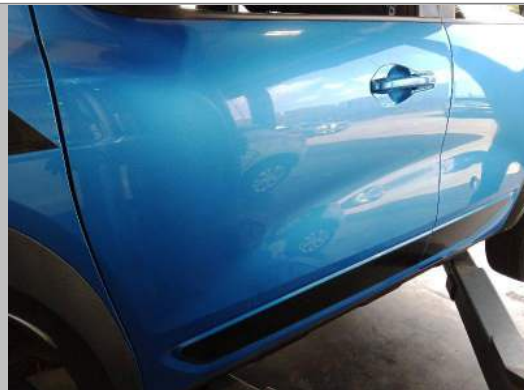

Door Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEHBC00200027778



CONDITION REPORT



Report No:
2017302489
DATE
23/09/2026



Door Rear Left



Rear Fender Left



Boot Lid / Hatch door



Rear bumper



Rear bumper



Rear Fender Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEHBC00200027778



CONDITION REPORT



Report No:
2017302489
DATE
23/09/2026



Shock Absorber Rear Left



Shock Absorber Rear Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEHBC00200027778