



CONDITION REPORT



Report No:

2017298441

DATE

14/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	14/09/2026		M57 Pretoria Road - 1619
Inspection Date	14/09/2026		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	RENAULT	Registration Number	MJ34ZRGF
Model	KIGER	Register Number	
VIN	MEEHBC00500122657	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/05/2026
Color	SILVER	Power / Displacement	
Year Model		Paint Finish	M - METALLIC
Km Reading	11,134 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEHBC00500122657



CONDITION REPORT



Report No:

2017298441

DATE


14/09/2026

Damage

Repair Way

Seat Front Right Dirty
 Front Bumper Paintwork • Scratched
 Boot Lid / Hatch door Paintwork • Scratched
 Steering Insufficient
 Warning lights illuminated

Repair
 Repair
 Repair
 Repair
 Repair

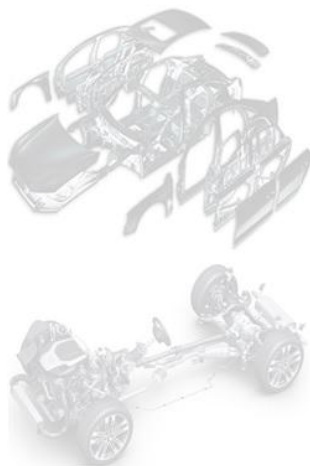

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.6	2.5	-	
Rear	1.3	1.5	-	
Emergency / Parking	0.7	1	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	195/60R16	89H	MRF	Wanderer	V	0125	6 mm
Front Right	195/60R16	89H	MRF	Wanderer	V	0125	6 mm
Rear Left	195/60R16	89H	MRF	Wanderer	V	0125	6 mm
Rear Right	195/60R16	89H	MRF	Wanderer	V	0125	6 mm
Spare	165/80R14	85R	Ceat	Temporary	V	0000	5 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEHBC00500122657



CONDITION REPORT



Report No:
2017298441
DATE
14/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	INJECTION	DTC065711	MAIN RELAY CONTROL CIRCUIT SHORT CIRCUIT TO EARTH	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Signs of spray work done on body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEHBC00500122657



CONDITION REPORT



Report No:

2017298441

DATE _____

14/09/2026

FORD FIESTA					
Car				1.1 1000	
Tramcar/Car:		Car	102424313		
Variant:		Motor	1112		
City (mile, km):		Injection	1400		
Telephone:		Manufacturer	102424313		
Year class:	102424313	Model	102424313		
Year class:	102424313	Year	102424313		
Last results				1000	1000
Side-slip test					
Front axle	1.9 inches	Rear axle	1.9 inches		
Shock absorber test (102424313)					
Front axle	1.8	1000	1000		
Rear axle	1.8	1.8	1.8		
Total weight	1.8	1.8	1.8		
Brake test					
Front axle	1.8	1000	1000		
Rear axle	1.8	1.8	1.8		
Total weight	1.8	1.8	1.8		
Fuel test					
Front axle	1.8	1000	1000		
Rear axle	1.8	1.8	1.8		
Total weight	1.8	1.8	1.8		
Performance test					
Front axle	1.8	1000	1000		
Rear axle	1.8	1.8	1.8		
Total weight	1.8	1.8	1.8		
Acceleration test					
Front axle	1.8	1000	1000		
Rear axle	1.8	1.8	1.8		
Total weight	1.8	1.8	1.8		
Deceleration test					
Front axle	1.8	1000	1000		
Rear axle	1.8	1.8	1.8		
Total weight	1.8	1.8	1.8		
Deceleration test					
Front axle	1.8	1000	1000		
Rear axle	1.8	1.8	1.8		
Total weight	1.8	1.8	1.8		

Shock and brake report

AUTOLINK VEHICLE DIAGNOSTIC REPORT

File Edit View Tools Help About

Vehicle Information

Diagnostic Results

Page 1 of 1 Total 1000000

Diagnostics report

[illegible]

Diagnostics report

[illegible]

Diagnostics report



FRONT RIGHT CORNER



REAR LEFT CORNER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEHBC00500122657



CONDITION REPORT



Report No:

2017298441

DATE

14/09/2026



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual transmission



90 DEGREE FRONT



90 DEGREE RIGHT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEHBC00500122657



CONDITION REPORT



Report No:
2017298441
DATE
14/09/2026



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEHBC00500122657



CONDITION REPORT




Report No:

2017298441

DATE


14/09/2026

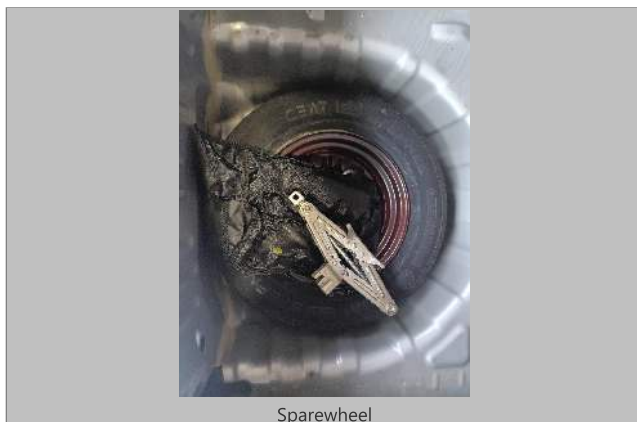

Sparewheel



LICENSE DISC

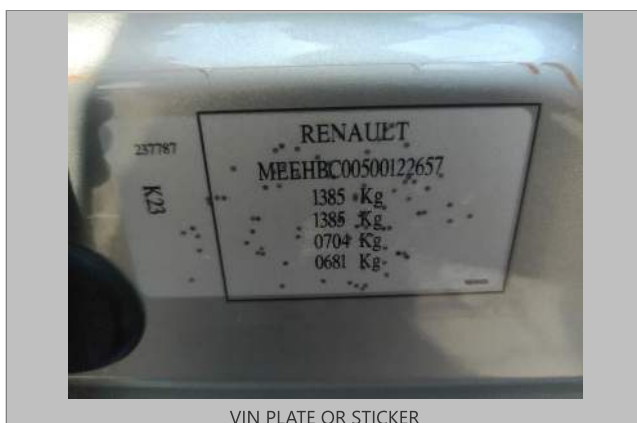

VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEHBC00500122657



CONDITION REPORT



Report No:

2017298441

DATE


14/09/2026



REAR



Expansion bottle

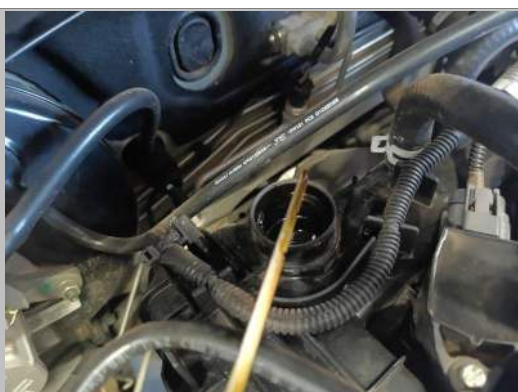

Dipstick



Oil cap



Warning lights illuminated



Seat Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEHBC00500122657



CONDITION REPORT



Report No:
2017298441
DATE
14/09/2026



Front Bumper



Boot Lid / Hatch door

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEHBC00500122657