



CONDITION REPORT

Report No: 2016413511

DATE
11/06/2024

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	11/06/2024		M57 Pretoria Road - 1619
Inspection Date	11/06/2024		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	RENAULT	Registration Number	LP32DMGP
Model	KIGER	Register Number	
VIN	MEEHBC00600103468	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/01/2025
Color	WHITE	Power / Displacement	
Year Model		Paint Finish	TWO COAT UNI
Km Reading	319 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION



Damage	Repair Way
Front Bumper Residual Traces of Repair	Repair
Front Fender Left / Inner Tray Residual Traces of Repair	Repair
Rear bumper Paintwork • Scratched	Repair
Main Beam Left Welded	Repair
Main Beam Right Welded	Repair
Radiator Cradle Residual Traces of Repair	Repair
Body and Exterior	Vehicle safety integrity compromised
Body and Exterior	Minor dents and scratches on some body panels
Body and Exterior	Stone chips and spray work on some body panels
Body and Exterior	Signs of impact damage to front of vehicle
Body and Exterior	Residual traces of repair on some body panels
Body and Exterior	Vehicle is a cut and joint
Body and Exterior	License disc faded

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEHBC00600103468

1 / 8



CONDITION REPORT

Report No: 2016413511

 DATE
11/06/2024

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.03	2.41	-	
Rear	1.53	1.58	-	
Emergency / Parking	1.08	0.98	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	195/60 R16	89V	Ceat	Secure drive	V	3123	6 mm
Front Right	195/60 R16	89V	Ceat	Secure drive	V	3123	5 mm
Rear Left	195/60 R16	89V	Ceat	Secure drive	V	3123	6 mm
Rear Right	195/60 R16	89V	Ceat	Secure drive	V	3123	6 mm
Spare	165/80 R14	85R	Ceat	Temporary	V	1223	4 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	INJECTION	DTC073696	GEAR R SPEED COHERENCE MECHANICAL FAILURES	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.


General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za




CONDITION REPORT


VIN: MEEH8C09600103468
Report No: 2016413571
2 / 8
DATE
11/06/2024

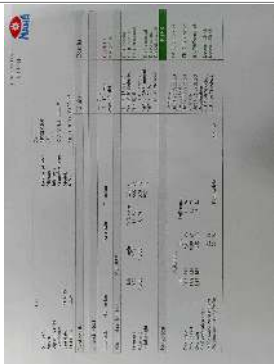

Brake and shock absorber repor

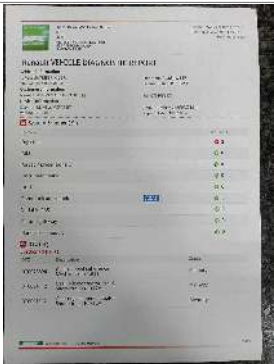

Diagnostic report page 1

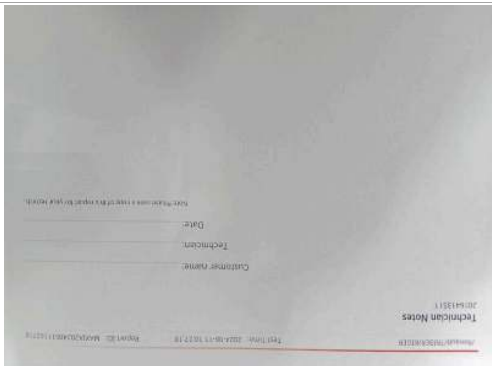

Diagnostic report page 2



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016413511

VIN: MEEHBC00600103468

DATE

11/06/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016413511

DATE
VIN: MEEHBC00600103468
11/06/2024
4/8



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Automatic transmission



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



CONDITION REPORT

Report No: 2016413511

DATE

11/06/2024

VIN: MEEHBC00600103468

5 / 8

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016413511

DATE
11/06/2024

VIN: MEEHBC00600103468

6 / 8



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Spare wheel and Accessories



CONDITION REPORT

Report No: 2016413511

DATE
11/06/2024

VIN: MEEHBC00600103468
7 / 8

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016413511

DATE
11/06/2024



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



Front chassis



Rear chassis



Oil cap and dipstick



CONDITION REPORT

Report No: 2016413511

DATE
11/06/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016413511

DATE
11/06/2024

Rear bumper



Rear bumper



Front Fender Left / Inner Tray



Main Beam Left



Radiator Cradle



Main Beam Right

**CONDITION REPORT**

Report No: 2016413511

DATE
11/06/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016413511

DATE
11/06/2024

Front Fender Left / Inner Tray



Water level



Front Bumper



Front Bumper

**CONDITION REPORT****Report No: 2016413511****DATE**
11/06/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za