



CONDITION REPORT

Report No: 2016847813

DATE
17/04/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	17/04/2025		M57 Pretoria Road - 1619
Inspection Date	17/04/2025		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	
Manufacturer	RENAULT	Registration Number	KF09NBGP
Model	KIGER	Register Number	
VIN	MEEHBC00800017921	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	30/11/2024
Color	WHITE	Power / Displacement	
Year Model		Paint Finish	C - COMMON
Km Reading	44,463 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Headlight Right Damaged	Replace
Front Bumper Residual Traces of Repair	Repair
Bonnet Paintwork • Chipmarks	Repair
Front Fender Right Residual Traces of Repair	Repair
Rear Fender Right Paintwork • Scratched	Repair
Door Front Left Paintwork • Scratched	Repair
Door Front Right Paintwork • Discoloured	Repair
Door Rear Left Paintwork • Scratched	Repair
Door Rear Right Paintwork • Scratched	Repair
Rear bumper Paintwork • Scratched	Repair
Windscreen Chipped	Repair
Body exterior	Vehicle got minor scratches, stone chips and dents
Body exterior	Signs of spray work done on some body panels

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEHBC00800017921



CONDITION REPORT

Report No: 2016847813

DATE
17/04/2025

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.9	2.7	-	
Rear	1.2	1.2	-	
Emergency / Parking	1.1	1.3	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	195/60R16	89V	Ceat	Securadrive	V	2621	3 mm
Front Right	195/60R16	89V	Dunlop	Sp sport	V	2321	3 mm
Rear Left	195/60R16	89V	Ceat	Securadrive	V	2521	3 mm
Rear Right	195/60R16	89V	Ceat	Securadrive	V	2421	3 mm
Spare	185/65R15	88R	Ceat	Stepnee	V	0000	4 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ACTIVE	DTC941113	OIL PRESSURE SENSOR CIRCUIT OPEN CIRCUIT	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Andrick Wymers

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.


DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEHBC00800017921



CONDITION REPORT

Report No: 2016847813

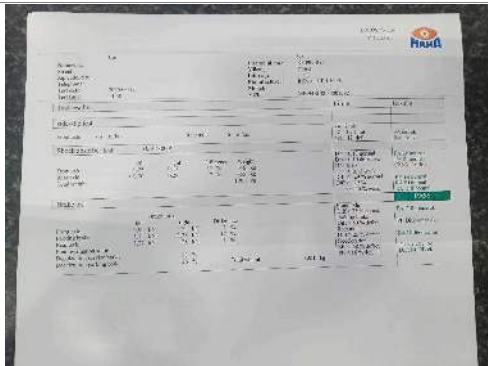DATE
17/04/2025

Shock and brake report



Diagnostic report



Diagnostic report



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEHBC00800017921



CONDITION REPORT

Report No: 2016847813

DATE
17/04/2025

DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Automatic



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEHBC00800017921



CONDITION REPORT

Report No: 2016847813

DATE
17/04/2025

90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Spare wheel

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEHBC00800017921




CONDITION REPORT

Report No: 2016847813

DATE
17/04/2025



LICENSE DISC

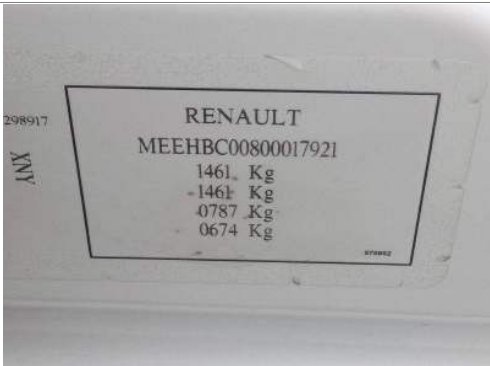

VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS



Oil cap and dipstick

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEHBC00800017921



CONDITION REPORT

Report No: 2016847813

DATE
17/04/2025

Expection bottle



Water level



Headlight Right



Windscreen



Door Front Right



Front Fender Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEHBC00800017921



CONDITION REPORT

Report No: 2016847813

DATE
17/04/2025

Rear Fender Right



Door Rear Right



Front Bumper



Front Bumper



Door Front Left



Door Rear Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEHBC00800017921



CONDITION REPORT

Report No: 2016847813

DATE
17/04/2025

Rear bumper



Rear bumper



Bonnet

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEHBC00800017921