



CONDITION REPORT



Report No:
2017304582
DATE
29/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	29/09/2026		M57 Pretoria Road - 1619
Inspection Date	29/09/2026		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	RENAULT	Registration Number	LS14GDGP
Model	KIGER	Register Number	
VIN	MEEHBC00900027454	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/03/2026
Color	SILVER	Power / Displacement	
Year Model		Paint Finish	M - METALLIC
Km Reading	58,808 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: MEEHBC00900027454



CONDITION REPORT



Report No:
2017304582
DATE
29/09/2026

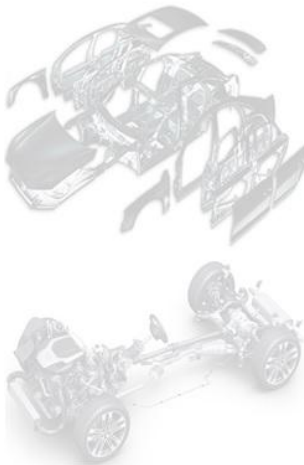

Damage	Repair Way
Switch Electrical Window Winder rear right Defective	Repair
Front Bumper Paintwork • Scratched	Repair
Boot Lid / Hatch door Dented	Repair
Tyre Front Left Smooth	Replace
Tyre Rear Left Damaged	Replace
Rim Rear Left Deformed	Repair
Rim Spare Wheel Deformed	Repair
Front tyre size differs	Replace
Engine light illuminated	Repair

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.5	2.5	-	
Rear	1.5	1.5	-	
Emergency / Parking	1.4	1.7	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	195/60R16	89H	MRF	Wanderer	V	3321	0 mm
Front Right	185/65R15	88R	Ceat	Temporary	V	3221	2 mm
Rear Left	195/60R16	89H	MRF	Wanderer	V	3221	5 mm
Rear Right	195/60R16	89H	MRF	Wanderer	V	3321	5 mm
Spare	195/60R16	89H	MRF	Wanderer	V	0000	1 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEHBC00900027454



CONDITION REPORT



Report No:
2017304582
DATE
29/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	INJECTION	DTC256200	BOOST PRESSURE SENSOR GENERAL ELECTRICAL FAILURE	

Inspection Conditions

No Test Drive
Rain at time of inspection
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Signs of spray work done on body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: MEEHBC00900027454




CONDITION REPORT




Report No:
2017304582
DATE
29/09/2026

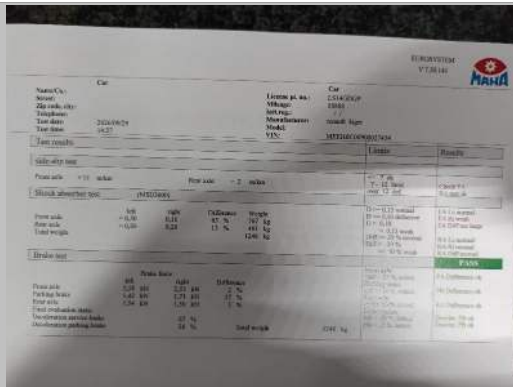


Shock and brake report

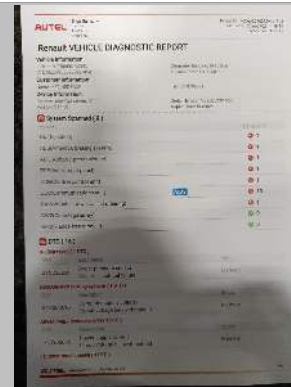

Diagnostics report

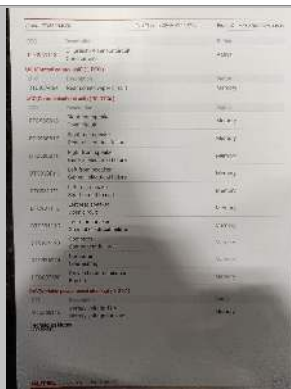

Diagnostics report

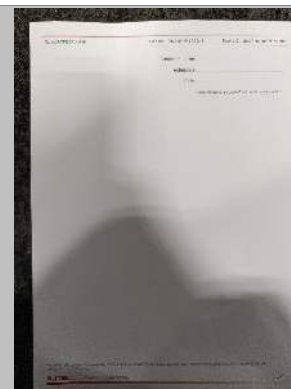

Diagnostics report



FRONT RIGHT CORNER



REAR LEFT CORNER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEHBC00900027454



CONDITION REPORT



Report No:

2017304582

DATE

29/09/2026



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual transmission



90 DEGREE FRONT



90 DEGREE RIGHT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEHBC00900027454



CONDITION REPORT



Report No:

2017304582

DATE

29/09/2026




90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD

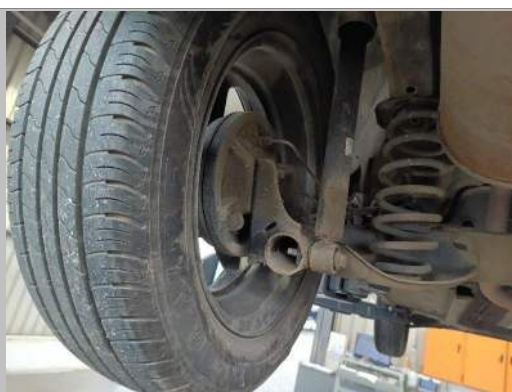

LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEHBC00900027454



CONDITION REPORT



Report No:

2017304582

DATE

29/09/2026



Sparewheel



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEHBC00900027454



CONDITION REPORT



Report No:

2017304582

DATE

29/09/2026



REAR



Expansion bottle




Oil cap and



Warning lights



Boot Lid / Hatch door

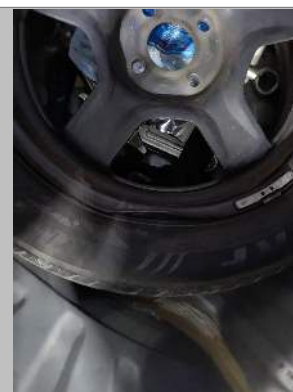

Rim Spare Wheel

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEHBC00900027454



CONDITION REPORT



Report No:

2017304582

DATE

29/09/2026



Switch Electrical Window Winder rear right



Switch Electrical Window Winder rear right



Front Bumper



Front Bumper



Tyre Front Left



Rim Rear Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEHBC00900027454



CONDITION REPORT



Report No:
2017304582
DATE
29/09/2026



Tyre Rear Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEHBC00900027454