



CONDITION REPORT

Report No: 2016336665

DATE
11/04/2024

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	11/04/2024		M57 Pretoria Road - 1619
Inspection Date	11/04/2024		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	TOYOTA	Registration Number	DZW088L
Model	AVANZA	Register Number	
VIN	MHKM5EA2N0K002884	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/08/2020
Color	GOLDEN	Power / Displacement	
Year Model		Paint Finish	M - METALLIC
Km Reading	315,590 KM	Fuel	PETROL
Cab / Body Type	STATION WAGON	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Battery clamps Defective	Repair
Central Air Vent Missing	Replace
Hooter Defective	Repair
Tail Light Right Damaged	Replace
Headlight Left Damaged	Replace
Dash Padding Damaged	Repair
Carpet Front Damaged	Repair
Carpet Rear Damaged	Replace
Number Plate Rear Missing	Replace
Front Bumper Paintwork • Scratched	Repair
Grill Cracked	Repair
Bonnet Dented	Repair
Front Fender Left Dented	Repair
Front Fender Right Dented	Repair
Rear Fender Left Paintwork • Scratched	Repair
Rear Fender Right Residual Traces of Repair	Repair
Door Front Left Dented	Repair
Door Front Right Dented	Repair
Door Rear Left Dented	Repair
Door Rear Right Paintwork • Scratched	Repair
Boot Lid / Hatch door Dented	Repair
Rear bumper Paintwork • Scratched	Repair
Windscreen Cracked	Replace
Shock Absorber Rear Left Leak	Replace
Shock Absorber Rear Right Leak	Replace
Control Arm(s) Front Axle Left Defective	Replace
Tyre Rear Left Smooth	Replace
Tyre Rear Right Smooth	Replace
Body exterior	Vehicle got minor scratches, stone chips and dents

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MHKM5EA2N0K002884

1 / 13



CONDITION REPORT

Report No: 2016336665

DATE
11/04/2024

Damage	Repair Way
Body exterior	Signs of spray work done on some body panels
All four hup caps missing	Replace
Both front fender liner missing	Replace
Battery loose	Repair
ABS and traction control light on	Repair

Brakes

Brake Test Results

	Left	Right	Axle Weight [KG]	Deceleration [m/s ²]
	Braking Force [KN]	Braking Force [KN]		
Front	2.3	2.5	-	
Rear	1.5	1.2	-	
Emergency / Parking	0.8	1	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	185/60R14	82H	Dunlop	Sp sport	V	3118	2 mm
Front Right	185/70R14	88H	Symmetry	Sy101	V	4821	4 mm
Rear Left	185/70R14	88H	Ardent	Tour rx1	V	3221	0 mm
Rear Right	185/70R14	88H	Royal black	Royal passen	V	4619	0 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

Inspection Conditions

No Test Drive
 Battery Flat
 Engine number – not possible to verify engine number (not visible without dismantling)
 Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Andrick Wymers

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
 www.dekraauto.co.za




CONDITION REPORT

VIN: RLKMF5A201633686

Report No: 201633686

2 / 13
DATE


11/04/2024

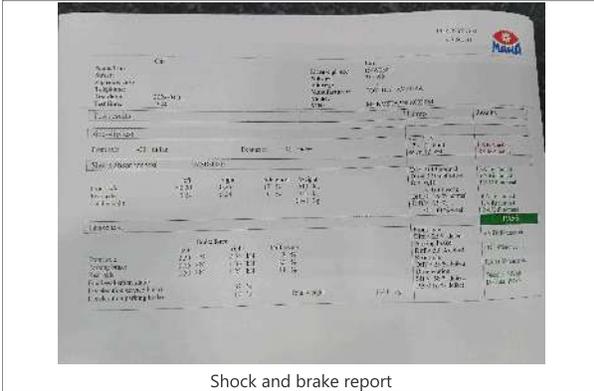

Shock and brake report



Diagnostic report

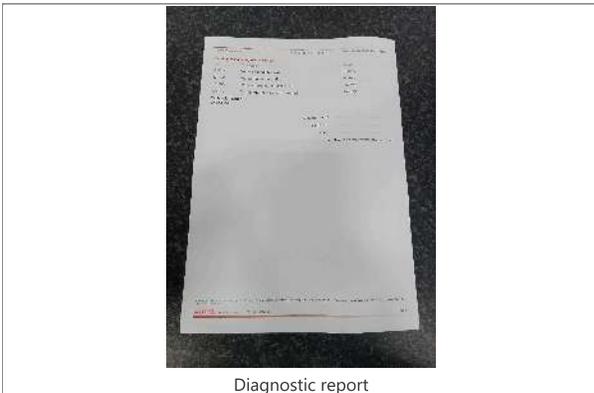

Diagnostic report



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016336665

VIN: MHKM5EA2N0K002884

DATE

11/04/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016336665

DATE: 11/04/2024
VIN: MHKM5EA21N0002824
4/13



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016336665

DATE
11/04/2024

VIN: MHKM5EA2N0K002884

5 / 13

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016336665

DATE
11/04/2024

VIN: MHKM5EA2N0K002884

6 / 13



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



No spare wheel

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016336665

DATE
11/04/2024

VIN: MHKM5EA2N0K002884

7 / 13

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016336665

DATE
11/04/2024



LICENSE DISC



VIN PLATE OR STICKER




ENGINE 1



ENGINE 2



CHASSIS

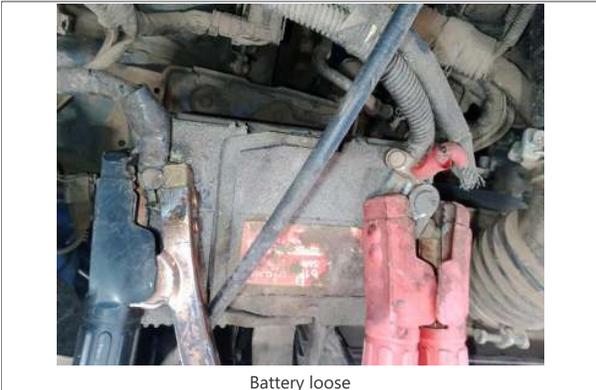

Battery loose

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016336665

DATE
11/04/2024

VIN: MHKM5EA2N0K002884

9 / 13

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016336665

DATE
11/04/2024




Coolant bottle



Oil cap and dipstick



Water level

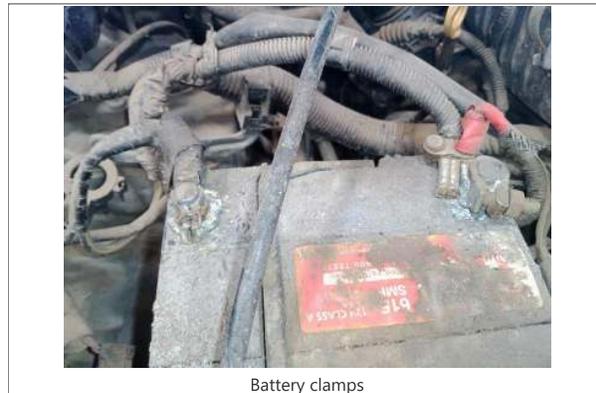

Battery clamps



Headlight Left



Grill

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016336665

DATE
11/04/2024

VIN: MHKM5EA2N0K002884

11 / 13

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016336665

DATE
11/04/2024



Windscreen



Carpet Front

NUMK002884
12 / 13



Carpet Rear



Carpet Rear



Carpet Rear



Tail Light Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016336665

DATE
11/04/2024

VIN: MHKM5EA2N0K002884

13 / 13

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016336665

DATE
11/04/2024



Number Plate Rear



Hooter



Rear Fender Right



Door Rear Right



Door Front Right



Front Fender Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016336665

DATE
11/04/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016336665

DATE
11/04/2024



Front Bumper



Front Bumper



Front Fender Left



Door Front Left



Door Rear Left



Rear Fender Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016336665

DATE
11/04/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016336665

DATE
11/04/2024



Rear bumper



Rear bumper



Rear bumper



Boot Lid / Hatch door



Tyre Rear Left



Tyre Rear Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016336665

DATE
11/04/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016336665


DATE
11/04/2024



Shock Absorber Rear Left



Shock Absorber Rear Right

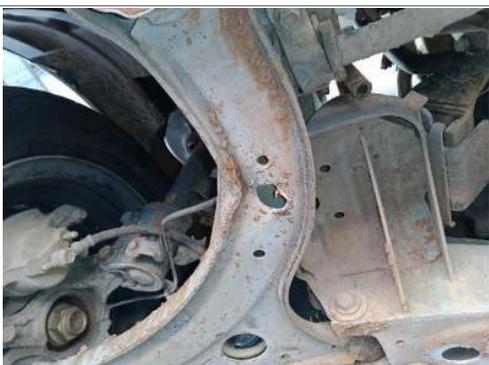

Control Arm(s) Front Axle Left



Dash Padding



Bonnet



Central Air Vent

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016336665

DATE
11/04/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za