



CONDITION REPORT

Report No: 2016205746

DATE
19/12/2023

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	19/12/2023		M57 Pretoria Road - 1619
Inspection Date	19/12/2023		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	TOYOTA	Registration Number	KBF583MP
Model	AVANZA	Register Number	
VIN	MHKM5FA2N0K006192	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	19/12/2023
Color	GOLDEN	Power / Displacement	
Year Model		Paint Finish	M - METALLIC
Km Reading	210,824 KM	Fuel	PETROL
Cab / Body Type	STATION WAGON	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Tail Light Right Damaged	Replace
Headlight Left Damaged	Repair
Seat Front Left Damaged	Repair
Seat Front Right Damaged	Repair
Seat Rear Damaged	Repair
Carpet Front Damaged	Repair
Carpet Rear Damaged	Repair
Side Mirror Left Paintwork • Discoloured	Repair
Front Bumper Damaged	Repair
Bonnet Paintwork • Discoloured	Repair
Front Fender Left Dented	Repair
Front Fender Right Paintwork • Discoloured	Repair
Rear Fender Left Paintwork • Discoloured	Repair
Rear Fender Right Paintwork • Discoloured	Repair
Door Front Left Paintwork • Scratched	Repair
Door Front Right Paintwork • Discoloured	Repair
Door Rear Left Paintwork • Discoloured	Repair
Door Rear Right Paintwork • Scratched	Repair
Boot Lid / Hatch door Welded	Repair
Rear bumper Paintwork • Scratched	Repair
Windscreen Cracked	Replace
Tie Rod End right Defective	Replace
Split Pin Left Incorrect	Replace
Shock Absorber Rear Right Leak	Replace
Ball Joint(s) Front Axle Right Damaged	Replace
L/F fender line missing	Replace
Windscreen sealing rubber missing	Replace
No license disc	Replace

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MHKM5FA2N0K006192

1 / 13



CONDITION REPORT

Report No: 2016205746

 DATE
19/12/2023

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.3	2.2	-	
Rear	1.9	1.9	-	
Emergency / Parking	1.2	1.5	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	185/65R14	86H	Symmetry	Sy101	V	4521	3 mm
Front Right	185/65R14	86H	Xcent	El601	V	2820	3 mm
Rear Left	165/70R14	81T	MRF	Zvtv	V	0122	3 mm
Rear Right	185/65R14	86H	Dunlop	Sp sport	V	3717	2 mm
Spare	175/65R14	82T	Goodyear	Gt2	V	////	2 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Body • Exterior: Vehicle got minor scratches, stone chips and dents on some body panels. Signs of spray work done on some body panels and discoloring on some body panels

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Andrick Wymers

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



CONDITION REPORT


VIN: MLKMF5A2096205746

Report No: 2096205746


2 / 13

DATE

19/12/2023

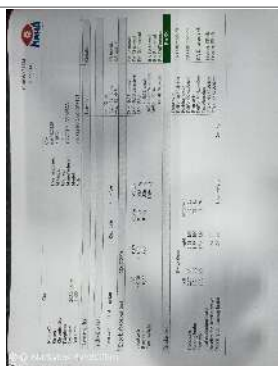

Shock and brake report

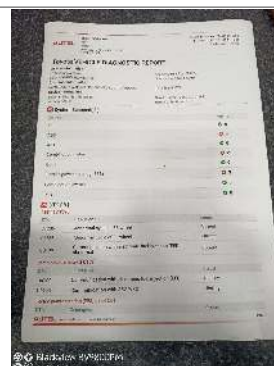

Diagnostic report



Diagnostic report



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016205746
VIN: MHKM5FA2N0K006192
DATE
3/13
19/12/2023

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016205746

DATE
VIN: MHKM5FA219102023
19/10/2023
4 / 13



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016205746

DATE
19/12/2023

VIN: MHKM5FA2N0K006192

5 / 13

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016205746


DATE
19/12/2023

VIN: MHKM5FA2N0K006192


6 / 13



LF TYRE TREAD

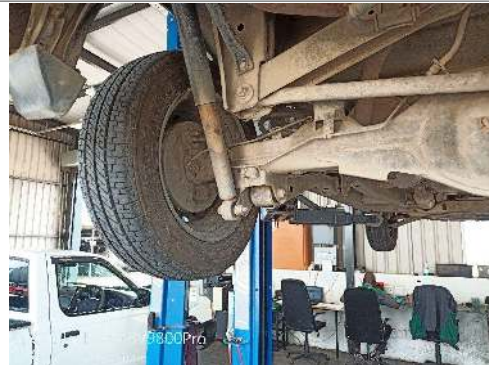

LR TYRE TREAD

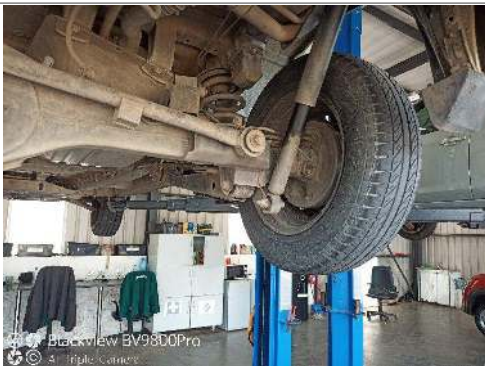

RR TYRE TREAD



RF TYRE TREAD



Spare wheel



LICENSE DISC



CONDITION REPORT

Report No: 2016205746

DATE
19/12/2023

VIN: MHKM5FA2N0K006192
7 / 13

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016205746

DATE
19/12/2023



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS



Coolant bottle



Oil cap and dipstick



CONDITION REPORT

Report No: 2016205746

DATE
19/12/2023

VIN: MHKM5FA2N0K006192
9 / 13

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016205746

DATE
19/12/2023

Manual



Windscreen



Water level



Water level



Headlight Left



Tail Light Right



CONDITION REPORT

Report No: 2016205746

DATE
19/12/2023

VIN: MHKM5FA2N0K006192

11 / 13

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016205746

DATE
19/12/2023

Seat Front Left



Seat Front Right



Seat Rear



Carpet Rear



Carpet Front



Front Fender Right



CONDITION REPORT

Report No: 2016205746

DATE
19/12/2023

VIN: MHKM5FA2N0K006192
13 / 13

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016205746

DATE
19/12/2023

Bonnet



Front Bumper



Front Bumper



Front Fender Left



Side Mirror Left



Door Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016205746

DATE
19/12/2023

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016205746

DATE
19/12/2023

Door Rear Left



Rear Fender Left



Boot Lid / Hatch door



Boot Lid / Hatch door



Boot Lid / Hatch door



Rear bumper



CONDITION REPORT

Report No: 2016205746

DATE
19/12/2023

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016205746

DATE
19/12/2023

Rear bumper



Rear Fender Right



Door Rear Right



Door Front Right



Shock Absorber Rear Right



Ball Joint(s) Front Axle Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016205746

DATE
19/12/2023

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016205746

DATE
19/12/2023

Split Pin Left



Tie Rod End right

**CONDITION REPORT****Report No: 2016205746****DATE**
19/12/2023

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za