



CONDITION REPORT



Report No:
2016980822
DATE
15/08/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	15/08/2025		M57 Pretoria Road - 1619
Inspection Date	15/08/2025		Kempton Park - GT

Vehicle Data

Vehicle Type	LIGHT LOAD VEHICLE	Registered Owner	MFC
Manufacturer	NISSAN	Registration Number	JR79TGGP
Model	NAVARA 2.3 SE D-CAB DSL PU AT [2018-2021]	Register Number	
VIN	MNTCB2D23Z0000930	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	
Color	GREY	Power / Displacement	
Year Model	2018	Paint Finish	TWO COAT METALLIC
Km Reading	131,964 KM	Fuel	DIESEL
Cab / Body Type	DOUBLE CAB	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: MNTCB2D23Z0000930



CONDITION REPORT



Report No:
2016980822
DATE
15/08/2025

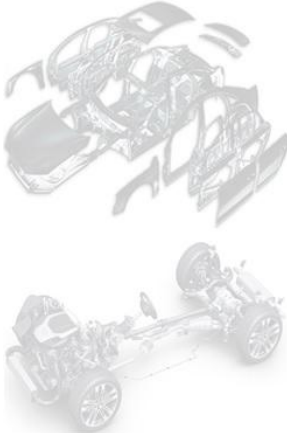	Damage	Repair Way
	Engine Oil Leak	Repair
	Front Bumper Damaged	Repair
	Bonnet Damaged	Repair
	Front Fender Left Damaged	Repair
	Front Fender Right Damaged	Repair
	Rear Fender Left Damaged	Repair
	Rear Fender Right Damaged	Repair
	Door Front Right Damaged	Repair
	Door Rear Left Damaged	Repair
	Door Rear Right Damaged	Repair
	Tailgate Damaged	Repair
	Rear bumper Damaged	Repair
	Windscreen Damaged	Replace
	Gearbox Oil Leak	Replace

Brakes

Brake Test Results

	Left	Right	Axle Weight [KG]	Deceleration [m/s²]
	Braking Force [KN]	Braking Force [KN]		
Front	3.86	4.09	-	
Rear	2.97	2.95	-	
Emergency / Parking	2.99	3.2	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	265/60R18	110T	Bridgestone	Radial	V	4422	3 mm
Front Right	265/60R18	110T	Bridgestone	Radial	V	4522	3 mm
Rear Left	265/60R18	110T	Bridgestone	Radial	V	4422	3 mm
Rear Right	265/60R18	110T	Bridgestone	Radial	V	4422	3 mm
Spare	255/70R16	111H	Toyo	Radial	V	0218	3 mm

* Tyre Legend: V=Virgin, R=Recap

**CONDITION REPORT**

Report No:
2016980822
DATE
15/08/2025

Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: Body • Exterior: Minor dents and scratches and stone chips to some body panels. Signs of repair work done to somebody panels. Repair work done to vehicle below standard. Poor alignment to somebody panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MNTCB2D23Z0000930



CONDITION REPORT




Report No:
2016980822
DATE
15/08/2025




Oil cap and dipstick.




Automatic.

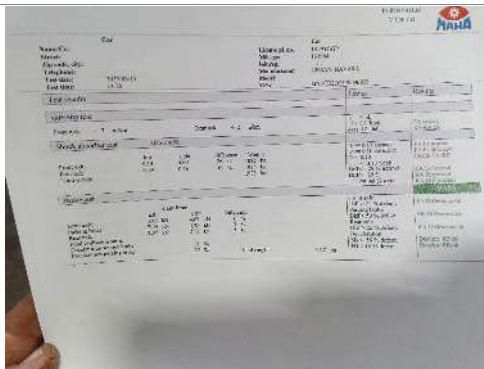

Brake test.

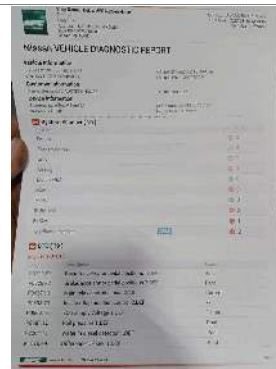

Diagnostic.

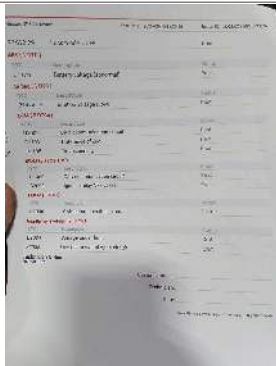

Diagnostic.



Undercarriage front.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MNTCB2D23Z0000930



CONDITION REPORT



Report No:
2016980822
DATE
15/08/2025



Undercarriage rear.



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MNTCB2D23Z0000930



CONDITION REPORT



Report No:
2016980822
DATE
15/08/2025



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MNTCB2D23Z0000930




CONDITION REPORT



Report No:
2016980822
DATE
15/08/2025



RR TYRE TREAD

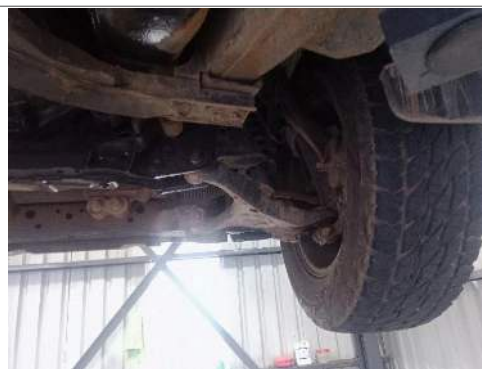

RF TYRE TREAD



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



Water level

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MNTCB2D23Z0000930



CONDITION REPORT



Report No:
2016980822
DATE
15/08/2025



Front Bumper



Front Bumper



Bonnet



Front Fender Left



Door Rear Left



Rear Fender Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MNTCB2D23Z0000930




CONDITION REPORT



Report No:
2016980822
DATE
15/08/2025




Tailgate

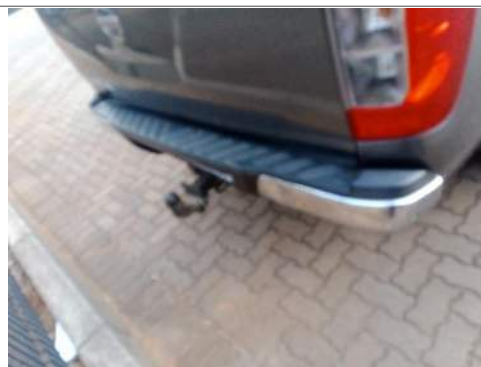

Rear bumper



Rear Fender Right

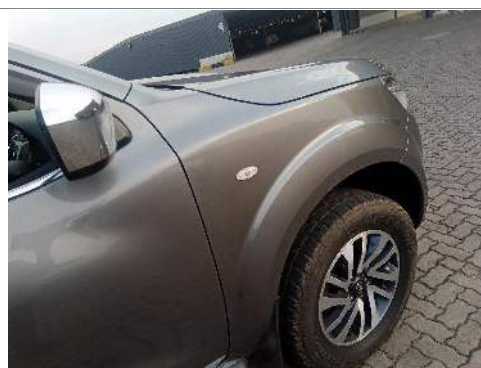

Front Fender Right



Door Front Right



Door Rear Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: MNTCB2D23Z0000930



CONDITION REPORT



Report No:
2016980822
DATE
15/08/2025

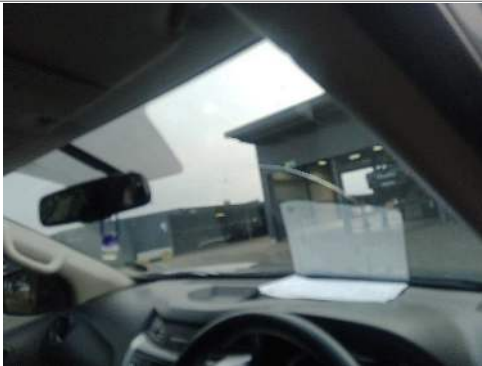

Windscreen



Engine



Gearbox

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MNTCB2D23Z0000930