



CONDITION REPORT

Report No: 2016837880

DATE
10/04/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	10/04/2025		M57 Pretoria Road - 1619
Inspection Date	10/04/2025		Kempton Park - GT


Vehicle Data

Vehicle Type	LIGHT LOAD VEHICLE	Registered Owner	
Manufacturer	NISSAN	Registration Number	FSP314L
Model	NAVARA 2.3 LE D-CAB DSL 4X4 PU [2017-2019]	Register Number	
VIN	MNTCB4D23Z0001610	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	30/11/2025
Color	WHITE	Power / Displacement	
Year Model	2017	Paint Finish	C - COMMON
Km Reading	217,564 KM	Fuel	DIESEL
Cab / Body Type	DOUBLE CAB	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

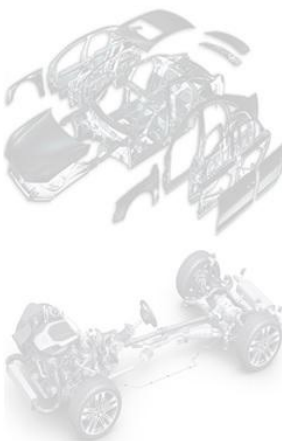

Damage	Repair Way
Hoses Oil Leak	Repair
Tail Light Left Damaged	Replace
Tail Light Right Damaged	Replace
Seat Front Right Torn / Cut	Repair
Door Panel Front Right Torn / Cut	Repair
Front Bumper Paintwork • Scratched	Repair
Grill Damaged	Replace
Bonnet Paintwork • Flaking	Repair
Front Fender Left Paintwork • Dull	Repair
Door Front Left Residual Traces of Repair	Repair
Load Body Residual Traces of Repair	Repair
Bolt(s) / Nut(s) Rear Wheel Left Missing	Replace
Gearbox Oil Leak	Repair
Warning lights illuminated	Repair

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MNTCB4D23Z0001610



CONDITION REPORT

Report No: 2016837880

DATE
10/04/2025

Brakes

Brake Test Results

No Brake Test on a brake test machine has been performed.

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	-	-	-	
Rear	-	-	-	
Emergency / Parking	-	-	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	265/60R18	110H	Dunlop	Grandtrek	V	1522	2 mm
Front Right	265/60R18	110H	Dunlop	Grandtrek	V	1522	1 mm
Rear Left	265/60R18	110H	Dunlop	Grandtrek	V	1522	0 mm
Rear Right	265/60R18	110H	Dunlop	Grandtrek	V	1522	3 mm
Spare	265/60R18	109T	GT radial	Advance	V	0000	1 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ENGINE	P0370:96	PREHEATING UNIT DIAGNOSIS CONNECTION 1 DEF	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Residual traces poor repair work on some body panels. Signs of spray work done on some body panels. Minor dents scratches stone chips on some body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.


DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MNTCB4D23Z0001610




CONDITION REPORT


Report No: 2016837880

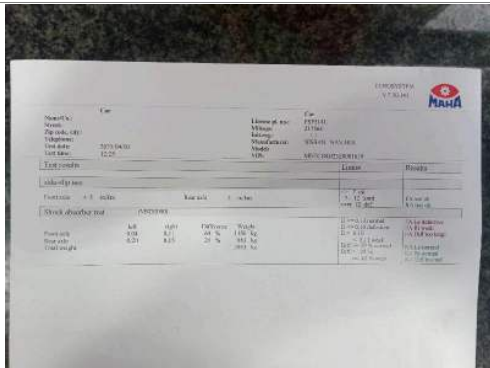DATE
10/04/2025


Shock test

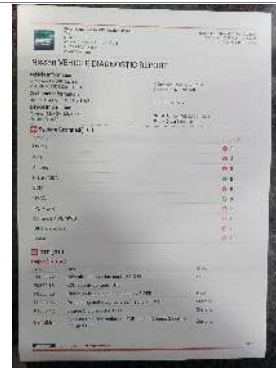

Diagnostic test

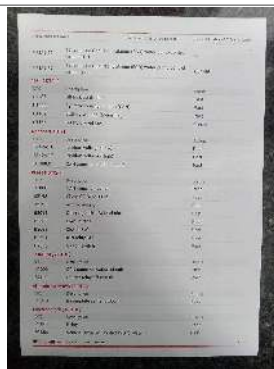

Diagnostic test

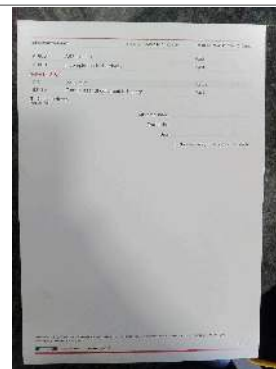

Diagnostic test



FRONT RIGHT CORNER



REAR LEFT CORNER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MNTCB4D23Z0001610



CONDITION REPORT

Report No: 2016837880

DATE
10/04/2025

INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual



90 DEGREE FRONT



90 DEGREE RIGHT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MNTCB4D23Z0001610



CONDITION REPORT


Report No: 2016837880

DATE
10/04/2025

90 DEGREE REAR



90 DEGREE LEFT

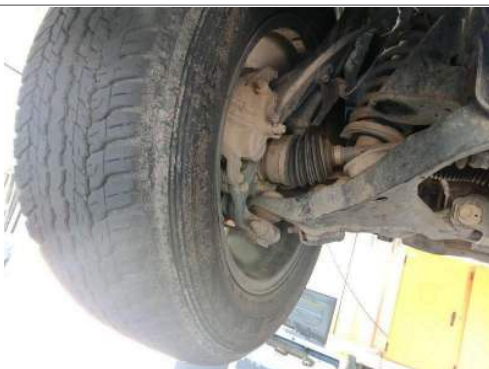


LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD

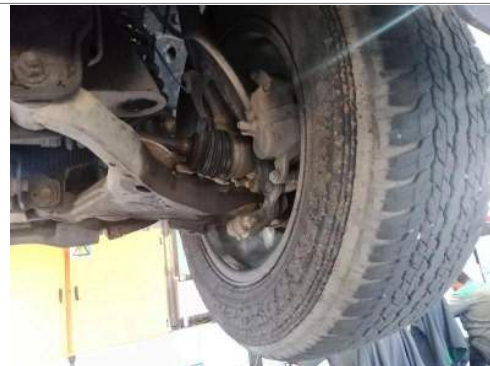

RF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MNTCB4D23Z0001610



CONDITION REPORT

Report No: 2016837880

DATE
10/04/2025

Sparewheel



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MNTCB4D23Z0001610



CONDITION REPORT

Report No: 2016837880

DATE
10/04/2025

Rear end



Warning lights illuminated



Expansion bottle



Oil cap and dipstick



Load Body



Load Body

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MNTCB4D23Z0001610



CONDITION REPORT

Report No: 2016837880

DATE
10/04/2025

Tail Light Right



Tail Light Left



Front Fender Left



Bonnet



Bonnet



Water level

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MNTCB4D23Z0001610



CONDITION REPORT

Report No: 2016837880

DATE
10/04/2025

Water level



Front Fender Left



Front Fender Left



Grill



Front Bumper



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MNTCB4D23Z0001610



CONDITION REPORT

Report No: 2016837880

DATE
10/04/2025

Front Bumper



Door Front Left



Bolt(s) / Nut(s) Rear Wheel Left



Load Body



Hoses



Gearbox

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MNTCB4D23Z0001610



CONDITION REPORT

Report No: 2016837880

DATE
10/04/2025

Gearbox



Gearbox



Seat Front Right



Seat Front Right



Door Panel Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MNTCB4D23Z0001610