



CONDITION REPORT



Report No:
2017302460
DATE
23/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	23/09/2026		M57 Pretoria Road - 1619
Inspection Date	23/09/2026		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	KIA	Registration Number	HMY089L
Model	SONET	Register Number	
VIN	MZBFB814LRN470025	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	30/11/2026
Color	SILVER	Power / Displacement	
Year Model		Paint Finish	M - METALLIC
Km Reading	35,804 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: MZBFB814LRN470025



CONDITION REPORT



Report No:
2017302460
DATE
23/09/2026

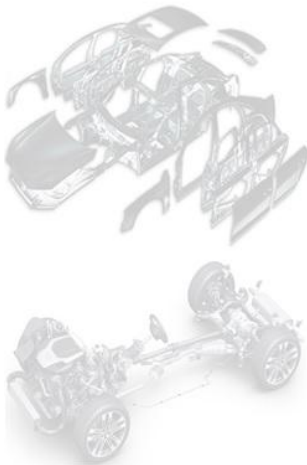

Damage	Repair Way
Front Bumper Paintwork • Scratched	Repair
Door Rear Right Paintwork • Scratched	Repair
Windscreen Chipped	Replace

Brakes

Brake Test Results

	Left	Right	Axle Weight [KG]	Deceleration [m/s ²]
	Braking Force [KN]	Braking Force [KN]		
Front	2.7	2.4	-	
Rear	1.7	1.5	-	
Emergency / Parking	1	1	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	215/60R16	95H	MRF	Wanderer	V	3624	5 mm
Front Right	215/60R16	95H	MRF	Wanderer	V	3624	6 mm
Rear Left	215/60R16	95H	MRF	Wanderer	V	3624	6 mm
Rear Right	215/60R16	95H	MRF	Wanderer	V	3624	6 mm
Spare	195/60R15	91H	Goodyear	Assurance	V	0000	6 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MZBFB814LRN470025



CONDITION REPORT



Report No:
2017302460
DATE
23/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	MOTOR DRIVEN POWER STEERING	C1102:16	BATTERY VOLTAGE LOW	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Engine Compartment: Bottom of engine is fully covered.
Body • Exterior: Signs of spray work done on body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MZBFB814LRN470025



CONDITION REPORT



Report No:

2017302460

DATE _____

23/09/2026

[illegible]

Shock and brake report

The screenshot displays the AUTEL diagnostic software interface. At the top, the 'AUTEL' logo is on the left, and the 'Diagnostic Report' title is on the right. Below the title, the 'Kia Vehicle Diagnostic Report' is prominently displayed. The report is organized into several sections: 'Vehicle Information' (listing VIN, Year, Make, Model, and Engine), 'Diagnostic Information' (listing the Diagnostic Trouble Code (DTC), Diagnostic Trouble Code (DTC), and Diagnostic Trouble Code (DTC)), 'Diagnostic Results' (listing the Diagnostic Trouble Code (DTC), Diagnostic Trouble Code (DTC), and Diagnostic Trouble Code (DTC)), and 'Diagnostic Summary' (listing the Diagnostic Trouble Code (DTC), Diagnostic Trouble Code (DTC), and Diagnostic Trouble Code (DTC)). The interface is clean and professional, with a white background and blue accents. The text is clear and legible, making it easy to read the diagnostic information.

Diagnostics report

1947 11 20
 1948 1 10
 1949 1 10
 1950 1 10
 1951 1 10
 1952 1 10
 1953 1 10
 1954 1 10
 1955 1 10
 1956 1 10
 1957 1 10
 1958 1 10
 1959 1 10
 1960 1 10
 1961 1 10
 1962 1 10
 1963 1 10
 1964 1 10
 1965 1 10
 1966 1 10
 1967 1 10
 1968 1 10
 1969 1 10
 1970 1 10
 1971 1 10
 1972 1 10
 1973 1 10
 1974 1 10
 1975 1 10
 1976 1 10
 1977 1 10
 1978 1 10
 1979 1 10
 1980 1 10
 1981 1 10
 1982 1 10
 1983 1 10
 1984 1 10
 1985 1 10
 1986 1 10
 1987 1 10
 1988 1 10
 1989 1 10
 1990 1 10
 1991 1 10
 1992 1 10
 1993 1 10
 1994 1 10
 1995 1 10
 1996 1 10
 1997 1 10
 1998 1 10
 1999 1 10
 2000 1 10
 2001 1 10
 2002 1 10
 2003 1 10
 2004 1 10
 2005 1 10
 2006 1 10
 2007 1 10
 2008 1 10
 2009 1 10
 2010 1 10
 2011 1 10
 2012 1 10
 2013 1 10
 2014 1 10
 2015 1 10
 2016 1 10
 2017 1 10
 2018 1 10
 2019 1 10
 2020 1 10
 2021 1 10
 2022 1 10
 2023 1 10
 2024 1 10
 2025 1 10
 2026 1 10
 2027 1 10
 2028 1 10
 2029 1 10
 2030 1 10
 2031 1 10
 2032 1 10
 2033 1 10
 2034 1 10
 2035 1 10
 2036 1 10
 2037 1 10
 2038 1 10
 2039 1 10
 2040 1 10
 2041 1 10
 2042 1 10
 2043 1 10
 2044 1 10
 2045 1 10
 2046 1 10
 2047 1 10
 2048 1 10
 2049 1 10
 2050 1 10
 2051 1 10
 2052 1 10
 2053 1 10
 2054 1 10
 2055 1 10
 2056 1 10
 2057 1 10
 2058 1 10
 2059 1 10
 2060 1 10
 2061 1 10
 2062 1 10
 2063 1 10
 2064 1 10
 2065 1 10
 2066 1 10
 2067 1 10
 2068 1 10
 2069 1 10
 2070 1 10
 2071 1 10
 2072 1 10
 2073 1 10
 2074 1 10
 2075 1 10
 2076 1 10
 2077 1 10
 2078 1 10
 2079 1 10
 2080 1 10
 2081 1 10
 2082 1 10
 2083 1 10
 2084 1 10
 2085 1 10
 2086 1 10
 2087 1 10
 2088 1 10
 2089 1 10
 2090 1 10
 2091 1 10
 2092 1 10
 2093 1 10
 2094 1 10
 2095 1 10
 2096 1 10
 2097 1 10
 2098 1 10
 2099 1 10
 2100 1 10
 2101 1 10
 2102 1 10
 2103 1 10
 2104 1 10
 2105 1 10
 2106 1 10
 2107 1 10
 2108 1 10
 2109 1 10
 2110 1 10
 2111 1 10
 2112 1 10
 2113 1 10
 2114 1 10
 2115 1 10
 2116 1 10
 2117 1 10
 2118 1 10
 2119 1 10
 2120 1 10
 2121 1 10
 2122 1 10
 2123 1 10
 2124 1 10
 2125 1 10
 2126 1 10
 2127 1 10
 2128 1 10
 2129 1 10
 2130 1 10
 2131 1 10
 2132 1 10
 2133 1 10
 2134 1 10
 2135 1 10
 2136 1 10
 2137 1 10
 2138 1 10
 2139 1 10
 2140 1 10
 2141 1 10
 2142 1 10
 2143 1 10
 2144 1 10
 2145 1 10
 2146 1 10
 2147 1 10
 2148 1 10
 2149 1 10
 2150 1 10
 2151 1 10
 2152 1 10
 2153 1 10
 2154 1 10
 2155 1 10
 2156 1 10
 2157 1 10
 2158 1 10
 2159 1 10
 2160 1 10
 2161 1 10
 2162 1 10
 2163 1 10
 2164 1 10
 2165 1 10
 2166 1 10
 2167 1 10
 2168 1 10
 2169 1 10
 2170 1 10
 2171 1 10
 2172 1 10
 2173 1 10
 2174 1 10
 2175 1 10
 2176 1 10
 2177 1 10
 2178 1 10
 2179 1 10
 2180 1 10
 2181 1 10
 2182 1 10
 2183 1 10
 2184 1 10
 2185 1 10
 2186 1 10
 2187 1 10
 2188 1 10
 2189 1 10
 2190 1 10
 2191 1 10
 2192 1 10
 2193 1 10
 2194 1 10
 2195 1 10
 2196 1 10
 2197 1 10
 2198 1 10
 2199 1 10
 2200 1 10
 2201 1 10
 2202 1 10
 2203 1 10
 2204 1 10
 2205 1 10
 2206 1 10
 2207 1 10
 2208 1 10
 2209 1 10
 2210 1 10
 2211 1 10
 2212 1 10
 2213 1 10
 2214 1 10
 2215 1 10
 2216 1 10
 2217 1 10
 2218 1 10
 2219 1 10
 2220 1 10
 2221 1 10
 2222 1 10
 2223 1 10
 2224 1 10
 2225 1 10
 2226 1 10
 2227 1 10
 2228 1 10
 2229 1 10
 2230 1 10
 2231 1 10
 2232 1 10
 2233 1 10
 2234 1 10
 2235 1 10
 2236 1 10
 2237 1 10
 2238 1 10
 22

Diagnostics report



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MZBFB814LRN470025



CONDITION REPORT



Report No:
2017302460
DATE
23/09/2026



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual transmission



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MZBFB814LRN470025



CONDITION REPORT



Report No:
2017302460
DATE
23/09/2026



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Sparewheel

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MZBFB814LRN470025



CONDITION REPORT



Report No:
2017302460
DATE
23/09/2026



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS



REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MZBFB814LRN470025



CONDITION REPORT



Report No:
2017302460
DATE
23/09/2026



Oil cap and dipstick



Coolant reservoir



Windscreen



Door Rear Right



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MZBFB814LRN470025