



CONDITION REPORT



Report No:
2017302382
DATE
22/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	22/09/2026		M57 Pretoria Road - 1619
Inspection Date	22/09/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	KIA	Registration Number	KK89DRGP
Model	SONET	Register Number	
VIN	MZBFC814LNN134053	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	30/04/2027
Color	GOLDEN	Power / Displacement	
Year Model		Paint Finish	TWO COAT METALLIC
Km Reading	71,008 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: MZBFC814LNN134053



CONDITION REPORT



Report No:
2017302382
DATE
22/09/2026

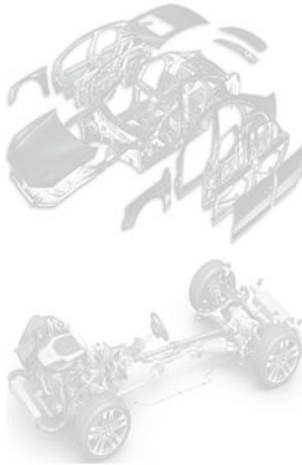

Damage	Repair Way
Battery box Damaged	Repair
Center Console / Cubbyhole + Lid Damaged	Repair
Windscreen Wiper Damaged	Replace
Seat Front Right Damaged	Repair
Seat Rear Damaged	Repair
Door Handle Front Right Defective	Repair
Door Sealing Rubber Front Right Damaged	Replace
Front Bumper Paintwork • Scratched	Repair
Bonnet Dented	Repair
Rear Fender Right Dented	Repair
Door Front Right Dented	Repair
Door Rear Right Dented	Repair
Rear bumper Defective	Repair
Sill Panel Left Dented	Repair
Roof Paintwork • Scratched	Repair
Windscreen Chipped	Repair
Rim Front Left Scratched	Repair
Deceleration service brake defective	Repair

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	1.85	2.03	-	
Rear	1.62	1.98	-	
Emergency / Parking	1.07	1.26	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	215/60 R16	95H	Apollo	Alnac	V	4621	3 mm
Front Right	215/60 R16	95H	Apollo	Alnac	V	4621	4 mm
Rear Left	215/60 R16	95H	Apollo	Alnac	V	4621	5 mm
Rear Right	215/60 R16	95H	Apollo	Alnac	V	4621	5 mm
Spare	195/65 R15	91H	Goodyear	Assurance	V	3921	0 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MZBFC814LNN134053



CONDITION REPORT



Report No:

2017302382

DATE

22/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	AB(AIRBAG)	B1102:00	BATTERY VOLTAGE LOW	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.Engine Compartment: Signs of rodent in engine bay.

Interior: Vehicle interior dirty and panels scratched.

Body • Exterior: Dents and scratches on body panelsSigns of hail damage on body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MZBFC814LNN134053



CONDITION REPORT



Report No:

2017302382

DATE _____

22/09/2026

Cari		Cari	
Area 1:		Area 2:	
Area 2:		Area 3:	
Area 3:		Area 4:	
Area 4:		Area 5:	
Area 5:		Area 6:	
Area 6:		Area 7:	
Area 7:		Area 8:	
Area 8:		Area 9:	
Area 9:		Area 10:	
Area 10:		Area 11:	
Area 11:		Area 12:	
Area 12:		Area 13:	
Area 13:		Area 14:	
Area 14:		Area 15:	
Area 15:		Area 16:	
Area 16:		Area 17:	
Area 17:		Area 18:	
Area 18:		Area 19:	
Area 19:		Area 20:	
Area 20:		Area 21:	
Area 21:		Area 22:	
Area 22:		Area 23:	
Area 23:		Area 24:	
Area 24:		Area 25:	
Area 25:		Area 26:	
Area 26:		Area 27:	
Area 27:		Area 28:	
Area 28:		Area 29:	
Area 29:		Area 30:	
Area 30:		Area 31:	
Area 31:		Area 32:	
Area 32:		Area 33:	
Area 33:		Area 34:	
Area 34:		Area 35:	
Area 35:		Area 36:	
Area 36:		Area 37:	
Area 37:		Area 38:	
Area 38:		Area 39:	
Area 39:		Area 40:	
Area 40:		Area 41:	
Area 41:		Area 42:	
Area 42:		Area 43:	
Area 43:		Area 44:	
Area 44:		Area 45:	
Area 45:		Area 46:	
Area 46:		Area 47:	
Area 47:		Area 48:	
Area 48:		Area 49:	
Area 49:		Area 50:	
Area 50:		Area 51:	
Area 51:		Area 52:	
Area 52:		Area 53:	
Area 53:		Area 54:	
Area 54:		Area 55:	
Area 55:		Area 56:	
Area 56:		Area 57:	
Area 57:		Area 58:	
Area 58:		Area 59:	
Area 59:		Area 60:	
Area 60:		Area 61:	
Area 61:		Area 62:	
Area 62:		Area 63:	
Area 63:		Area 64:	
Area 64:		Area 65:	
Area 65:		Area 66:	
Area 66:		Area 67:	
Area 67:		Area 68:	
Area 68:		Area 69:	
Area 69:		Area 70:	
Area 70:		Area 71:	
Area 71:		Area 72:	
Area 72:		Area 73:	
Area 73:		Area 74:	
Area 74:		Area 75:	
Area 75:		Area 76:	
Area 76:		Area 77:	
Area 77:		Area 78:	
Area 78:		Area 79:	
Area 79:		Area 80:	
Area 80:		Area 81:	
Area 81:		Area 82:	
Area 82:		Area 83:	
Area 83:		Area 84:	
Area 84:		Area 85:	
Area 85:		Area 86:	
Area 86:		Area 87:	
Area 87:		Area 88:	
Area 88:		Area 89:	
Area 89:		Area 90:	
Area 90:		Area 91:	
Area 91:		Area 92:	
Area 92:		Area 93:	
Area 93:		Area 94:	
Area 94:		Area 95:	
Area 95:		Area 96:	
Area 96:		Area 97:	
Area 97:		Area 98:	
Area 98:		Area 99:	
Area 99:		Area 100:	

Brake and shock absorber report

[illegible]

Diagnostic report page 1

WISCONSIN	Test Time: 2006-03-22 15:19:18	Report ID: MUKIA2026UN22151W18
Technician Notes 2017302362		
Customer name: _____		
Technician: _____		
Date: _____		
Note: Please save a copy of this report for your records.		

Diagnostic report page 2



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MZBFC814LNN134053



CONDITION REPORT



Report No:
2017302382
DATE
22/09/2026



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual Transmission



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MZBFC814LNN134053



CONDITION REPORT



Report No:
2017302382
DATE
22/09/2026



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Spare Wheel and Accessories

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MZBFC814LNN134053



CONDITION REPORT



Report No:

2017302382

DATE

22/09/2026



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



Front chassis



Oil cap and dipstick



Rear chassis

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MZBFC814LNN134053



CONDITION REPORT



Report No:
2017302382
DATE
22/09/2026



Center Console / Cubbyhole + Lid



Door Sealing Rubber Front Right



Seat Front Right



Seat Rear



Rear Fender Right



Door Rear Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MZBFC814LNN134053



CONDITION REPORT



Report No:

2017302382

DATE

22/09/2026



Door Front Right



Bonnet



Bonnet



Windscreen



Sill Panel Left



Rear bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MZBFC814LNN134053



CONDITION REPORT



Report No:

2017302382

DATE

22/09/2026



Roof



Water level



Battery box



Front Bumper



Front Bumper



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MZBFC814LNN134053



CONDITION REPORT



Report No:
2017302382
DATE
22/09/2026



Rim Front Left



Water level



Door Handle Front Right



Windscreen Wiper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MZBFC814LNN134053