



CONDITION REPORT



Report No:
2017306469
DATE
02/10/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	02/10/2026		M57 Pretoria Road - 1619
Inspection Date	02/10/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	LAND ROVER	Registration Number	LS48XMGP
Model	DISCOVERY SPORT 2.0 I4 HSE DSL 4X4 AT [2016-2018]	Register Number	
		Date Of First Licensing	
VIN	SALCA2AN4JH731168	Last COR	
Engine Number		License Expiry Date	31/03/2026
Doors	5	Power / Displacement	
Color	WHITE	Paint Finish	C - COMMON
Year Model	2018	Fuel	DIESEL
Km Reading	111,599 KM	Transmission	AUTOMATIC
Cab / Body Type	STATION WAGON		

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: SALCA2AN4JH731168



CONDITION REPORT



Report No:

2017306469

DATE

02/10/2026



Damage

Repair Way

Radio/CD/USB Defective	Repair
Side Mirror Left Paintwork • Scratched	Repair
Front Fender Left Paintwork • Scratched	Repair
Front Fender Right Paintwork • Scratched	Repair
Rear Fender Left Paintwork • Chipmarks	Repair
Rear Fender Right Paintwork • Scratched	Repair
Door Front Left Paintwork • Scratched	Repair
Door Rear Left Paintwork • Scratched	Repair
Door Rear Right Dented	Repair
Boot Lid / Hatch door Paintwork • Scratched	Repair
Rear bumper Paintwork • Scratched	Repair
Engine to silencer pipe Welded	Repair
Traction control light on and brake pads light	Repair
Warning light illuminated	Repair

Brakes

Brake Test Results

No Brake Test on a brake test machine has been performed.

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	-	-	-	
Rear	-	-	-	
Emergency / Parking	-	-	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	235/60R18	107H	Lanvigator	Performance	V	1523	3 mm
Front Right	235/60R18	103V	Goodyear	Wrangler	V	0720	3 mm
Rear Left	255/60R18	112H	General	Grabber	V	3221	3 mm
Rear Right	255/60R18	112H	General	Grabber	V	3221	3 mm
Spare	T155/85R18	115M	Continental	Temporary	V	3717	4 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: SALCA2AN4JH731168



CONDITION REPORT



Report No:
2017306469
DATE
02/10/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	INTERMITTENT	B10A2-38	CRASH INPUT -SIGNAL FREQUENCY INCORRECT	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Andrick Wymers

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: SALCA2AN4JH731168



CONDITION REPORT



Report No:

2017306469

DATE

02/10/2026



FRONT RIGHT CORNER



REAR LEFT CORNER



90 DEGREE FRONT



90 DEGREE REAR



90 DEGREE RIGHT



90 DEGREE LEFT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: SALCA2AN4JH731168



CONDITION REPORT



Report No:
2017306469
DATE
02/10/2026



INTERIOR (FRONT DRIVER DOOR)



Automatic



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



LICENSE DISC



VIN PLATE OR STICKER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: SALCA2AN4JH731168



CONDITION REPORT



Report No:
2017306469
DATE
02/10/2026



ENGINE 1



ENGINE 2




CHASSIS



Expection bottle



Oil cap and dipstick

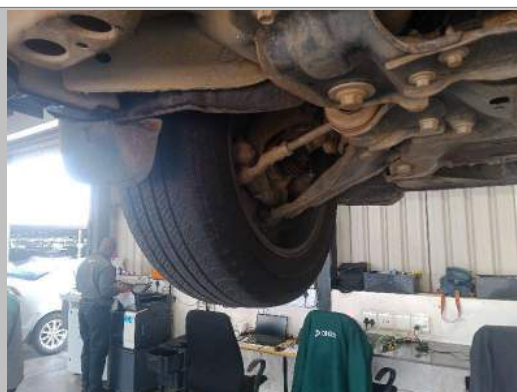

LF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: SALCA2AN4JH731168



CONDITION REPORT




Report No:


Report No.
2017306469

DATE _____


02/10/2026

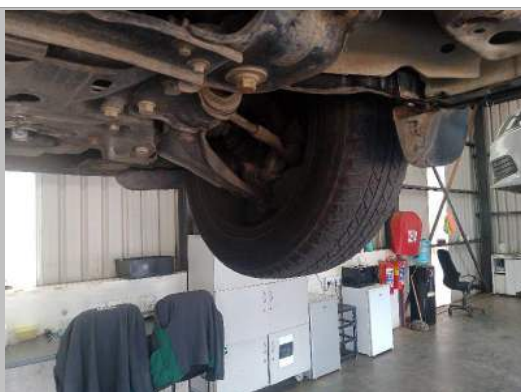

RF TYRE TREAD

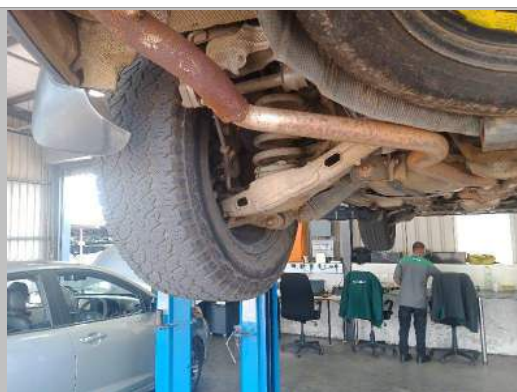

LR TYRE TREAD

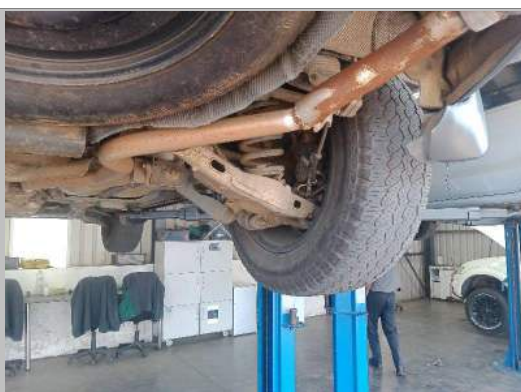

RR TYRE TREAD



Spare wheel

1st		2nd		3rd		4th		5th		6th		7th		8th		9th		10th		11th		12th		13th		14th		15th		16th		17th		18th		19th		20th		21st		22nd		23rd		24th		25th		26th		27th		28th		29th		30th		31st		32nd		33rd		34th		35th		36th		37th		38th		39th		40th		41st		42nd		43rd		44th		45th		46th		47th		48th		49th		50th		51st		52nd		53rd		54th		55th		56th		57th		58th		59th		60th		61st		62nd		63rd		64th		65th		66th		67th		68th		69th		70th		71st		72nd		73rd		74th		75th		76th		77th		78th		79th		80th		81st		82nd		83rd		84th		85th		86th		87th		88th		89th		90th		91st		92nd		93rd		94th		95th		96th		97th		98th		99th		100th	
1st	2nd	3rd	4th	5th	6th	7th	8th	9th	10th	11th	12th	13th	14th	15th	16th	17th	18th	19th	20th	21st	22nd	23rd	24th	25th	26th	27th	28th	29th	30th	31st	32nd	33rd	34th	35th	36th	37th	38th	39th	40th	41st	42nd	43rd	44th	45th	46th	47th	48th	49th	50th	51st	52nd	53rd	54th	55th	56th	57th	58th	59th	60th	61st	62nd	63rd	64th	65th	66th	67th	68th	69th	70th	71st	72nd	73rd	74th	75th	76th	77th	78th	79th	80th	81st	82nd	83rd	84th	85th	86th	87th	88th	89th	90th	91st	92nd	93rd	94th	95th	96th	97th	98th	99th	100th																																																																																																				

Shock report

[illegible]

Diagnostic Report page 1

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: SALCA2AN4JH731168




CONDITION REPORT




Report No:
2017306469
DATE
02/10/2026

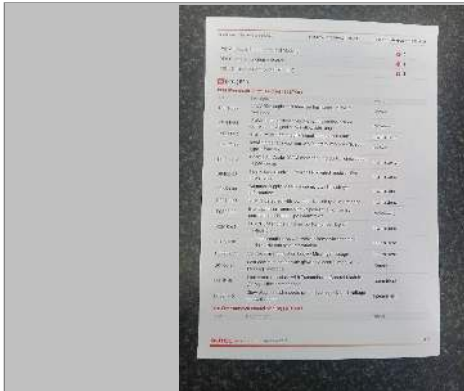

Diagnostic Report page 2

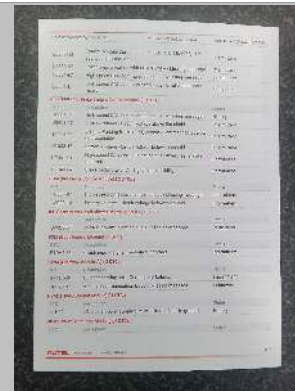

Diagnostic Report page 3

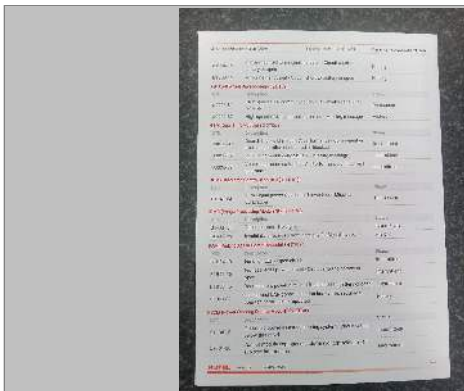

Diagnostic Report page 4



Diagnostic Report page 5



Radio/CD/USB



Water level

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: SALCA2AN4JH731168



CONDITION REPORT



Report No:

2017306469

DATE

02/10/2026



Side Mirror Left



Door Front Left



Front Fender Left



Front Fender Right



Rear Fender Right



Door Rear Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: SALCA2AN4JH731168



CONDITION REPORT



Report No:
2017306469
DATE
02/10/2026



Door Rear Right



Rear Fender Left




Boot Lid / Hatch door



Rear bumper



Rear bumper

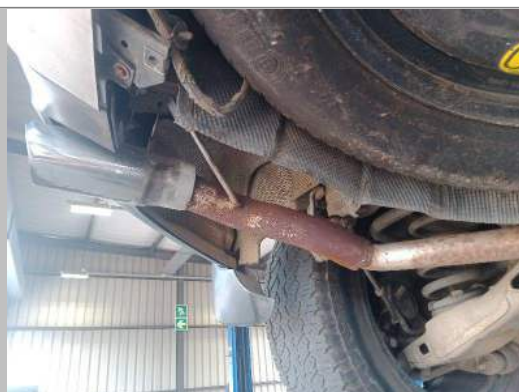

Engine to silencer pipe

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: SALCA2AN4JH731168



CONDITION REPORT



Report No:
2017306469
DATE
02/10/2026



Engine to silencer pipe

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: SALCA2AN4JH731168