



CONDITION REPORT



Report No:
2016924341
DATE
25/06/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	25/06/2025		M57 Pretoria Road - 1619
Inspection Date	25/06/2025		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	LAND ROVER	Registration Number	KLK665NW
Model	RANGE ROVER SPORT 3.0 DSL HSE 4X4 AT [2010-2011]	Register Number	
		Date Of First Licensing	
VIN	SALLSAAF3BA286467	Last COR	
Engine Number		License Expiry Date	31/07/2023
Doors	5	Power / Displacement	
Color	BLACK	Paint Finish	TWO COAT METALLIC
Year Model	2011	Fuel	DIESEL
Km Reading	205,864 KM	Transmission	AUTOMATIC
Cab / Body Type	STATION WAGON		

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: SALLSAAF3BA286467



CONDITION REPORT



Report No:
2016924341
DATE
25/06/2025

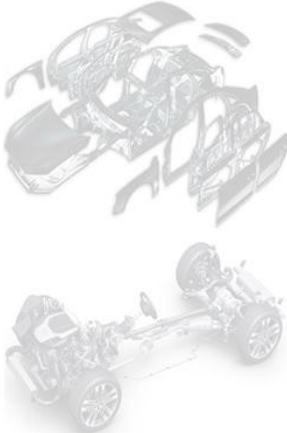	Damage	Repair Way
	Engine Oil Leak Under bonnet insulation cover Damaged Engine Management Lights Set Hood Lining Damaged Door Panel Front Left Damaged Front Bumper Damaged Bonnet Damaged Front Fender Left Damaged Front Fender Right Damaged Rear Fender Left Damaged Rear Fender Right Damaged Door Front Left Damaged Door Front Right Damaged Door Rear Left Damaged Door Rear Right Damaged Boot Lid / Hatch door Damaged Rear bumper Damaged Steering box Leak Gearbox Oil Leak Brakes Insufficient	Repair Repair Repair Repair Repair Repair Repair Repair Repair Repair Repair Repair Repair Repair Repair Repair Repair Repair Repair Repair

Brakes

Brake Test Results

No Brake Test on a brake test machine has been performed.

	Left	Right	Axle Weight [KG]	Deceleration [m/s²]
	Braking Force [KN]	Braking Force [KN]		
Front	-	-	-	
Rear	-	-	-	
Emergency / Parking	-	-	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	275/40R20	106V	Lanvigator	Radial	V	0120	2 mm
Front Right	275/40R20	106Y	Pirelli	Radial	V	1317	2 mm
Rear Left	275/40R20	106W	Zeta	Radial	V	0717	3 mm
Rear Right	275/40R20	106W	Pirelli	Radial	V	4721	2 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: SALLSAAF3BA286467



CONDITION REPORT



Report No:
2016924341
DATE
25/06/2025

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	PCM	U0416-68	INVALID DATA SENT FROM VEHICLE DYNAMICS CONTROL MODULE.	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. 276 DTC'S AT TIME OF TESTING SEE DTC REPORT. VEHICLE ELECTRONICS MALFUNCTIONING. VEHICLE STRUGGLES TO START. Body • Exterior: Minor dents and scratches and stone chips to some body panels. Signs of repair work done to some body panels. Poor alignment to some body panels. hatch door glass does not close properly.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: SALLSAAF3BA286467



CONDITION REPORT



Report No:
2016924341
DATE
25/06/2025

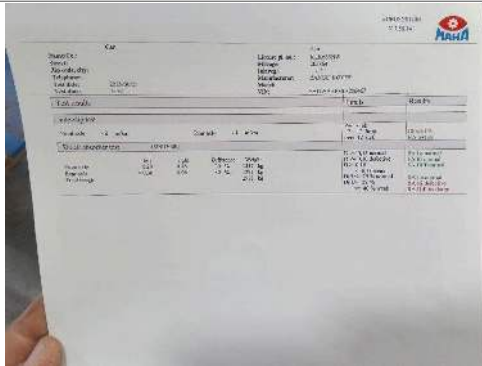

Brake test.



Diagnostic.



Diagnostic.



Diagnostic.



Diagnostic.



Diagnostic.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: SALLSAAF3BA286467



CONDITION REPORT




Report No:
2016924341
DATE
25/06/2025



Diagnostic.




Diagnostic.

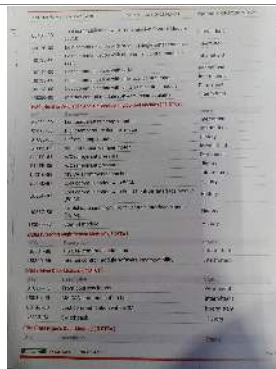

Diagnostic.



Diagnostic.

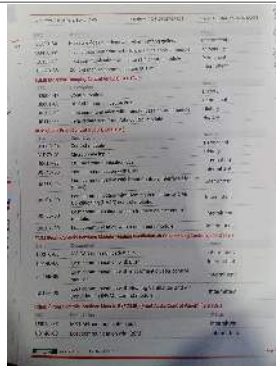

Diagnostic.



Diagnostic.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: SALLSAAF3BA286467



CONDITION REPORT



Report No:
2016924341
DATE
25/06/2025



Diagnostic.



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: SALLSAAF3BA286467



CONDITION REPORT



Report No:
2016924341
DATE
25/06/2025



Automatic.



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: SALLSAAF3BA286467



CONDITION REPORT



Report No:
2016924341
DATE
25/06/2025



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: SALLSAAF3BA286467



CONDITION REPORT



Report No:
2016924341
DATE
25/06/2025

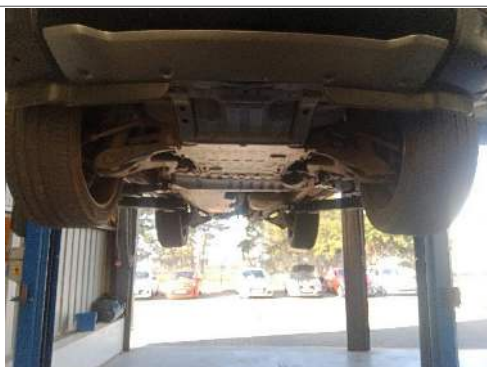

Undercarriage front.



Undercarriage rear.



Oil cap.



Water level



Under bonnet insulation cover



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: SALLSAAF3BA286467



CONDITION REPORT



Report No:
2016924341
DATE
25/06/2025




Front Bumper



Bonnet




Front Fender Left

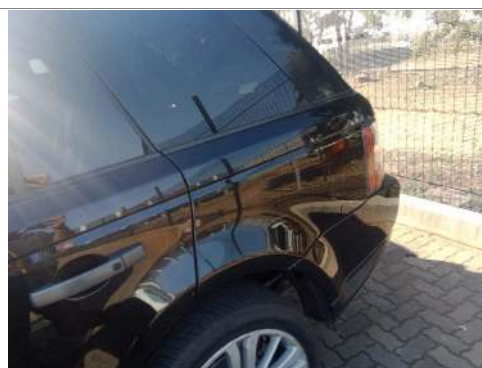

Rear Fender Left



Door Front Left

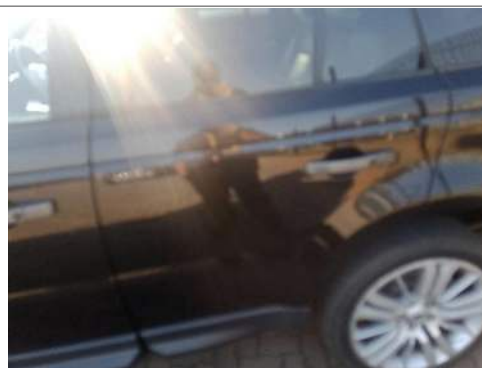

Door Rear Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: SALLSAAF3BA286467



CONDITION REPORT



Report No:
2016924341
DATE
25/06/2025



Rear bumper



Rear bumper



Door Rear Right



Door Front Right



Front Fender Right



Rear Fender Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: SALLSAAF3BA286467



CONDITION REPORT



Report No:
2016924341
DATE
25/06/2025



Boot Lid / Hatch door



Engine Management Lights



Door Panel Front Left



Hood Lining



Gearbox



Engine

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: SALLSAAF3BA286467

**CONDITION REPORT**

Report No:
2016924341
DATE
25/06/2025



Steering box

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: SALLSAAF3BA286467