



CONDITION REPORT



Report No:
2016921182
DATE
23/06/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	23/06/2025		M57 Pretoria Road - 1619
Inspection Date	23/06/2025		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	LAND ROVER	Registration Number	HS85XSGP
Model	RANGE ROVER EVOQUE COUPE 2.0 SI4 DYNAMIC 4WD AT [2012-2015]	Register Number	
VIN	SALVA1AG5DH811846	Date Of First Licensing	
Engine Number		Last COR	
Doors	3	License Expiry Date	
Color	WHITE	Power / Displacement	
Year Model	2013	Paint Finish	C - COMMON
Km Reading	236,327 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: SALVA1AG5DH811846



CONDITION REPORT



Report No:
2016921182
DATE
23/06/2025

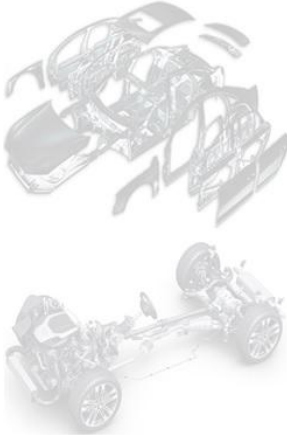	Damage	Repair Way
	Engine Oil Leak Seat Front Right Torn / Cut Door Handle Front Right Malfunction Front Bumper Paintwork • Discoloured Bonnet Paintwork • Scratched Front Fender Right Paintwork • Scratched Rear Fender Left Paintwork • Scratched Rear Fender Right Dented Door Front Left Paintwork • Scratched Door Front Right Dented Rear bumper Paintwork • Scratched Windscreen Damaged Stabilizer Mounting Front Left Defective Gearbox Oil Leak Brakes No license disc	Repair Repair Repair Repair Repair Repair Repair Repair Repair Repair Repair Replace Repair Repair No brake test done vehicle is 4wd Replace

Brakes
Brake Test Results

No Brake Test on a brake test machine has been performed.

	Left	Right	Axle Weight [KG]	Deceleration [m/s²]
	Braking Force [KN]	Braking Force [KN]		
Front	-	-	-	
Rear	-	-	-	
Emergency / Parking	-	-	-	

Tyres and Rims
Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	245/45R20	103Y	Anchee	Ac818	V	2024	4 mm
Front Right	245/45R20	103Y	Anchee	Ac818	V	4023	4 mm
Rear Left	245/45R20	103Y	Anchee	Ac818	V	4023	4 mm
Rear Right	245/45R20	103Y	Anchee	Ac818	V	4023	4 mm
Spare	T155/85R18	115M	Continental	Temporary	V	2218	3 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: SALVA1AG5DH811846



CONDITION REPORT



Report No:
2016921182
DATE
23/06/2025

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	INTERMITTENT	B1A69-09	HUMIDITY SENSOR CIRCUIT	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Andrick Wymers

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: SALVA1AG5DH811846



CONDITION REPORT



Report No:
2016921182
DATE
23/06/2025

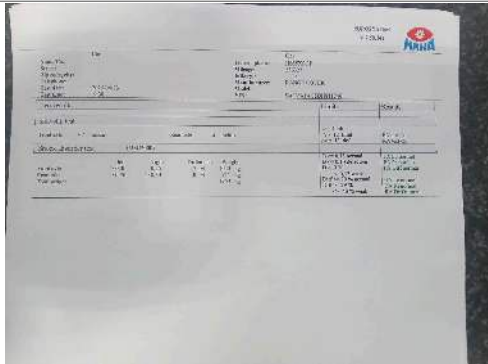


Shock report



Diagnostic report



Diagnostic report

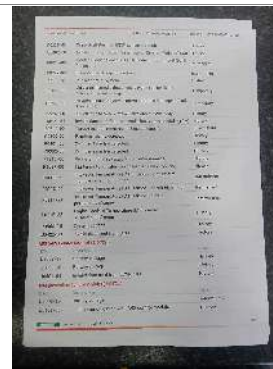

Diagnostic report



Diagnostic report



Diagnostic report

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: SALVA1AG5DH811846



CONDITION REPORT



Report No:
2016921182
DATE
23/06/2025



Diagnostic report



Diagnostic report



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: SALVA1AG5DH811846



CONDITION REPORT



Report No:
2016921182
DATE
23/06/2025



ODOMETER



Automatic



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: SALVA1AG5DH811846



CONDITION REPORT



Report No:
2016921182
DATE
23/06/2025



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Spare wheel



No license disc

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: SALVA1AG5DH811846



CONDITION REPORT



Report No:
2016921182
DATE
23/06/2025



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS



Oil cap and dipstick



Expenditure bottle

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: SALVA1AG5DH811846



CONDITION REPORT



Report No:
2016921182
DATE
23/06/2025



Water level



Windscreen



Bonnet



Rear bumper



Rear bumper



Seat Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: SALVA1AG5DH811846



CONDITION REPORT



Report No:
2016921182
DATE
23/06/2025



Rear Fender Right



Door Front Right



Front Fender Right



Front Bumper



Front Bumper



Door Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: SALVA1AG5DH811846



CONDITION REPORT



Report No:
2016921182
DATE
23/06/2025



Rear Fender Left



Engine



Gearbox



Stabilizer Mounting Front Left



Door Handle Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: SALVA1AG5DH811846