



CONDITION REPORT

Report No: 2016891329

DATE
27/05/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	27/05/2025		M57 Pretoria Road - 1619
Inspection Date	27/05/2025		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	
Manufacturer	NISSAN	Registration Number	HPZ659FS
Model	QASHQAI 1.6 VISIA 5-DR [2010-2015]	Register Number	
VIN	SJNFAAJ10Z2778907	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	30/06/2025
Color	WHITE	Power / Displacement	
Year Model	2013	Paint Finish	TWO COAT UNI
Km Reading	291,752 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Engine Oil Leak	Repair
Seat Front Right Damaged	Repair
Seat Belt Front Right Damaged	Repair
Side Mirror Left Damaged	Replace
Front Bumper Damaged	Repair
Bonnet Damaged	Repair
Front Fender Left Damaged	Repair
Front Fender Right Damaged	Repair
Rear Fender Left Damaged	Repair
Rear Fender Right Damaged	Repair
Door Front Left Damaged	Repair
Door Front Right Damaged	Repair
Door Rear Left Damaged	Repair
Door Rear Right Damaged	Repair
Boot Lid / Hatch door Damaged	Repair
Rear bumper Damaged	Repair
Sealing Window Rear Door Right Damaged	Replace
Parking Brake Performance Left / Right Difference out of legal range	Repair
Tyre Front Left Worn	Replace

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: SJNFAAJ10Z2778907



CONDITION REPORT

Report No: 2016891329

DATE
27/05/2025

Damage	Repair Way
Tyre Front Right Worn	Replace
Tyre Rear Right Worn	Replace
Gearbox Oil Leak	Repair
CV Joint(s) Boot(s) Rear Right (inner/outer) Damaged	Replace
Airbag warning light illuminated	Repair

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s²]
Front	3.81	3.45	-	
Rear	2.49	2.61	-	
Emergency / Parking	0.32	2.4	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	215/65R16	98H	Bridgestone	Radial	V	0613	0 mm
Front Right	215/65R16	98H	Uniroyal	Radial	V	1419	0 mm
Rear Left	205/65R16	95H	Kumho	Radial	V	1720	1 mm
Rear Right	205/65R16	95H	Kumho	Radial	V	1720	0 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Minor dents and scratches and stone chips to some body panels. Signs of repair work done to somebody panels. Poor alignment to somebody panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: SJNFAAJ10Z2778907

**CONDITION REPORT****Report No: 2016891329****DATE**
27/05/2025

strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: SJNFAAJ10Z2778907



CONDITION REPORT

Report No: 2016891329

DATE
27/05/2025

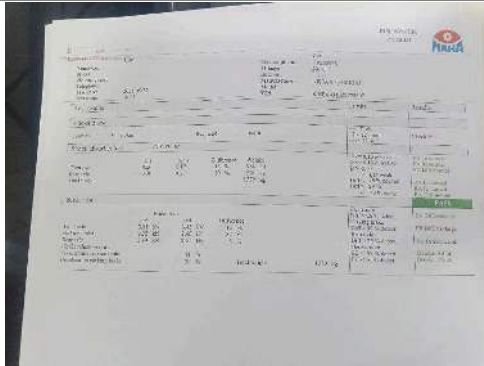

Brake test.



Diagnostic.



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: SJNFAAJ10Z2778907



CONDITION REPORT

Report No: 2016891329

DATE
27/05/2025

ODOMETER



Manual.



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: SJNFAAJ10Z2778907



CONDITION REPORT

Report No: 2016891329

DATE
27/05/2025



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC



VIN PLATE OR STICKER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: SJNFAAJ10Z2778907



CONDITION REPORT


Report No: 2016891329

DATE
27/05/2025

ENGINE 1



Undercarriage front.

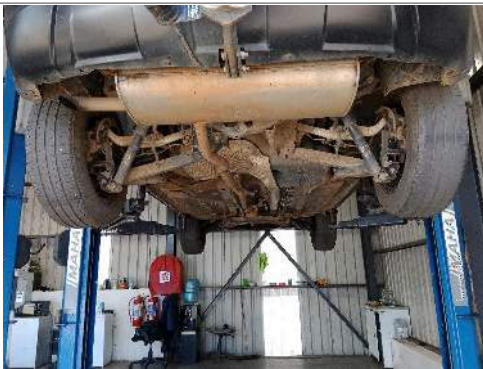

Undercarriage rear.



Oil cap and dipstick.



Water level



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: SJNFAAJ10Z2778907



CONDITION REPORT

Report No: 2016891329

DATE
27/05/2025

Front Bumper



Bonnet



Front Fender Left



Rear Fender Left



Door Front Left



Door Rear Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: SJNFAAJ10Z2778907



CONDITION REPORT


Report No: 2016891329

DATE
27/05/2025

Boot Lid / Hatch door



Rear bumper

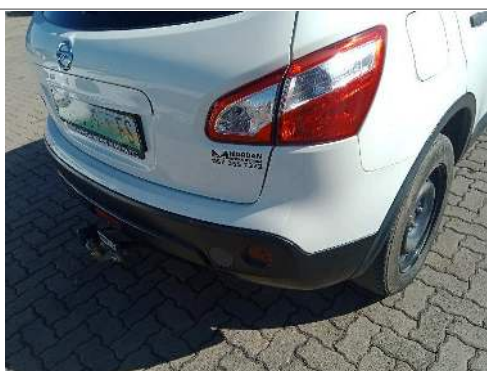

Rear bumper



Front Fender Right



Rear Fender Right



Door Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: SJNFAAJ10Z2778907



CONDITION REPORT

Report No: 2016891329

DATE
27/05/2025

Door Rear Right



Sealing Window Rear Door Right



Side Mirror Left



Side Mirror Left



Seat Front Right



Seat Belt Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: SJNFAAJ10Z2778907



CONDITION REPORT

Report No: 2016891329

DATE
27/05/2025

Tyre Rear Right



Tyre Front Left



Tyre Front Right



Engine



Gearbox



CV Joint(s) Boot(s) Rear Right (inner/outer)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: SJNFAAJ10Z2778907