



CONDITION REPORT

Report No: 2016273841

DATE  
19/02/2024

MFC Auction House  
M57 Pretoria Rd, Glenmarais, KEMPTON PARK  
Gauteng

DEKRA MFC  
M57 Pretoria Rd - 1619  
KEMPTON PARK - GT  
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	19/02/2024		M57 Pretoria Road - 1619
Inspection Date	19/02/2024		Kempton Park - GT

Vehicle Data


Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	NISSAN	Registration Number	CG28XWGP
Model	JUKE	Register Number	
VIN	SJNFBAF15Z6287434	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/12/2022
Color	WHITE	Power / Displacement	
Year Model		Paint Finish	C - COMMON
Km Reading	151,501 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Under bonnet insulation cover Damaged	Replace
Indicator Light Front Right Malfunction	Repair
Seat Front Right Torn / Cut	Repair
Side Mirror Right Paintwork • Scratched	Repair
Front Bumper Paintwork • Scratched	Repair
Bonnet Paintwork • Chipmarks	Repair
Front Fender Left Dented	Repair
Front Fender Right Paintwork • Scratched	Repair
Door Front Left Dented	Repair
Door Front Right Damaged	Repair
Door Rear Left Dented	Repair
Windscreen Cracked	Replace
Tie Rod End right Defective	Replace
Body exterior	Vehicle got minor scratches, stone chips and dents
Ignition barrel defective	Repair

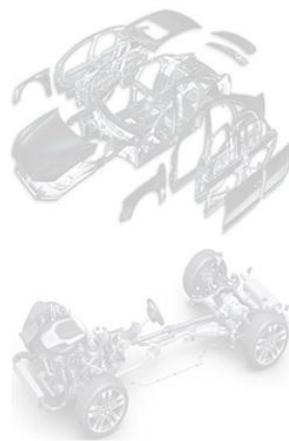

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: SJNFBAF15Z6287434

1 / 9



## CONDITION REPORT

Report No: 2016273841

DATE  
19/02/2024

### Brakes

#### Brake Test Results

	Left	Right	Axle Weight [KG]	Deceleration [m/s <sup>2</sup> ]
	Braking Force [KN]	Braking Force [KN]		
Front	2.4	3.1	-	
Rear	1.8	1.8	-	
Emergency / Parking	1.1	1.3	-	

### Tyres and Rims

#### Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	205/60R16	92V	Hankook	Kinergy	V	4216	2 mm
Front Right	215/65R15	96H	Michelin	Primacy	V	1606	3 mm
Rear Left	205/60R16	92H	Bridgestone	Turanza	V	2712	3 mm
Rear Right	215/60R16	95V	Kumho	Solus	V	0911	2 mm

\* Tyre Legend: V=Virgin, R=Recap

### Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

### Inspection Conditions

No Test Drive  
 Battery Flat  
 Engine number – not possible to verify engine number (not visible without dismantling)  
 Inspection conditions for the vehicle inspection were sufficient

### Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

### Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

### Technician

Andrick Wymers


This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.




CONDITION REPORT


Report No: 204629384  
2 / 9  
DATE  
19/02/2024

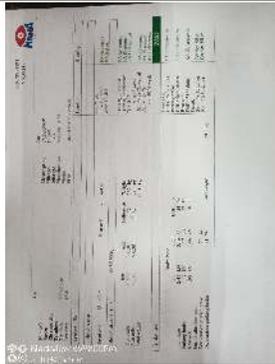

Shock and brake report

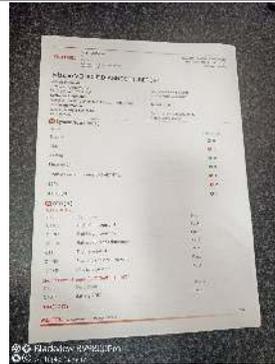

Diagnostic report

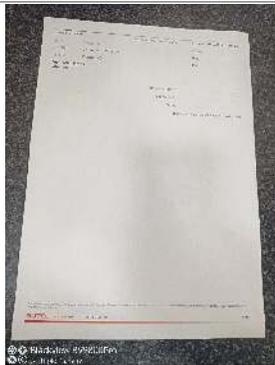

Diagnostic report



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



**CONDITION REPORT**

**Report No: 2016273841**  
VIN: SJNFBAF15Z6287434  
DATE  
3/19  
**19/02/2024**

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016273841

DATE 15/02/2024  
VIN: SJNFBAF1570292624  
4/9



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



**CONDITION REPORT**

**Report No: 2016273841**

**DATE**  
**19/02/2024**

VIN: SJNFBAF15Z6287434

5 / 9

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016273841

DATE  
19/02/2024

VIN: SJNFBAF15Z6287434

6 / 9



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



No spare wheel



LICENSE DISC

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



**CONDITION REPORT**

**Report No: 2016273841**

**DATE**  
**19/02/2024**

VIN: SJNFBAF15Z6287434

7 / 9

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016273841

DATE  
19/02/2024



VIN PLATE OR STICKER



ENGINE 1

15Z6287434  
8 / 9



ENGINE 2



CHASSIS



Ignition barrel defective



Coolant bottle

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



**CONDITION REPORT**

**Report No: 2016273841**

**DATE**  
**19/02/2024**

VIN: SJNFBAF15Z6287434

9 / 9

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016273841

DATE  
19/02/2024



Oil cap and dipstick



Manual




Water level



Under bonnet insulation cover



Windscreen

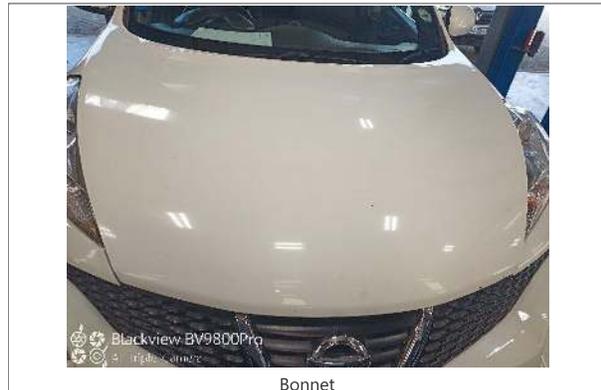

Bonnet

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



**CONDITION REPORT**

Report No: 2016273841

DATE  
19/02/2024

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016273841


DATE  
19/02/2024



Seat Front Right




Door Front Right

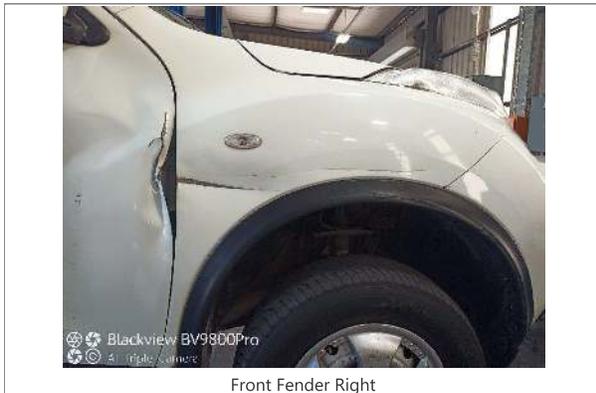


Front Fender Right



Side Mirror Right

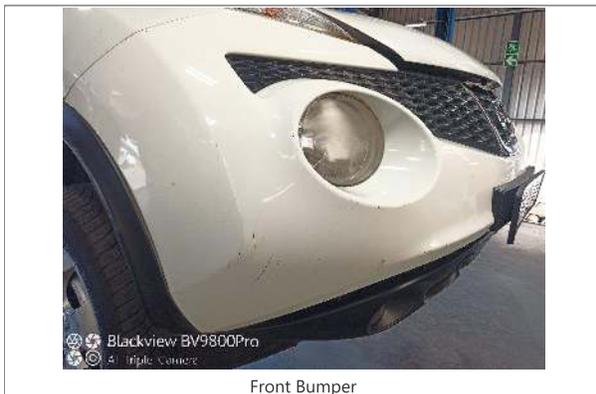

Front Bumper

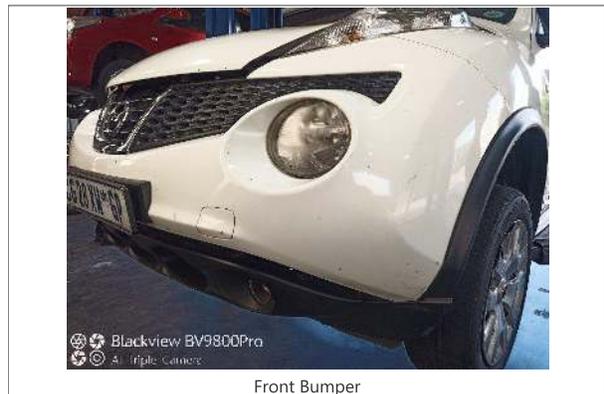

Front Bumper

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016273841

DATE  
19/02/2024



DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016273841

DATE  
19/02/2024

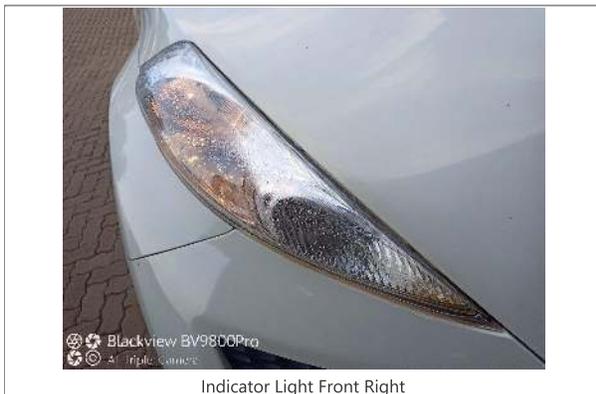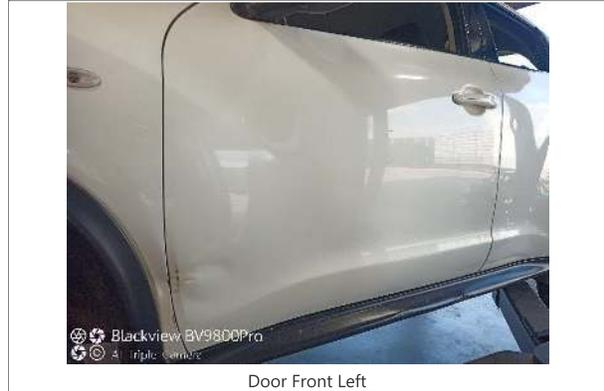

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



**CONDITION REPORT**

**Report No: 2016273841**

**DATE**  
**19/02/2024**

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za