



CONDITION REPORT



Report No:
2016960627
DATE
28/07/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	28/07/2025		M57 Pretoria Road - 1619
Inspection Date	28/07/2025		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	NISSAN	Registration Number	KGK429NW
Model	QASHQAI 1.2 T VISIA + ALLOYS 5-DR [2018-2020]	Register Number	
		Date Of First Licensing	
VIN	SJNFEAJ11Z2676195	Last COR	
Engine Number		License Expiry Date	30/11/2025
Doors	5	Power / Displacement	
Color	WHITE	Paint Finish	C - COMMON
Year Model	2019	Fuel	PETROL
Km Reading	132,294 KM	Transmission	MANUAL
Cab / Body Type	STATION WAGON		

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: SJNFEAJ11Z2676195




CONDITION REPORT



Report No:
2016960627
DATE
28/07/2025

Damage	Repair Way
Parcel Tray Missing	Replace
Front Fender Right Paintwork • Scratched	Repair
Boot Lid / Hatch door Dented	Repair
Rear bumper Paintwork • Scratched	Repair
Rim Rear Left Dented	Repair

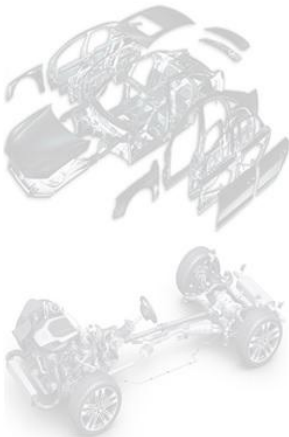

Brakes
Brake Test Results

	Left	Right	Axle Weight [KG]	Deceleration [m/s ²]
	Braking Force [KN]	Braking Force [KN]		
Front	3.2	2.6	-	
Rear	2.1	2.2	-	
Emergency / Parking	1.7	1.5	-	

Tyres and Rims
Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	215/60R17	96H	Boto	Vantage	V	2923	1 mm
Front Right	215/60R17	96H	Boto	Vantage	V	2923	2 mm
Rear Left	215/60R17	96H	Boto	Vantage	V	2923	2 mm
Rear Right	215/60R17	96H	Boto	Vantage	V	2923	3 mm
Spare	215/65R16	88H	Roadking	Argos	V	0000	5 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: SJNFEAJ11Z2676195



CONDITION REPORT



Report No:
2016960627
DATE
28/07/2025

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ENGINE	P0090:77	FUEL PRESSURE REGULATOR 1	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Engine Compartment: Bottom of engine is fully covered.
Body • Exterior: Signs of spray work done on some body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: SJNFEAJ11Z2676195



CONDITION REPORT



Report No:
2016960627
DATE
28/07/2025

[illegible]

Shock and brake report

[illegible]

Diagnostic test

[illegible]

Diagnostic test



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: SJNFEAJ11Z2676195



CONDITION REPORT



Report No:
2016960627
DATE
28/07/2025



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: SJNFEAJ11Z2676195



CONDITION REPORT




Report No:
2016960627
DATE
28/07/2025




90 DEGREE LEFT



LF TYRE TREAD

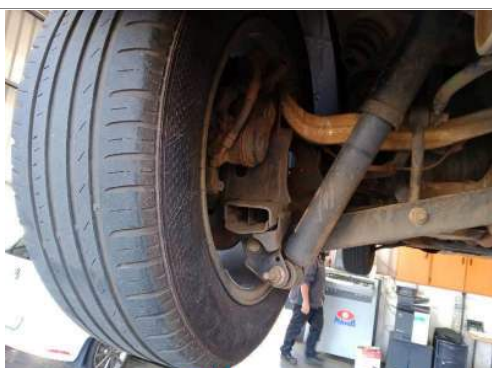

LR TYRE TREAD

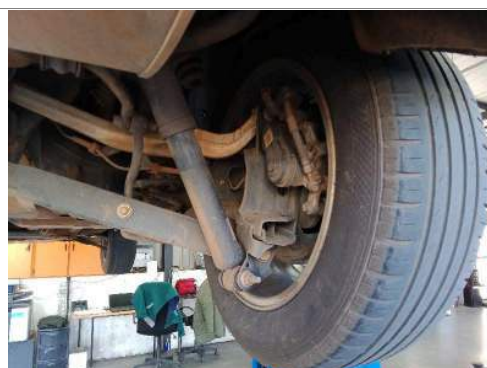

RR TYRE TREAD



RF TYRE TREAD



Sparewheel

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: SJNFEAJ11Z2676195



CONDITION REPORT



Report No:
2016960627
DATE
28/07/2025



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS



Rear end

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: SJNFEAJ11Z2676195



CONDITION REPORT



Report No:
2016960627
DATE
28/07/2025




Oil cap and dipstick



Expansion bottle



Front Fender Right

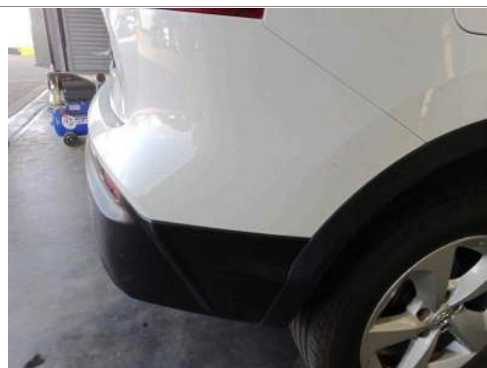

Rear bumper



Rear bumper



Rear bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: SJNFEAJ11Z2676195



CONDITION REPORT



Report No:
2016960627
DATE
28/07/2025



Rear bumper



Boot Lid / Hatch door



Parcel Tray



Water level



Rim Rear Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: SJNFEAJ11Z2676195