



CONDITION REPORT

Report No: 2016853349

DATE
24/04/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	24/04/2025		M57 Pretoria Road - 1619
Inspection Date	24/04/2025		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	
Manufacturer	KIA	Registration Number	HG85SNGP
Model	SPORTAGE	Register Number	
VIN	U5YPH81AMHL396526	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	30/11/2024
Color	GREY	Power / Displacement	
Year Model		Paint Finish	M - METALLIC
Km Reading	140,492 KM	Fuel	PETROL
Cab / Body Type	STATION WAGON	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Parcel Tray Missing	Replace
Front Bumper Damaged	Repair
Front Fender Right Paintwork • Scratched	Repair
Rear Fender Left Paintwork • Scratched	Repair
Rear Fender Right Paintwork • Scratched	Repair
Door Front Right Dented	Repair
Door Rear Right Paintwork • Scratched	Repair
Boot Lid / Hatch door Paintwork • Scratched	Repair
Rear bumper Paintwork • Scratched	Repair
Windscreen Cracked	Replace
Belly plates Damaged	Replace
Body exterior	Vehicle got minor scratches, stone chips and dents
L/F fender liner damage	Replace
Warning light on	Repair
Parking brake button malfunction	Repair

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: U5YPH81AMHL396526



CONDITION REPORT

Report No: 2016853349

 DATE
24/04/2025

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.6	3.8	-	
Rear	1.6	2.0	-	
Emergency / Parking	0.6	0.7	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	235/55R19	101H	Kumho	Venture	V	2013	4 mm
Front Right	245/45R19	102Y	Continental	Contact	V	1019	3 mm
Rear Left	225/60R17	99H	Kumho	Solus	V	4912	2 mm
Rear Right	245/45R19	102Y	Continental	Contact	V	1222	3 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	HISTORY	B1102:00	BATTERY VOLTAGE LOW	

Inspection Conditions

No Test Drive
 Rain at time of inspection
 Battery Flat
 Engine number – not possible to verify engine number (not visible without dismantling)
 Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Andrick Wymers

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.


DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
 www.dekraauto.co.za

VIN: U5YPH81AMHL396526



CONDITION REPORT

Report No: 2016853349

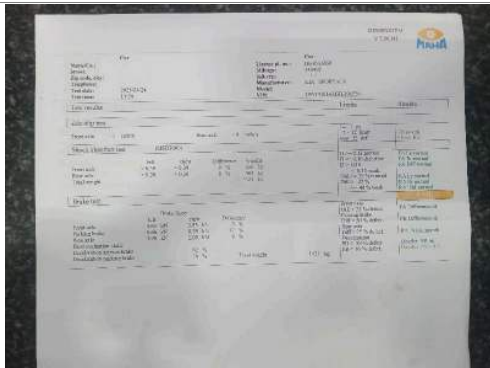DATE
24/04/2025

Shock and brake report



Diagnostic report



Diagnostic report



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: U5YPH81AMHL396526



CONDITION REPORT

Report No: 2016853349

DATE
24/04/2025

DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Automatic



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: U5YPH81AMHL396526



CONDITION REPORT


Report No: 2016853349

DATE
24/04/2025


90 DEGREE LEFT




LF TYRE TREAD

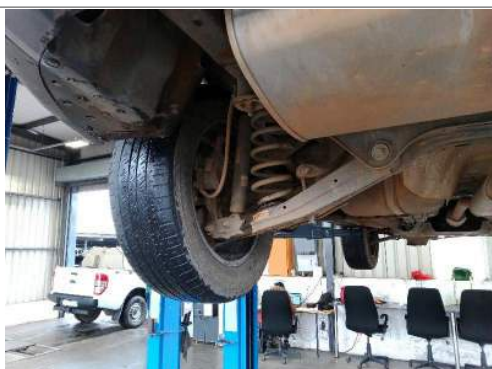

LR TYRE TREAD

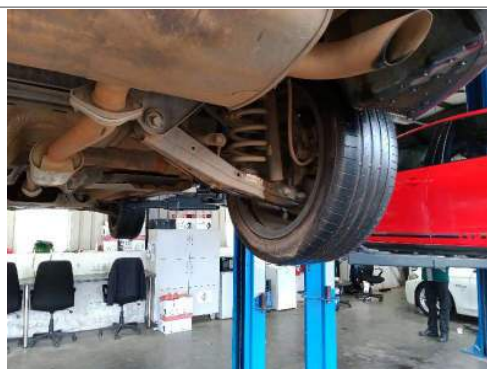

RR TYRE TREAD

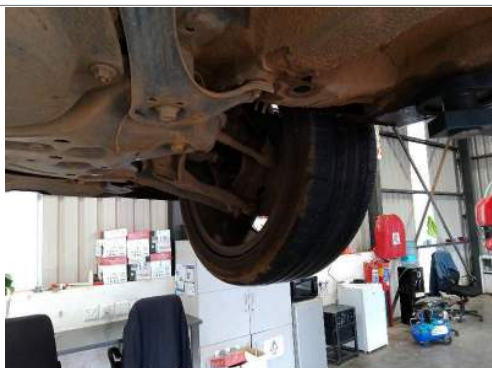

RF TYRE TREAD



No spare wheel

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: U5YPH81AMHL396526




CONDITION REPORT

Report No: 2016853349

DATE
24/04/2025



LICENSE DISC

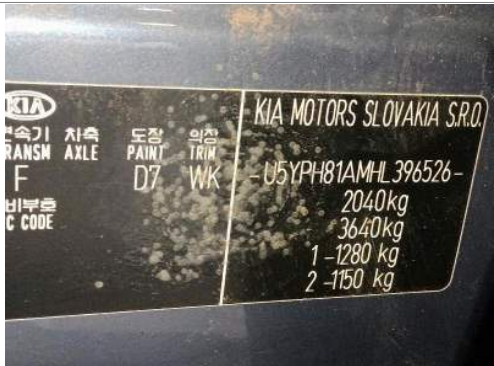

VIN PLATE OR STICKER




ENGINE 1



ENGINE 2



CHASSIS

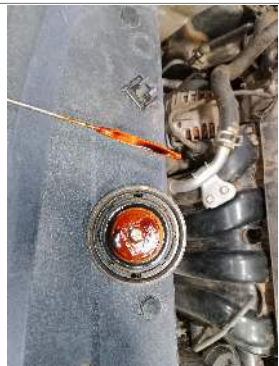

Oil cap and dipstick

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: U5YPH81AMHL396526



CONDITION REPORT


Report No: 2016853349

DATE
24/04/2025

Expection bottle



Water level

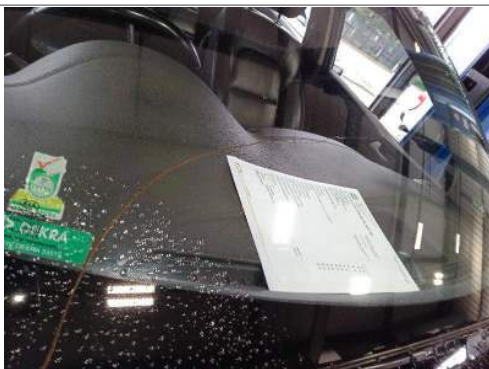

Windscreen



Parcel Tray



Boot Lid / Hatch door



Rear bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: U5YPH81AMHL396526



CONDITION REPORT

Report No: 2016853349

DATE
24/04/2025

Rear bumper



Rear Fender Right



Rear Fender Left



Door Rear Right



Door Front Right



Front Fender Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: U5YPH81AMHL396526



CONDITION REPORT

Report No: 2016853349

DATE
24/04/2025

Front Bumper



Belly plates

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: U5YPH81AMHL396526