




CONDITION REPORT



Report No:
2017303172
DATE
25/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572

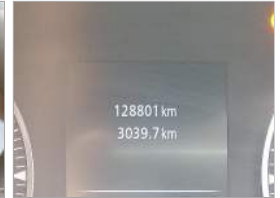

Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	25/09/2026		M57 Pretoria Road - 1619
Inspection Date	25/09/2026		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	RENAULT	Registration Number	KPJ679NW
Model	DUSTER	Register Number	
VIN	VF1HJD20X68210389	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	28/02/2027
Color	SILVER	Power / Displacement	
Year Model		Paint Finish	TWO COAT METALLIC
Km Reading	128,801 KM	Fuel	PETROL
Cab / Body Type	SUV	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VF1HJD20X68210389



CONDITION REPORT



Report No:

2017303172

DATE

25/09/2026

Damage

Repair Way

Front Bumper Damaged	Repair
Bonnet Damaged	Repair
Front Fender Right Damaged	Repair
Rear Fender Right Damaged	Repair
Door Front Left Damaged	Repair
Door Front Right Damaged	Repair
Door Rear Left Damaged	Repair
Door Rear Right Damaged	Repair
Rear bumper Damaged	Repair
Windscreen Damaged	Replace
Tyre Front Left Worn	Replace
Tyre Front Right Worn	Replace
Tyre Rear Right Worn	Replace



Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.74	3.09	-	
Rear	2.39	2.67	-	
Emergency / Parking	1.58	1.63	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	215/60R16	95V	Dunlop	Sp	V	3818	0 mm
Front Right	215/60R16	95V	Dunlop	Sp	V	3818	0 mm
Rear Left	215/65R16	98H	Continental	Crosscontact	V	3421	2 mm
Rear Right	215/65R16	98H	Fronway	Radial	V	4824	0 mm
Spare	215/65R16	98H	Fronway	Radial	V	4723	1 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: VF1HJD20X68210389



CONDITION REPORT



Report No:
2017303172
DATE
25/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	INJ	DTC0226F1	DRAKE ACCELERATOR PEDAL POSITIONS SAFETY MODE FLAG	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. 16 DTC'S AT TIME OF TESTING SEE DTC REPORT. Body • Exterior: Minor dents and scratches and stone chips to body panels. Signs of repair work done to body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VF1HJD20X68210389



CONDITION REPORT




Report No:


2017303172

DATE


25/09/2026

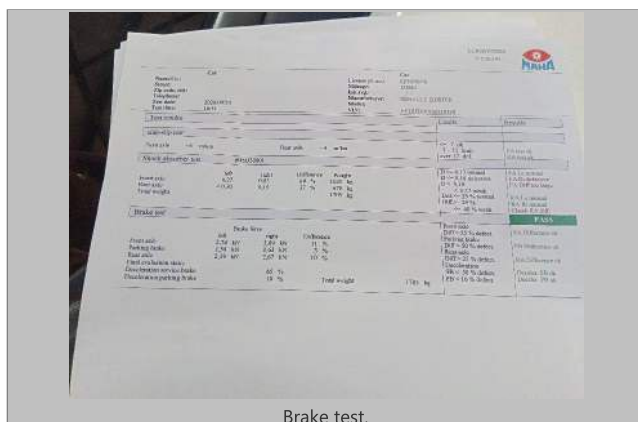

Brake test.

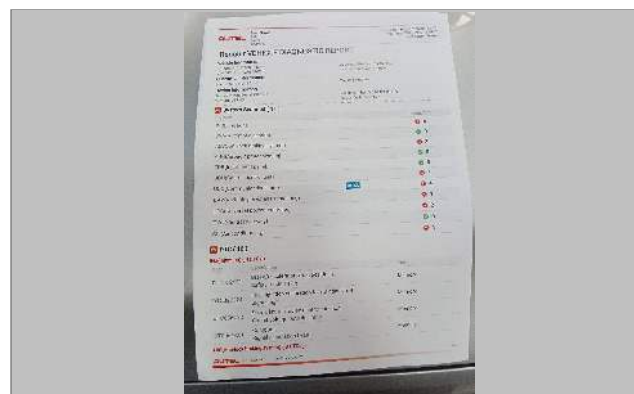

Diagnostic.

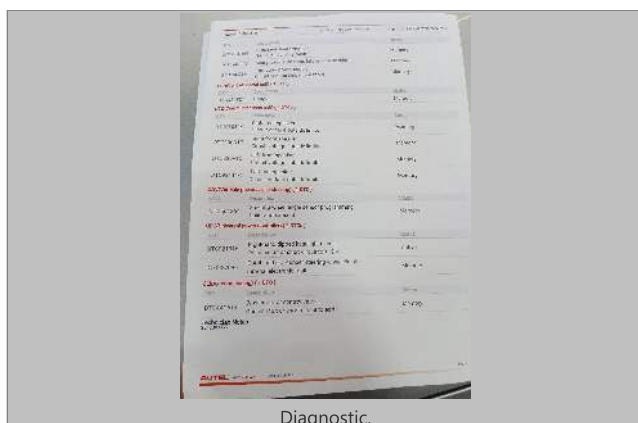

Diagnostic.



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VF1HJD20X68210389



CONDITION REPORT



Report No:

2017303172

DATE

25/09/2026



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Automatic.



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VF1HJD20X68210389



CONDITION REPORT



Report No:

2017303172

DATE

25/09/2026



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VF1HJD20X68210389



CONDITION REPORT



Report No:
2017303172
DATE
25/09/2026



VIN PLATE OR STICKER



ENGINE 1



Undercarriage front.



Undercarriage rear.



Oil cap and dipstick.



Oil cap and dipstick.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VF1HJD20X68210389



CONDITION REPORT



Report No:
2017303172
DATE
25/09/2026



Water level



Front Bumper



Front Bumper



Bonnet



Door Rear Left



Door Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VF1HJD20X68210389



CONDITION REPORT



Report No:

2017303172

DATE

25/09/2026



Rear bumper



Rear bumper



Rear Fender Right



Front Fender Right



Door Front Right



Door Rear Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VF1HJD20X68210389



CONDITION REPORT



Report No:
2017303172
DATE
25/09/2026



Windscreen



Tyre Front Left



Tyre Front Right



Tyre Rear Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VF1HJD20X68210389