



CONDITION REPORT



Report No:
2017302004
DATE
22/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	22/09/2026		M57 Pretoria Road - 1619
Inspection Date	22/09/2026		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	RENAULT	Registration Number	HL89RKGP
Model	DUSTER	Register Number	
VIN	VF1HSRCFN59319908	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	
Color	SILVER	Power / Displacement	
Year Model		Paint Finish	M - METALLIC
Km Reading	138,329 KM	Fuel	DIESEL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: VF1HSRCFN59319908



CONDITION REPORT



Report No:
2017302004
DATE
22/09/2026

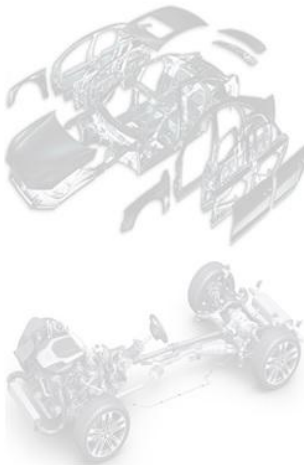

Damage	Repair Way
Front Bumper Paintwork • Scratched	Repair
Bonnet Paintwork • Chipmarks	Repair
Front Fender Left Dented	Repair
Front Fender Right Paintwork • Scratched	Repair
Rear Fender Left Paintwork • Scratched	Repair
Rear Fender Right Defective	Repair
Door Front Left Paintwork • Scratched	Repair
Door Front Right Paintwork • Scratched	Repair
Door Rear Left Dented	Repair
Door Rear Right Paintwork • Scratched	Repair
Boot Lid / Hatch door Dented	Repair
Rear bumper Paintwork • Scratched	Repair

Brakes

Brake Test Results

No Brake Test on a brake test machine has been performed.

	Left	Right	Axle Weight [KG]	Deceleration [m/s ²]
	Braking Force [KN]	Braking Force [KN]		
Front	-	-	-	
Rear	-	-	-	
Emergency / Parking	-	-	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	215/65R16	103/100S	Bf Goodrich	All-Terrain	V	2920	1 mm
Front Right	215/65R16	103/100S	Bf Goodrich	All-Terrain	V	3219	1 mm
Rear Left	215/65R16	103/100S	Bf Goodrich	All-Terrain	V	5219	2 mm
Rear Right	215/65R16	103/100S	Bf Goodrich	All-Terrain	V	3219	2 mm
Spare	215/65R16	98H	Continental	Contact	V	////	5 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VF1HSRCFN59319908



CONDITION REPORT



Report No:

2017302004

DATE

22/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	MEMORY	DTCF00316	BATTERY VOLTAGE 12V FEED VOLTAGE TOO LOW	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Andrick Wymers

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VF1HSRCFN59319908



CONDITION REPORT



Report No:
2017302004
DATE
22/09/2026



FRONT RIGHT CORNER



REAR LEFT CORNER



90 DEGREE RIGHT



90 DEGREE LEFT



90 DEGREE FRONT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VF1HSRCFN59319908



CONDITION REPORT



Report No:
2017302004
DATE
22/09/2026



ODOMETER



DASHBOARD (W/ ENGINE RUNNING)



INTERIOR (FRONT DRIVER DOOR)



Manual



LF TYRE TREAD



LR TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: VF1HSRCFN59319908



CONDITION REPORT



Report No:
2017302004
DATE
22/09/2026

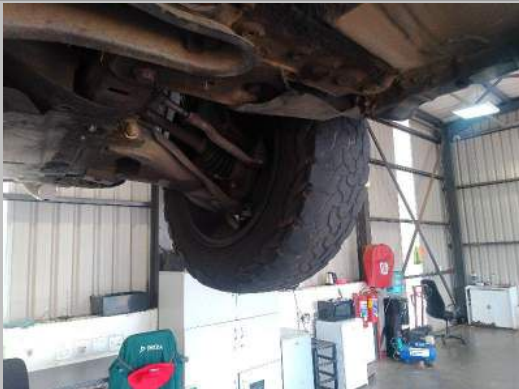

RF TYRE TREAD



RR TYRE TREAD



Spare wheel



Expansion bottle



Oil cap and dipstick



ENGINE 1

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VF1HSRCFN59319908



CONDITION REPORT



Report No:
2017302004
DATE
22/09/2026



ENGINE 2




CHASSIS




VIN PLATE OR STICKER



LICENSE DISC

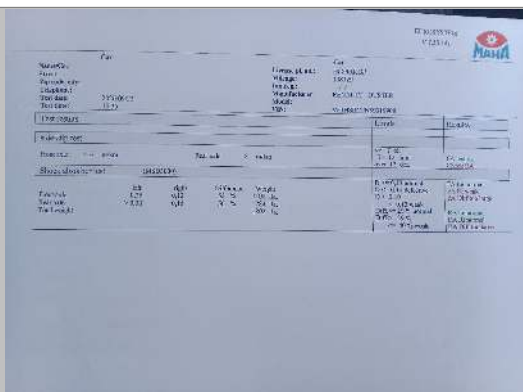

SHOCK REPORT

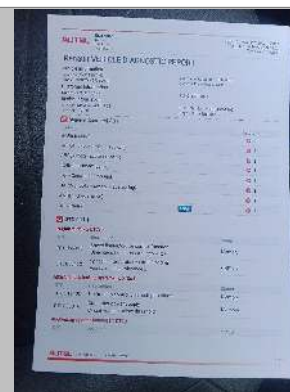

DIAGNOSTIC REPORT PAGE 1

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: VF1HSRCFN59319908



CONDITION REPORT



Report No:
2017302004
DATE
22/09/2026

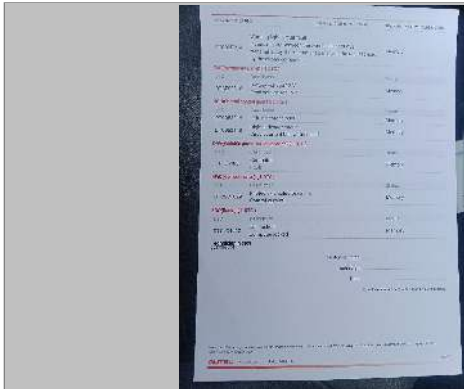

DIAGNOSTIC REPORT PAGE 2



Water level



Rear Fender Right



Door Rear Right



Door Front Right



Front Fender Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VF1HSRCFN59319908



CONDITION REPORT



Report No:
2017302004
DATE
22/09/2026



Front Bumper



Front Bumper



Bonnet



Front Fender Left



Door Front Left



Door Rear Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VF1HSRCFN59319908



CONDITION REPORT



Report No:
2017302004
DATE
22/09/2026



Rear Fender Left



Rear bumper



Rear bumper



Rear bumper



Boot Lid / Hatch door

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VF1HSRCFN59319908