



CONDITION REPORT

Report No: 2016271100

DATE  
16/02/2024

MFC Auction House  
M57 Pretoria Rd, Glenmarais, KEMPTON PARK  
Gauteng

DEKRA MFC  
M57 Pretoria Rd - 1619  
KEMPTON PARK - GT  
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	16/02/2024		M57 Pretoria Road - 1619
Inspection Date	16/02/2024		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	PEUGEOT	Registration Number	JZX581MP
Model	308	Register Number	
VIN	VF3LPHNZBFS247656	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	30/04/2024
Color	BLACK	Power / Displacement	
Year Model		Paint Finish	TWO COAT METALLIC
Km Reading	98,676 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Engine Oil Leak	Repair
Engine Wiring Defective	Repair
Oil level Insufficient	Replace
Bonnet stay and shocks Defective	Repair
Central Air Vent Defective	Repair
Seat Front Left Dirty	Repair
Seat Rear Dirty	Repair
Sun Visor Left Defective	Repair
Sun Visor Right Defective	Repair
Side Mirror Left Paintwork • Scratched	Repair
Front Bumper Paintwork • Scratched	Repair
Bonnet Paintwork • Scratched	Smart Repair
C • Pillar Right Paintwork • Scratched	Repair
Front Fender Left Paintwork • Scratched	Repair
Front Fender Right Paintwork • Scratched	Smart Repair
Rear Fender Left Paintwork • Scratched	Repair
Rear Fender Right Paintwork • Scratched	Repair
Door Front Left Paintwork • Scratched	Repair
Door Front Right Paintwork • Scratched	Repair
Door Rear Left Paintwork • Scratched	Repair
Door Rear Right Paintwork • Scratched	Repair
Boot Lid / Hatch door Paintwork • Scratched	Repair
Rear bumper Paintwork • Scratched	Repair
Rocker Panel Left Dented	Repair
Rocker Panel Right Paintwork • Scratched	Repair
Roof Paintwork • Scratched	Repair
Windscreen Chipped	Smart Repair
Tyre Front Right Worn	Replace
Tyre Rear Left Worn	Replace

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: VF3LPHNZBFS247656

1 / 14



## CONDITION REPORT

Report No: 2016271100

DATE  
16/02/2024

Damage	Repair Way
Tyre Rear Right Worn	Replace
Chassis Dented	Repair
Belly plates Damaged	Repair
Gearbox Oil Leak	Repair
Brakes Noisy	Repair
Interior	Vehicle interior dirty.
Axle and suspension	Abnormal noise coming from front and rear suspensi
Tyres and Rims	Spare wheel tyre has reached legal limit.
Lights	Left number plate lights not working.
Body and Exterior	Minor dents and scratches on some body panels.
Body and Exterior	Some body panels misaligned
Body and Exterior	Spray work on some body panels
Tyres and Rims	Alloy rims scratched
Engine	Engine bay dirty and brake fluid level ok
Undercarriage	Bottom of engine and gearbox fully covered
Undercarriage	Signs of oil leak on engine splash plate
Undercarriage	Vehicle undercarriage dirty.
Undercarriage	Exhaust heat shield damaged.
Tyres and Rims	Front left tyre has reached legal limit
Body and Exterior	Front left and right inner fender liners damaged
Body and Exterior	Signs of impact damage to front of vehicle.
Vehicle electronics malfunctioning	Repair
Electrical Components and Instruments	Front wipers faulty
Interior	Rear right seat belt buckle damaged
Drivers seat belt sensor malfunctioning	Repair
Engine management light illuminated on dashboard	Repair

### Brakes

#### Brake Test Results

	Left	Right	Axle Weight [KG]	Deceleration [m/s <sup>2</sup> ]
	Braking Force [KN]	Braking Force [KN]		
Front	3.29	3.19	-	
Rear	2.18	2.49	-	
Emergency / Parking	1.65	1.74	-	

### Tyres and Rims

#### Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	205/55 R16	91H	Pirelli	Cinturato	V	0218	1 mm
Front Right	205/55 R16	91H	Pirelli	Cinturato	V	0218	0 mm
Rear Left	205/55 R16	91V	Goodyear	Efficient	V	3415	0 mm
Rear Right	205/55 R16	94W	Triangle	Sportex	V	3920	0 mm
Spare	205/55 R16	91H	Pirelli	Cinturato	V	0218	1 mm

\* Tyre Legend: V=Virgin, R=Recap

### Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	BUILT-IN SYSTEMS INTERFACE(BSI)	B1808:87	FAULT IN UNLOCKING OF IMMOBILIZER BY ENGINE ECU QU	

### Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

### Comments

General Comments: ACCORDING TO AGE AND MILEAGE OF VEHICLE NORMAL WEAR AND TEAR ON INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



# CONDITION REPORT

VIN: V521 RHN 201627000  
Report No: Z01627000  
2 / 14  
DATE  
16/02/2024

## Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

## Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



CONDITION REPORT


Report No: 2016271100  
 VIN: VF3LPHNZBFS247656  
 DATE: 16/02/2024



Manual Transmission



Spare wheel and Accessories

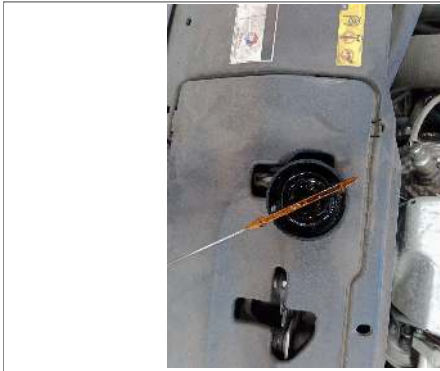

Oil cap and dipstick



Front chassis



Rear chassis

Vehicle		Chassis		Status	
Model	T 200	Standa	AT 200	17.10.2019	17.10.2019
Year	2019	2019	2019	17.10.2019	17.10.2019
Color	Blue	Blue	Blue	17.10.2019	17.10.2019
Engine	1.8	1.8	1.8	17.10.2019	17.10.2019
Power	125	125	125	17.10.2019	17.10.2019
Transmission	Manual	Manual	Manual	17.10.2019	17.10.2019
Drive	Front	Front	Front	17.10.2019	17.10.2019
Weight	1500	1500	1500	17.10.2019	17.10.2019
Max speed	180	180	180	17.10.2019	17.10.2019
0-100	10.5	10.5	10.5	17.10.2019	17.10.2019
Consumption	6.5	6.5	6.5	17.10.2019	17.10.2019
CO2	130	130	130	17.10.2019	17.10.2019

Front chassis

DEKRA Automotive (PTY) Ltd.  
 97 Willem Cruywagen Ave  
 Klerksord, Pretoria, 0200  
 Phone: 012 542 4867  
 www.dekraauto.co.za



**CONDITION REPORT**

**Report No: 2016271100**

**DATE**  
VIN: VF3LPHN7155271054  
~~16/02/2024~~  
4 / 14

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za




CONDITION REPORT

Report No: 2016271100


DATE  
16/02/2024

VIN: VF3LPHNZBFS247656


5 / 14

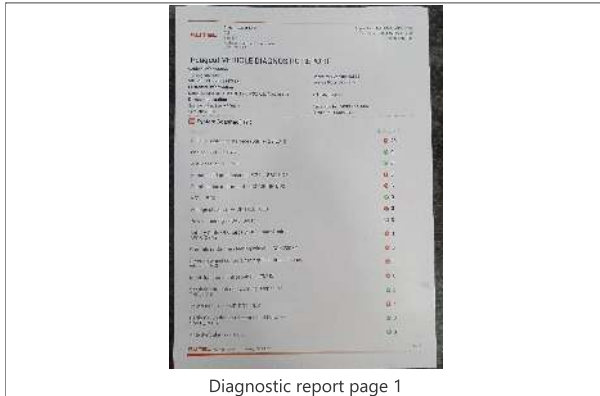


Diagnostic report page 1

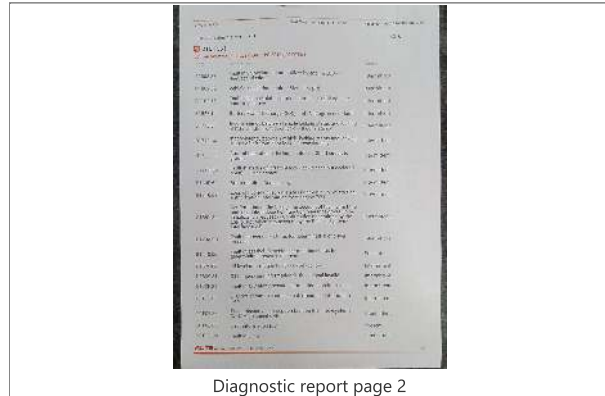


Diagnostic report page 2

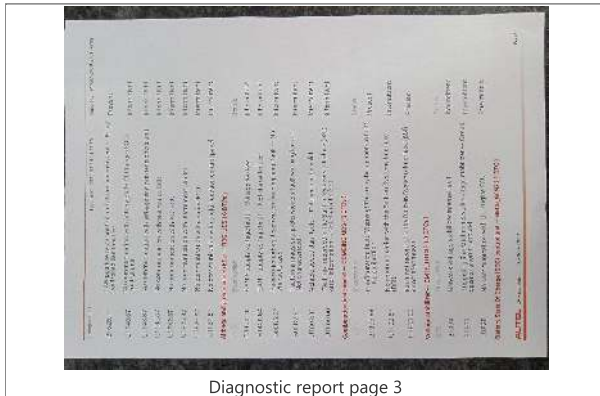


Diagnostic report page 3

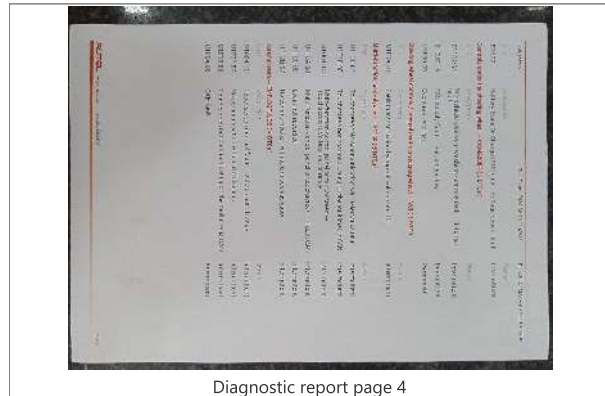

Diagnostic report page 4

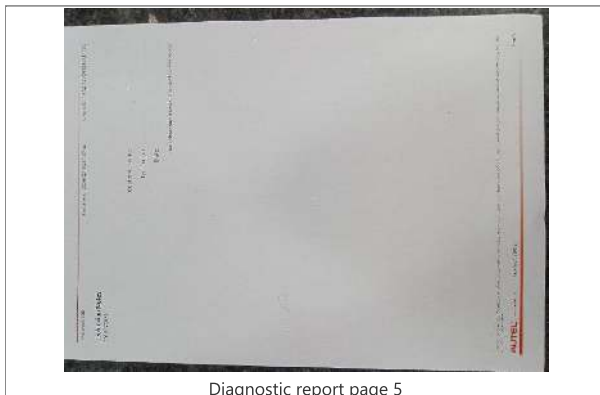

Diagnostic report page 5

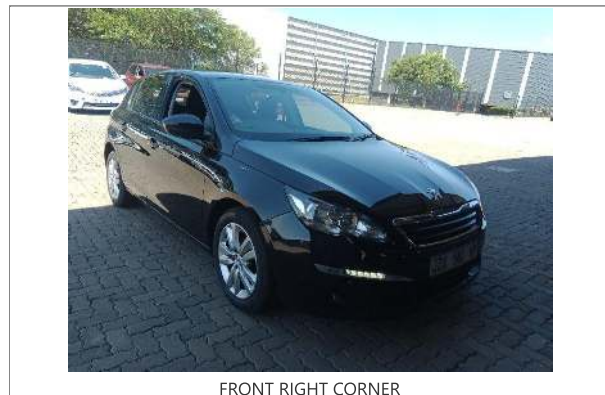

FRONT RIGHT CORNER

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



**CONDITION REPORT**

**Report No: 2016271100**

**DATE**  
**16/02/2024**

VIN: VF3LPHNZBFS247656

6 / 14

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016271100

DATE  
16/02/2024



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

VIN: VF3LPHNZBFS247656  
7 / 14



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za





**CONDITION REPORT**

**Report No: 2016271100**

**DATE**  
**16/02/2024**

VIN: VF3LPHNZBFS247656  
8 / 14

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016271100

DATE  
16/02/2024



90 DEGREE REAR



90 DEGREE LEFT

VIN: VF3LPHNZBFS247656

9 / 14



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



**CONDITION REPORT**

**Report No: 2016271100**

**DATE**  
**16/02/2024**

VIN: VF3LPHNZBFS247656

10 / 14

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016271100

DATE  
16/02/2024



LICENSE DISC



VIN PLATE OR STICKER

VIN: VF3LPHNZBFS247656  
11 / 14




ENGINE 1



Sun Visor Left



Sun Visor Right

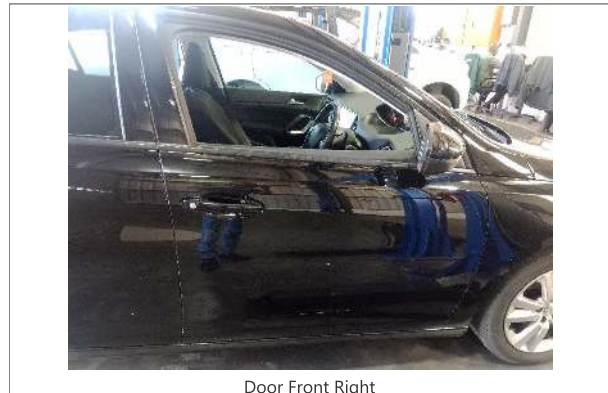

Door Front Right

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



**CONDITION REPORT**

**Report No: 2016271100**

**DATE**  
**16/02/2024**

VIN: VF3LPHNZBFS247656

12 / 14

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016271100

DATE  
16/02/2024



Door Rear Right



Rear Fender Right


ZBFS247656  
13 / 14



Seat Rear



Rear bumper

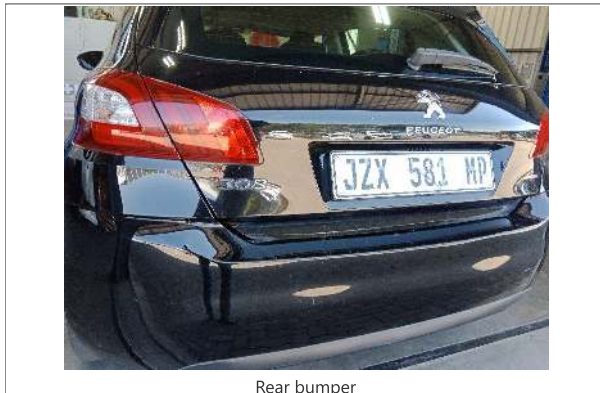

Rear bumper



Boot Lid / Hatch door

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016271100

DATE  
16/02/2024

VIN: VF3LPHNZBFS247656

14 / 14

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016271100

DATE  
16/02/2024



Roof




Roof



C • Pillar Right



Rear Fender Left

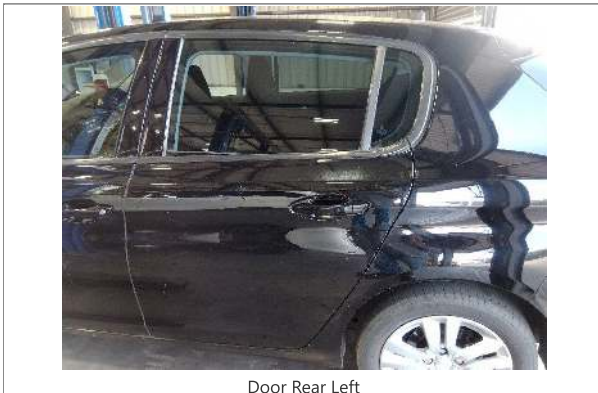

Door Rear Left



Seat Rear

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za





**CONDITION REPORT**

Report No: 2016271100

DATE  
16/02/2024


DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016271100


DATE  
16/02/2024

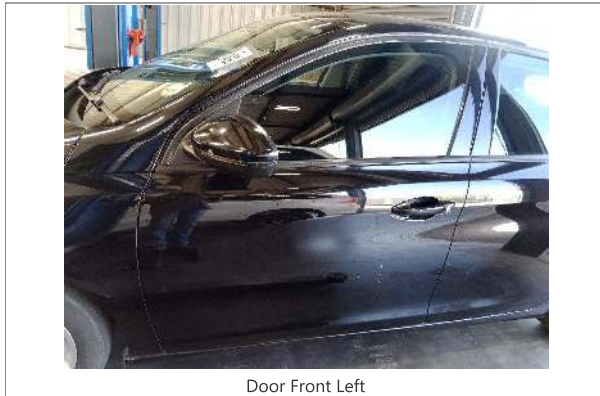


Door Front Left



Side Mirror Left

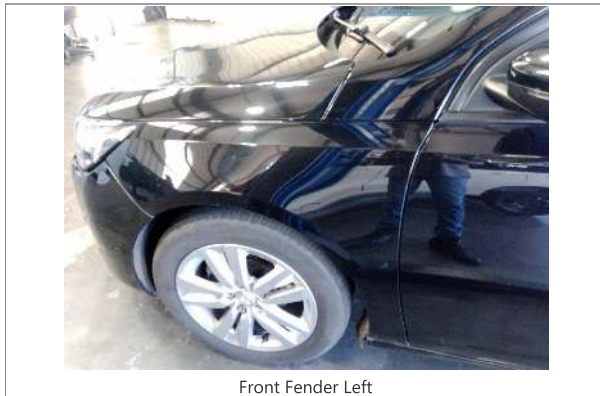

Front Fender Left

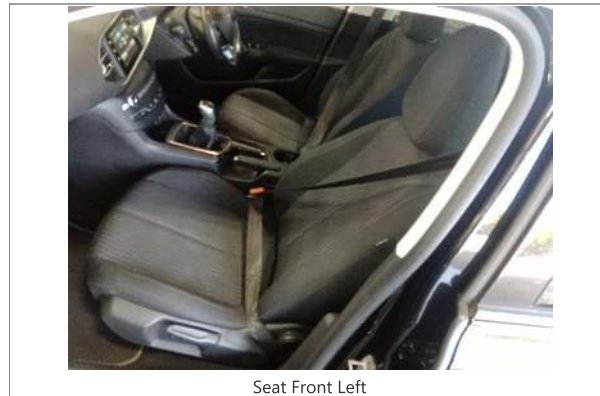

Seat Front Left



Windscreen



Front Bumper

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



**CONDITION REPORT**

Report No: 2016271100

DATE  
16/02/2024

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za




CONDITION REPORT

Report No: 2016271100


DATE  
16/02/2024




Front Bumper

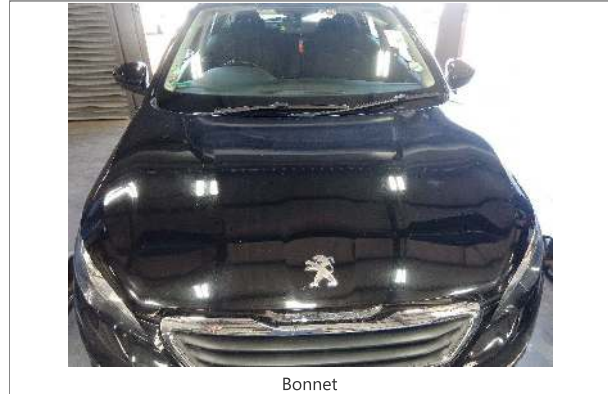

Bonnet

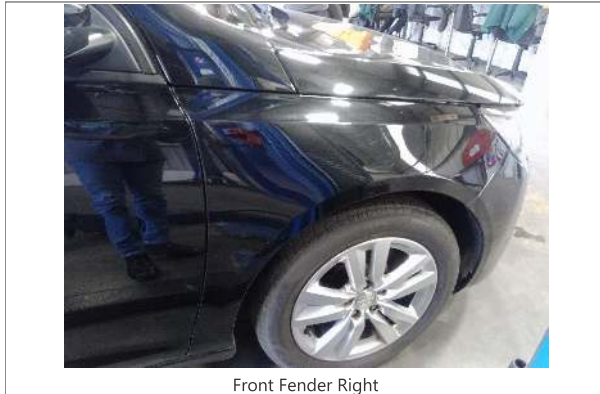

Front Fender Right

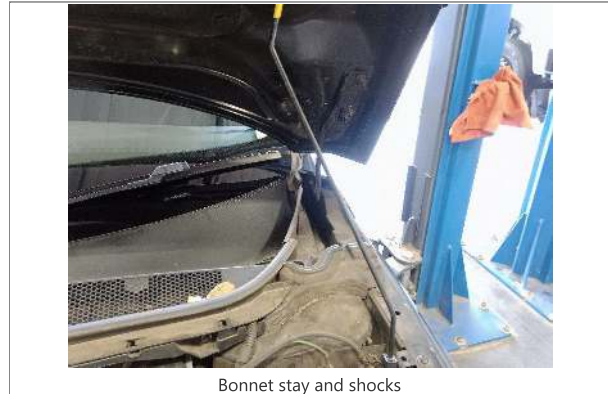

Bonnet stay and shocks



Engine



Water level

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



**CONDITION REPORT**

Report No: 2016271100

DATE  
16/02/2024

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016271100

DATE  
16/02/2024



Rocker Panel Left



Rocker Panel Right



Engine



Tyre Front Right



Chassis



Tyre Rear Left

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016271100

DATE  
16/02/2024

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016271100

DATE  
16/02/2024




Tyre Rear Right




Belly plates



Gearbox

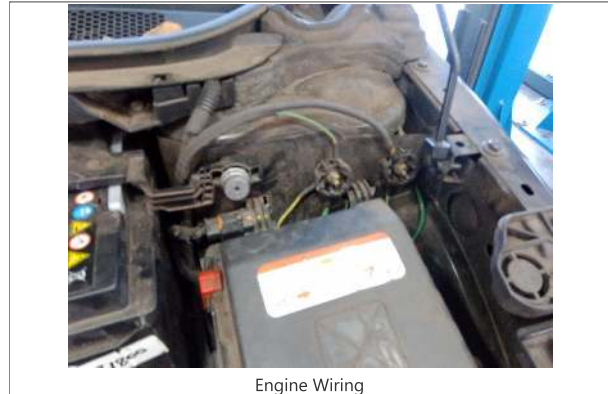

Engine Wiring

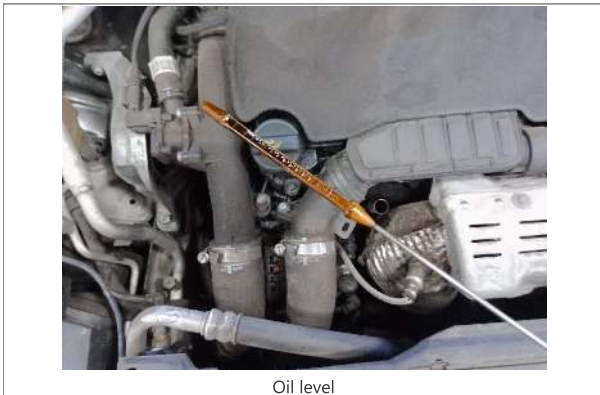

Oil level



Central Air Vent

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za





**CONDITION REPORT**

**Report No: 2016271100**

**DATE**  
**16/02/2024**

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za