



CONDITION REPORT



Report No:
2017302320
DATE
23/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	23/09/2026		M57 Pretoria Road - 1619
Inspection Date	23/09/2026		Kempton Park - GT

Vehicle Data

Vehicle Type	LIGHT LOAD VEHICLE	Registered Owner	MFC
Manufacturer	PEUGEOT	Registration Number	LGR077MP
Model	LANDTREK 1.9 4ACTION 110KW 4X4 DSL D-CAB PU AT [2021-ON]	Register Number	
		Date Of First Licensing	
VIN	VR3FDAHDYR3024107	Last COR	
Engine Number		License Expiry Date	28/02/2027
Doors	4	Power / Displacement	
Color	WHITE	Paint Finish	TWO COAT UNI
Year Model	2024	Fuel	DIESEL
Km Reading	47,693 KM	Transmission	AUTOMATIC
Cab / Body Type	DOUBLE CAB		

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: VR3FDAHDYR3024107



CONDITION REPORT



Report No:
2017302320
DATE
23/09/2026

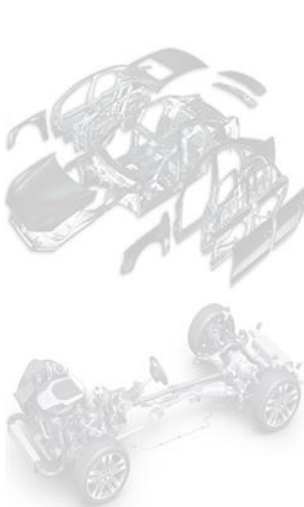

Damage	Repair Way
Front Bumper Damaged	Repair
Front Fender Left Damaged	Repair
Rear Fender Left Damaged	Replace
Rear Fender Right Damaged	Repair
Door Front Left Damaged	Repair
Windscreen Damaged	Replace
Tyre Front Right Worn	Replace
Tyre Rear Left Worn	Repair
Belly plates Damaged	Replace

Brakes

Brake Test Results

No Brake Test on a brake test machine has been performed.

	Left	Right	Axle Weight [KG]	Deceleration [m/s ²]
	Braking Force [KN]	Braking Force [KN]		
Front	-	-	-	
Rear	-	-	-	
Emergency / Parking	-	-	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	265/60R18	110T	Giti	Radial	V	2924	2 mm
Front Right	265/60R18	110T	Giti	Radial	V	2924	0 mm
Rear Left	265/60R18	110T	Giti	Radial	V	2924	0 mm
Rear Right	265/60R18	110T	Giti	Radial	V	3024	4 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VR3FDAHDYR3024107



CONDITION REPORT



Report No:
2017302320
DATE
23/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	AIRBAGS AND PRETENSIONERS	B1B29:11	PASSENGER AIRBAG DEACTIVATION WARNING LAMP CIRCUIT	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. 14 DTC'S AT TIME OF TESTING SEE DTC REPORT. Body • Exterior: Minor dents and scratches and stone chips to body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: VR3FDAHDYR3024107




CONDITION REPORT




Report No:
2017302320
DATE
23/09/2026

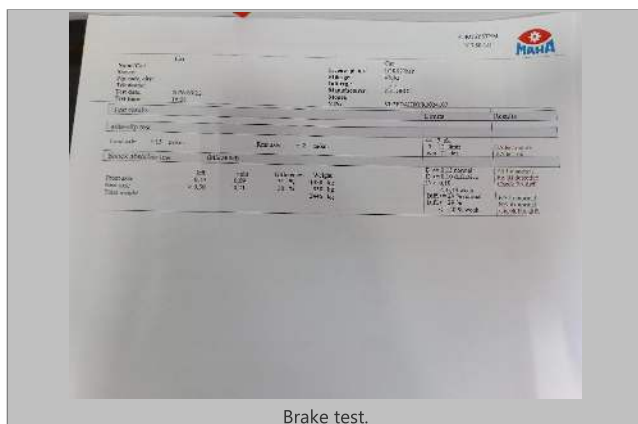

Brake test.

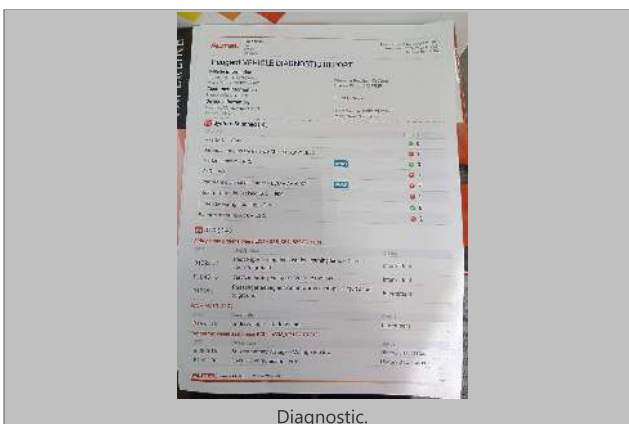


Diagnostic.

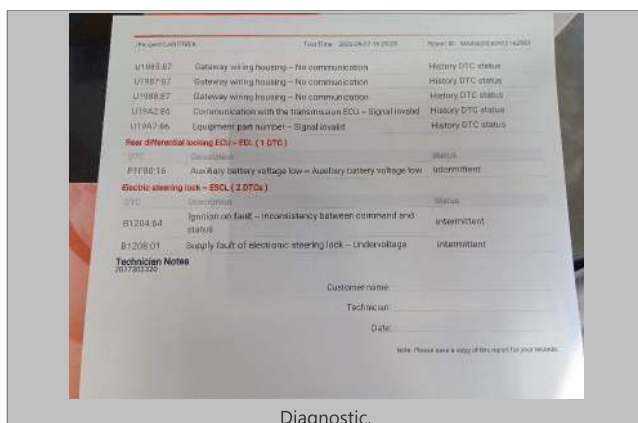


Diagnostic.



Undercarriage front.

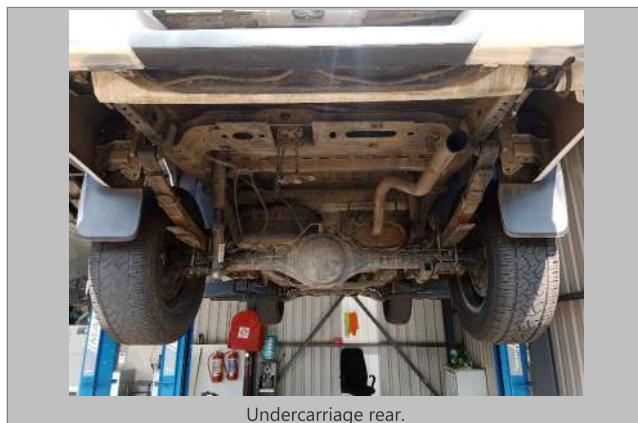

Undercarriage rear.

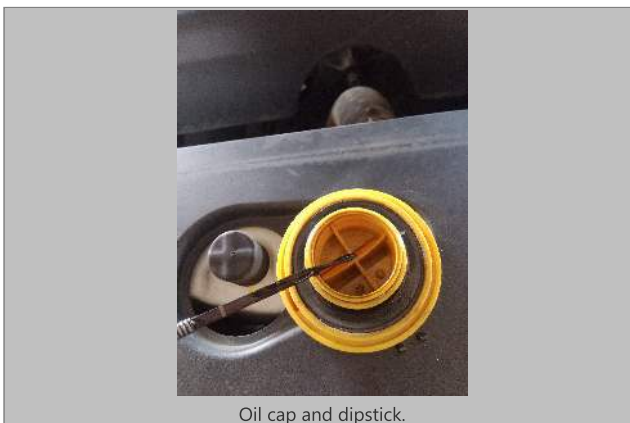

Oil cap and dipstick.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VR3FDAHDYR3024107



CONDITION REPORT



Report No:
2017302320
DATE
23/09/2026



Automatic.



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VR3FDAHDYR3024107



CONDITION REPORT



Report No:
2017302320
DATE
23/09/2026



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VR3FDAHDYR3024107



CONDITION REPORT



Report No:
2017302320
DATE
23/09/2026



RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



Water level

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VR3FDAHDYR3024107



CONDITION REPORT



Report No:
2017302320
DATE
23/09/2026



Front Bumper



Front Bumper



Front Fender Left



Rear Fender Left



Door Front Left



Rear Fender Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VR3FDAHDYR3024107



CONDITION REPORT



Report No:
2017302320
DATE
23/09/2026




Windscreen



Tyre Rear Left



Belly plates

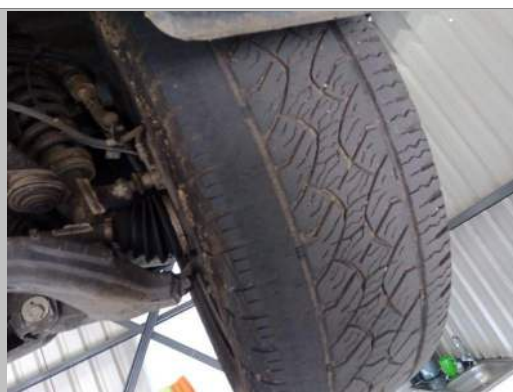

Tyre Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VR3FDAHDYR3024107