



CONDITION REPORT



Report No:
2017303140
DATE
25/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	25/09/2026		M57 Pretoria Road - 1619
Inspection Date	25/09/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	OPEL	Registration Number	KPY814NW
Model	CROSSLAND 1.2 EDITION [2021-2022]	Register Number	
VIN	W0V7D9EE3M4341635	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	
Color	SILVER	Power / Displacement	
Year Model	2022	Paint Finish	TWO COAT METALLIC
Km Reading	97,560 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: W0V7D9EE3M4341635



CONDITION REPORT



Report No:

2017303140

DATE

25/09/2026

Damage

Repair Way

Engine Management Lights Set
 Headlight Left Damaged
 Front Bumper Damaged
 Bonnet Damaged
 Front Fender Left Damaged
 Front Fender Right Damaged
 Rear Fender Right Damaged
 Door Front Left Damaged
 Door Front Right Damaged
 Door Rear Left Damaged
 Door Rear Right Damaged
 Spare Tyre Worn

Repair
 Replace
 Repair
 Repair
 Repair
 Repair
 Repair
 Repair
 Repair
 Repair
 Repair
 Replace



Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.89	3.09	-	
Rear	2.01	2.1	-	
Emergency / Parking	1.47	1.6	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	205/60R16	92V	Hilo	Radial	V	1624	2 mm
Front Right	205/60R16	92H	Autogrip	Radial	V	3924	2 mm
Rear Left	205/60R16	92V	Invovic	Radial	V	3025	1 mm
Rear Right	205/60R16	92H	Autogrip	Radial	V	1224	2 mm
Spare	T125/85R16	99M	Continental	Temporary	V	3521	0 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: W0V7D9EE3M4341635



CONDITION REPORT



Report No:

2017303140

DATE

25/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ELECTRONIC BRAKE CONTROL MODULE	C1383:00	BRIGHT FLUID LEVEL SENSOR CIRCUIT MALFUNCTION	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: 49 DTC'S AT TIME OF TESTING SEE DTC REPORT. ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Engine Compartment: micro cracks visible in timing belt.

Body • Exterior: Minor dents and scratches and stone chips to body panels. Signs of repair work done to body panels. Poor alignment to somebody panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: W0V7D9EE3M4341635



CONDITION REPORT



Report No:

2017303140

DATE

25/09/2026



FRONT RIGHT CORNER



REAR LEFT CORNER



90 DEGREE FRONT



90 DEGREE REAR



90 DEGREE LEFT



90 DEGREE RIGHT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: W0V7D9EE3M4341635




CONDITION REPORT




Report No:
2017303140
DATE
25/09/2026




ODOMETER

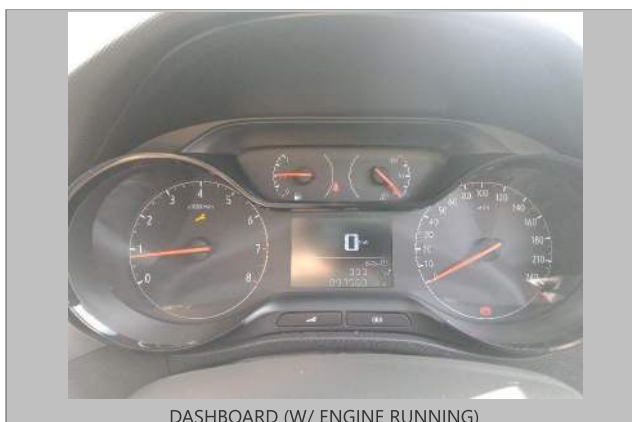

DASHBOARD (W/ ENGINE RUNNING)

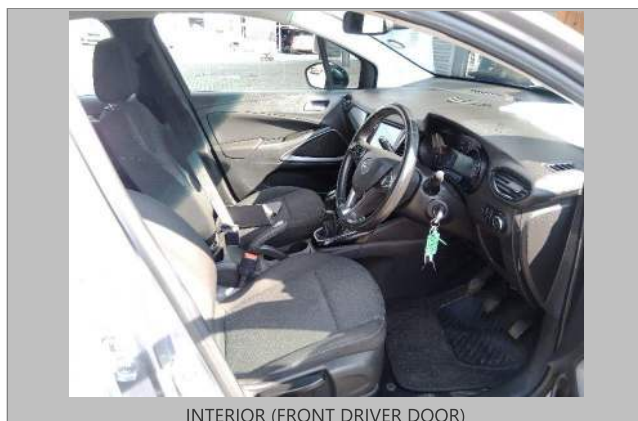


INTERIOR (FRONT DRIVER DOOR)

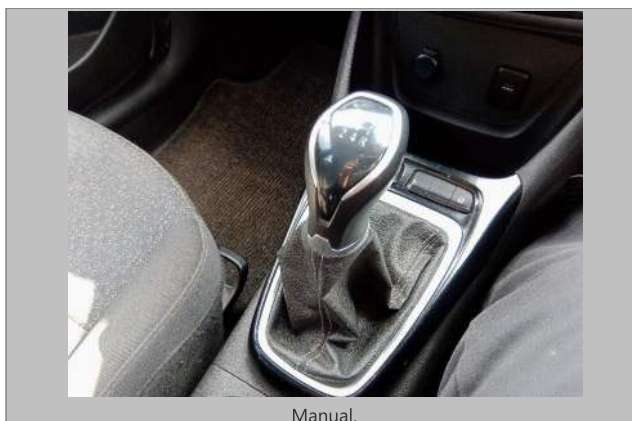

Manual.



LF TYRE TREAD

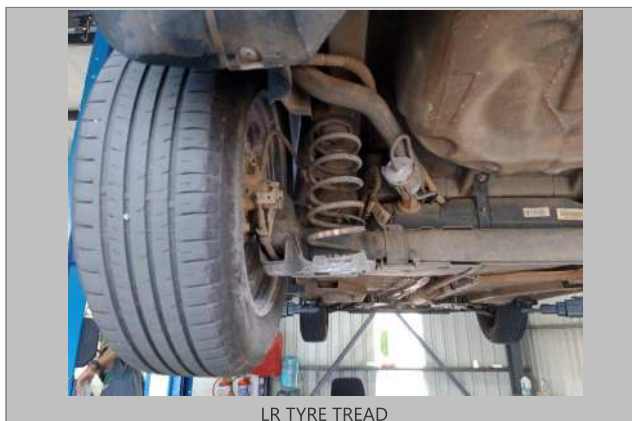

LR TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: W0V7D9EE3M4341635




CONDITION REPORT



Report No:
2017303140
DATE
25/09/2026



RF TYRE TREAD

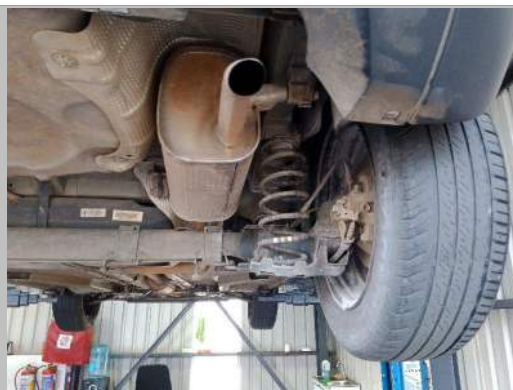

RR TYRE TREAD



spare wheel.



timing belt



Oil cap and dipstick.



Undercarriage front.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: W0V7D9EE3M4341635



CONDITION REPORT



Report No:

2017303140

DATE

25/09/2026



Undercarriage rear.




ENGINE 1




VIN PLATE OR STICKER



LICENSE DISC

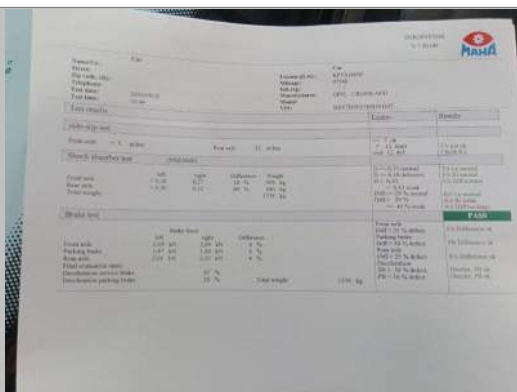

BRAKE TEST REPORT

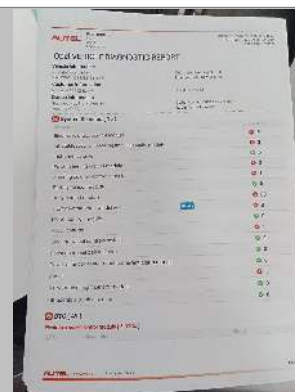

DIAGNOSTIC REPORT PAGE 1

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: W0V7D9EE3M4341635



CONDITION REPORT




Report No:


2017303140

DATE


25/09/2026

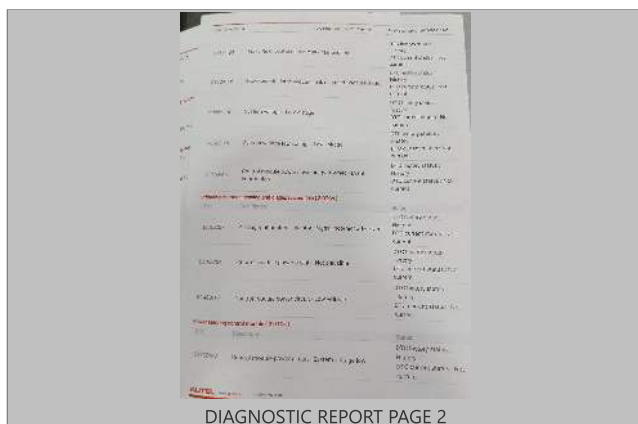


DIAGNOSTIC REPORT PAGE 2

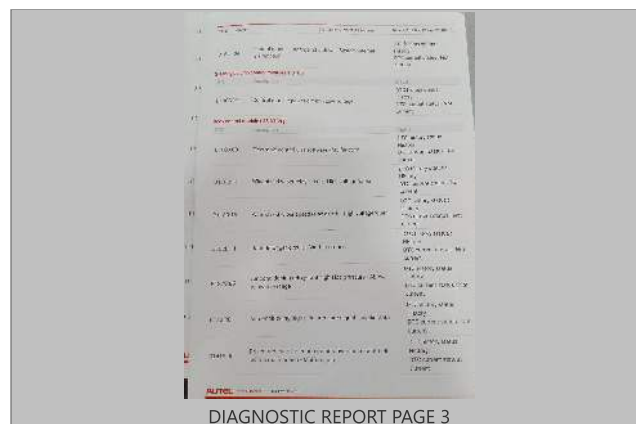


DIAGNOSTIC REPORT PAGE 3

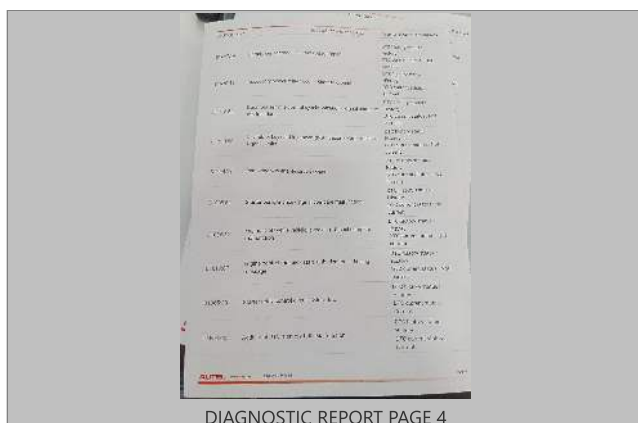


DIAGNOSTIC REPORT PAGE 4

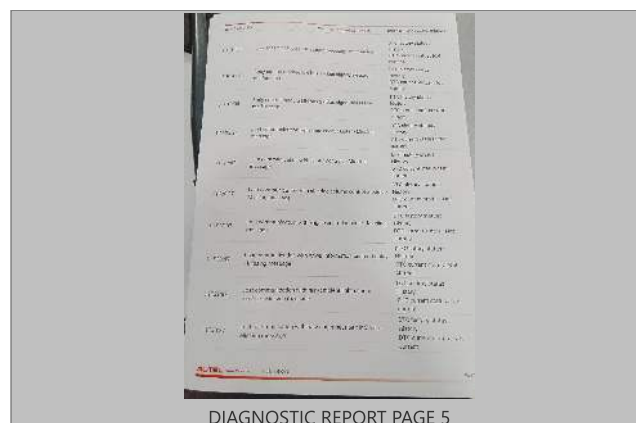

DIAGNOSTIC REPORT PAGE 5

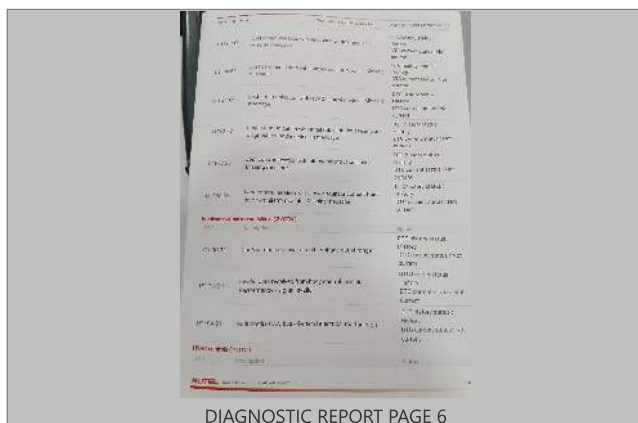

DIAGNOSTIC REPORT PAGE 6

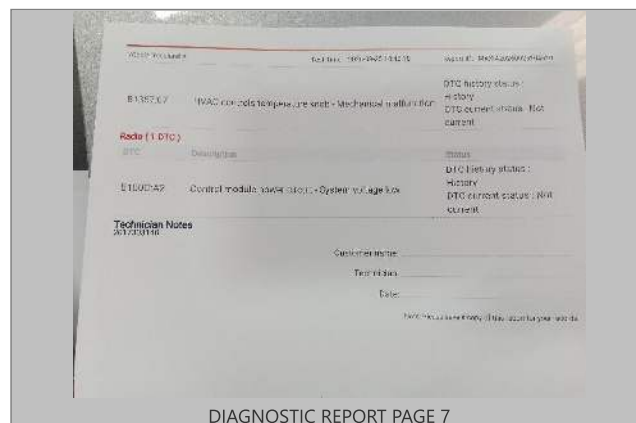

DIAGNOSTIC REPORT PAGE 7

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: W0V7D9EE3M4341635



CONDITION REPORT



Report No:
2017303140
DATE
25/09/2026



Water level



Front Bumper



Front Bumper



Bonnet



Bonnet



Headlight Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: W0V7D9EE3M4341635



CONDITION REPORT



Report No:
2017303140
DATE
25/09/2026



Front Fender Left




Door Front Left



Door Rear Left



Spare Tyre

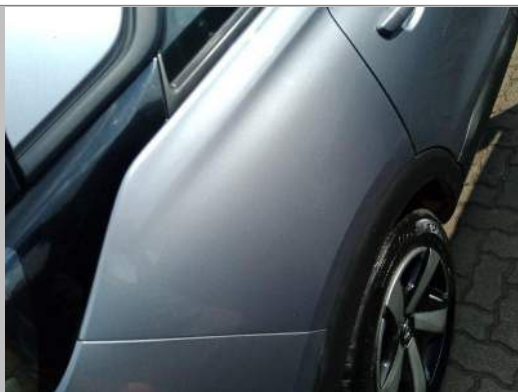

Rear Fender Right



Front Fender Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: W0V7D9EE3M4341635



CONDITION REPORT



Report No:
2017303140
DATE
25/09/2026



Door Front Right



Door Rear Right



Engine Management Lights

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: W0V7D9EE3M4341635