



CONDITION REPORT

Report No: 2016254577

DATE
05/02/2024

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	05/02/2024		M57 Pretoria Road - 1619
Inspection Date	05/02/2024		Kempton Park - GT

Vehicle Data


Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	AUDI	Registration Number	KN92CYGP
Model	A3 TFSI	Register Number	
VIN	WAUZZZ8V0KA126905	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	30/04/2024
Color	WHITE	Power / Displacement	
Year Model		Paint Finish	TWO COAT METALLIC
Km Reading	64,378 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Front Bumper Damaged	Repair
Front Fender Left Damaged	Repair
Door Front Right Damaged	Repair
Door Rear Right Damaged	Repair
Rear bumper Damaged	Repair
Tyre Rear Left Worn	Replace
Steering Malfunction	Repair

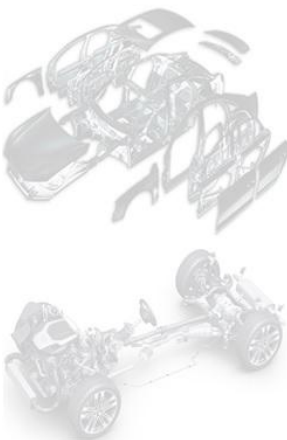

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WAUZZZ8V0KA126905



CONDITION REPORT

Report No: 2016254577

DATE
05/02/2024

Brakes

Brake Test Results

	Left	Right	Axle Weight [KG]	Deceleration [m/s ²]
	Braking Force [KN]	Braking Force [KN]		
Front	3.26	3.37	-	
Rear	2.86	2.78	-	
Emergency / Parking	1.92	1.52	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	205/60R16	92V	Autogrip	Radial	V	0421	3 mm
Front Right	205/60R16	92V	Autogrip	Radial	V	0421	3 mm
Rear Left	205/55R16	91W	Bridgestone	Radial	V	2119	0 mm
Rear Right	205/55R16	91W	Bridgestone	Radial	V	2619	2 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: STEERING LIGHT ON CLUSTER INTERMITTED. Body • Exterior: Minor dents and scratches and stone chips to some body panels. Signs of repair work done to some body panels.

Undercarriage: Bottom of engine and gearbox fully covered.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Technician

Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.




CONDITION REPORT

VIN: WAUZZZ8820016254577


Report No: 2016254577

2 / 8
DATE


05/02/2024

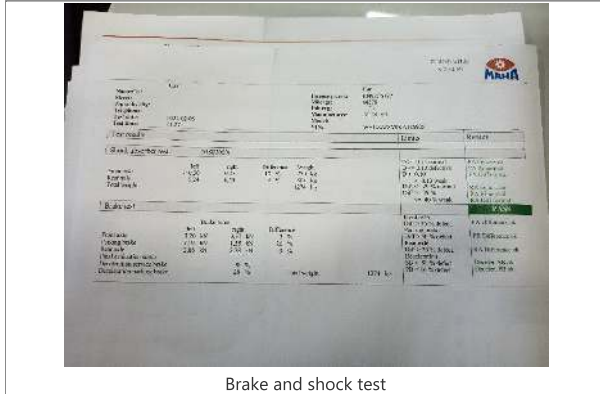


Brake and shock test

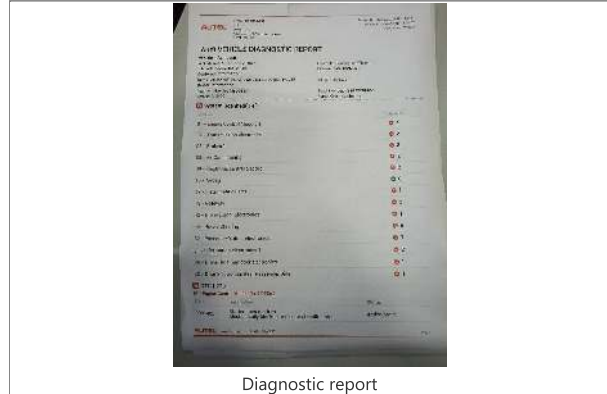


Diagnostic report

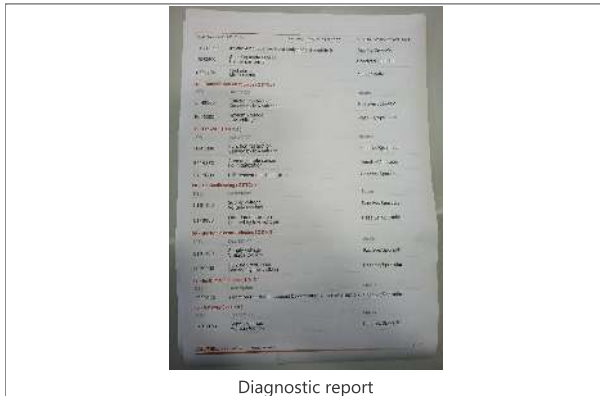


Diagnostic report

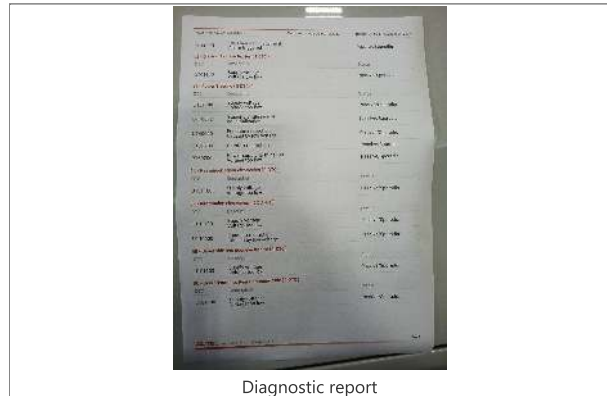

Diagnostic report

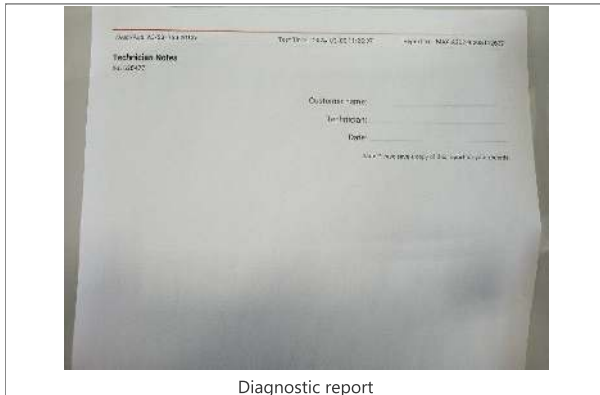

Diagnostic report

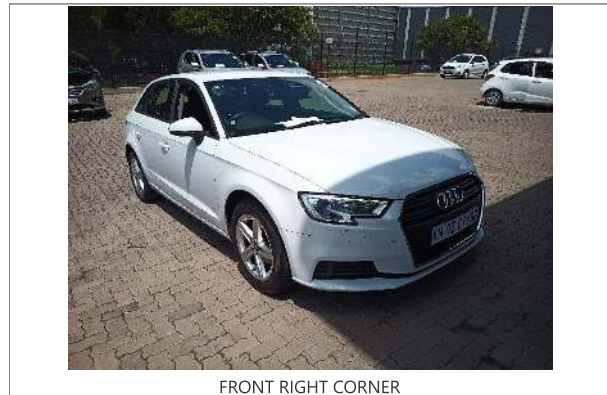

FRONT RIGHT CORNER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016254577

VIN: WAUZZZ8V0KA126905

DATE

05/02/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016254577

DATE: 03/02/2024
VIN: WAUZZZ8V030024
4/8



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)




DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT

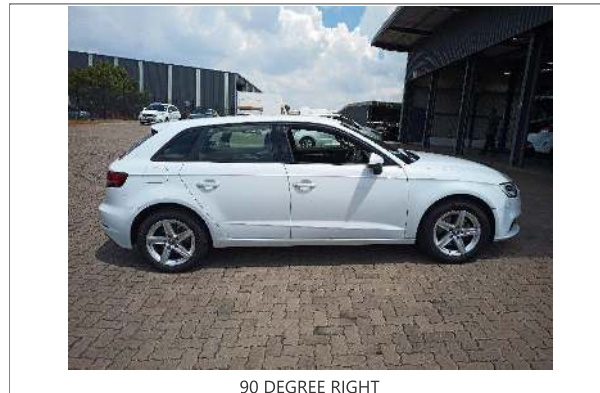

90 DEGREE RIGHT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016254577

DATE
05/02/2024

VIN: WAUZZZ8V0KA126905

5 / 8

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za




CONDITION REPORT

Report No: 2016254577

DATE
05/02/2024

VIN: WAUZZZ8V0KA126905

6 / 8

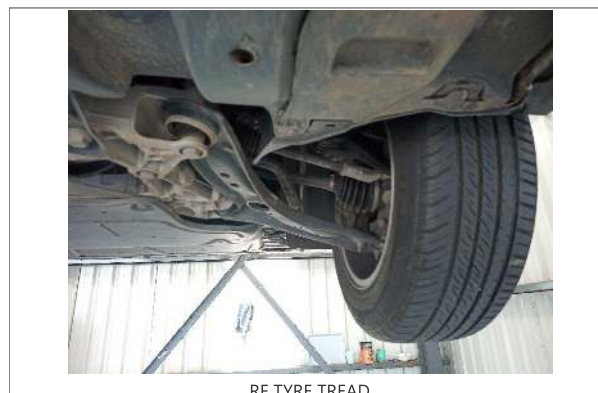

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
 www.dekraauto.co.za



CONDITION REPORT

Report No: 2016254577

DATE
05/02/2024

VIN: WAUZZZ8V0KA126905

7 / 8

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



LICENSE DISC



VIN PLATE OR STICKER

0KA126905
8 / 8



ENGINE 1



CHASSI



CHASSI



ADDITIONAL 10



CONDITION REPORT

Report No: 2016254577

DATE
05/02/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016254577

DATE
05/02/2024




ADDITIONAL 11



Water level




Front Bumper

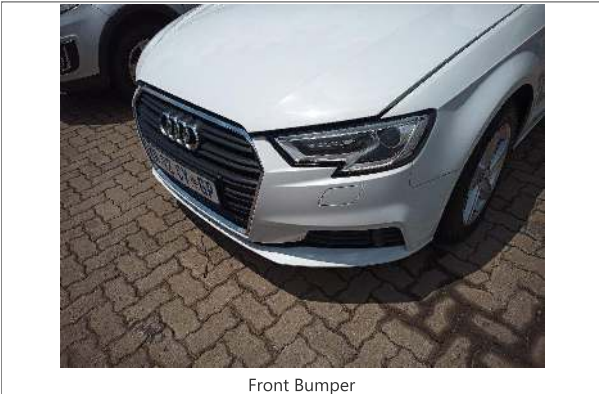

Front Bumper



Front Fender Left

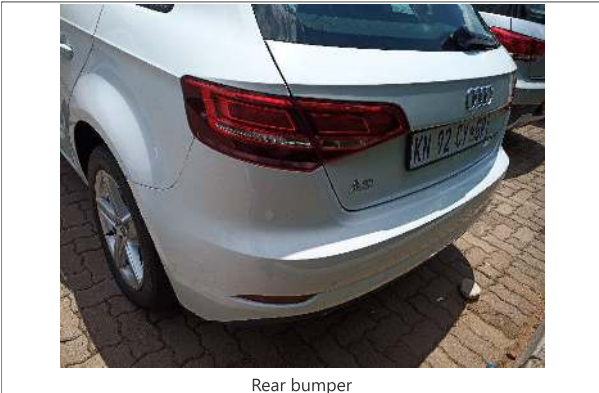

Rear bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016254577

DATE
05/02/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016254577

DATE
05/02/2024



Rear bumper



Door Front Right



Door Rear Right



Tyre Rear Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016254577

DATE
05/02/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za