



CONDITION REPORT



Report No:
2016993250
DATE
27/08/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	29/08/2025		M57 Pretoria Road - 1619
Inspection Date	27/08/2025		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	AUDI	Registration Number	JR25BKGP
Model	S3 2.0T FSI QUATTRO 3-DR S TRONIC [2014-2017]	Register Number	
VIN	WAUZZZ8V4FA077018	Date Of First Licensing	
Engine Number		Last COR	
Doors	3	License Expiry Date	31/08/2024
Color	RED	Power / Displacement	
Year Model	2015	Paint Finish	C - COMMON
Km Reading	94,896 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: WAUZZZ8V4FA077018



CONDITION REPORT



Report No:
2016993250
DATE
27/08/2025

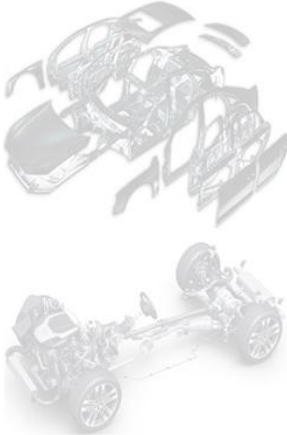	Damage	Repair Way
	Engine Oil Leak Dim Light Right Malfunction Front Bumper Paintwork • Scratched Bonnet Paintwork • Chipmarks Front Fender Left Paintwork • Flaking Front Fender Right Paintwork • Flaking Rear Fender Left Paintwork • Flaking Rear Fender Right Paintwork • Flaking Door Front Left Paintwork • Scratched Door Front Right Paintwork • Scratched Rear bumper Paintwork • Scratched Sill Panel Right Defective Tyre Front Left Defective Tyre Rear Right Damaged Brakes	Repair Repair Repair Repair Repair Repair Repair Repair Repair Repair Repair Repair Replace Replace No brake test done vehicle is 4wd

Brakes

Brake Test Results

No Brake Test on a brake test machine has been performed.

	Left	Right	Axle Weight [KG]	Deceleration [m/s²]
	Braking Force [KN]	Braking Force [KN]		
Front	-	-	-	
Rear	-	-	-	
Emergency / Parking	-	-	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	225/40R18	92W	Sun wide	Rs-one	V	4520	3 mm
Front Right	225/40R18	92W	Good ride	Sa-07	V	4918	3 mm
Rear Left	225/45R18	91Y	Continental	Contact	V	3016	3 mm
Rear Right	225/45R18	91Y	Continental	Contact	V	4119	2 mm
Spare	T125/70R18	99M	Continental	Contact	V	00000	4 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WAUZZZ8V4FA077018



CONDITION REPORT



Report No:
2016993250
DATE
27/08/2025

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	PASSIVE/SPORADIC	B13C401	SUNROOF BUTTON ELECTRICAL FAULT	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Andrick Wymers

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: WAUZZZ8V4FA077018



CONDITION REPORT



Report No:
2016993250
DATE
27/08/2025

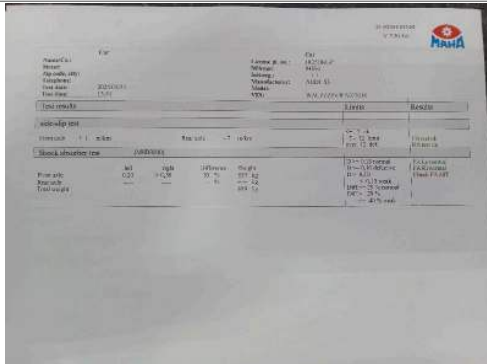

Shock report




Diagnostic report



Diagnostic report



Diagnostic report

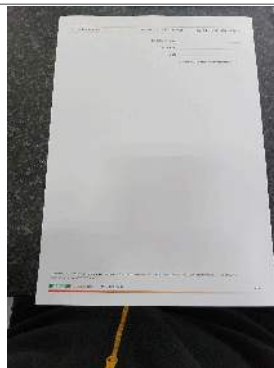

Diagnostic report



FRONT RIGHT CORNER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WAUZZZ8V4FA077018



CONDITION REPORT



Report No:
2016993250
DATE
27/08/2025



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Automatic



90 DEGREE FRONT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WAUZZZ8V4FA077018



CONDITION REPORT



Report No:
2016993250
DATE
27/08/2025



90 DEGREE RIGHT



90 DEGREE REAR




90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD

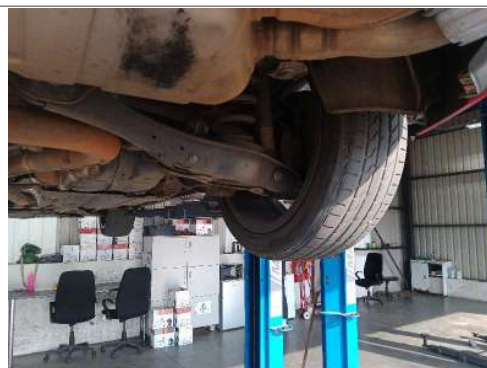

RR TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WAUZZZ8V4FA077018



CONDITION REPORT



Report No:
2016993250
DATE
27/08/2025




RF TYRE TREAD



Spare wheel



LICENSE DISC

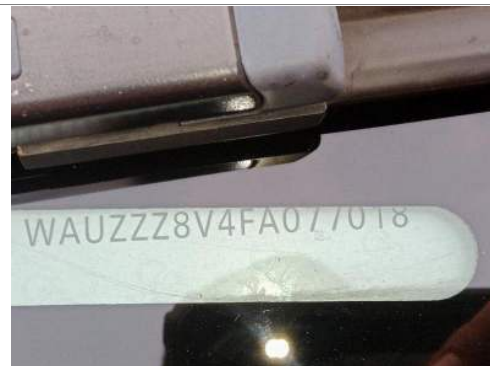

VIN PLATE OR STICKER



ENGINE 1



ENGINE 2

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WAUZZZ8V4FA077018



CONDITION REPORT



Report No:
2016993250
DATE
27/08/2025



CHASSIS



Expansion bottle



Oil cap and dipstick



Water level



Dim Light Right



Rear Fender Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WAUZZZ8V4FA077018



CONDITION REPORT



Report No:
2016993250
DATE
27/08/2025



Door Front Right



Front Fender Right



Front Bumper



Front Fender Left



Door Front Left



Rear Fender Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WAUZZZ8V4FA077018



CONDITION REPORT



Report No:
2016993250
DATE
27/08/2025



Rear bumper




Rear bumper



Bonnet



Sill Panel Right

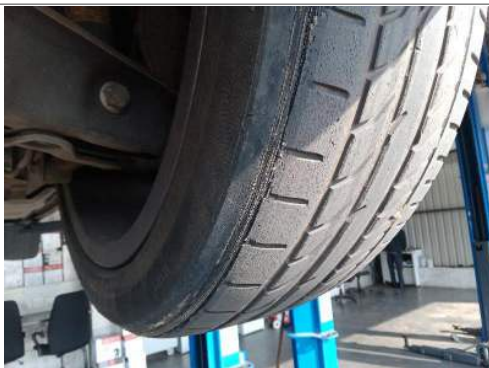

Tyre Rear Right



Engine

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WAUZZZ8V4FA077018



CONDITION REPORT



Report No:
2016993250
DATE
27/08/2025



Tyre Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WAUZZZ8V4FA077018