



CONDITION REPORT



Report No:
2017299426
DATE
16/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	16/09/2026		M57 Pretoria Road - 1619
Inspection Date	16/09/2026		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	AUDI	Registration Number	BY10BBZN
Model	A3	Register Number	
VIN	WAUZZZF38R1157136	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/10/2025
Color	GREY	Power / Displacement	
Year Model	2013	Paint Finish	TWO COAT METALLIC
Km Reading	12,290 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: WAUZZZF38R1157136



CONDITION REPORT



Report No:
2017299426
DATE
16/09/2026

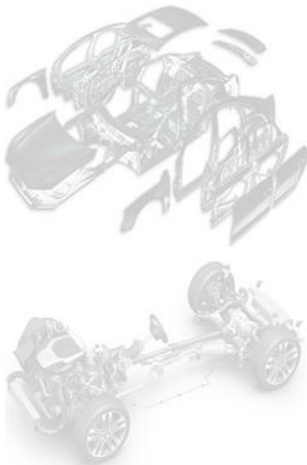

Damage	Repair Way
Front Bumper Damaged	Repair
Front Fender Left Damaged	Repair
Rear Fender Left Damaged	Repair
Rear Fender Right Damaged	Repair
Door Front Left Damaged	Repair
Door Rear Left Damaged	Repair

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.8	3.7	-	
Rear	2.9	3.1	-	
Emergency / Parking	2.9	3.2	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	235/55R18	100V	Michelin	Radial	V	1524	3 mm
Front Right	235/55R18	100V	Michelin	Radial	V	1524	3 mm
Rear Left	235/55R18	100V	Michelin	Radial	V	1524	3 mm
Rear Right	235/55R18	100V	Michelin	Radial	V	1524	3 mm
Spare	T145/85R18	103M	Linglong	Temporary	V	1024	2 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WAUZZZF38R1157136



CONDITION REPORT



Report No:
2017299426
DATE
16/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	09-ELECTRONIC CENTRAL ELECTRIC	B147A18	REMOTE CONTROL VEHICLE KEY 2 INSUFFICIENT CURRENT	ACTIVE /STATIC

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Minor dents and scratches and stone chips to body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WAUZZZF38R1157136



CONDITION REPORT



Report No:
2017299426
DATE
16/09/2026

Car				EUROSYSTEM VTN 141		MAHA	
Name/Car:	Car	License plate:	Car	VTN 141	MAHA		
Street:		Model:					
Zip code, city:		Year:					
Telephone:		Manufacturer:					
Test date:	2026/09/17	Model:					
Test time:	9:55	Year:					
Test results				Limits	Results		
Side-slip test							
Front axle	+ 6 m/min	Front axle	- 5 m/min				
Shock absorber test (MSD/MSR)							
Front axle	left	right	Difference	Weight			
Front axle	0.29	0.21	29 %	1100 kg			
Rear axle	0.20	0.24	20 %	970 kg			
Total weight				1970 kg			
Brake test							
Front axle	left	right	Difference				
Front axle	3.82 kN	3.75 kN	2 %				
Parking brake	2.00 kN	2.20 kN	10 %				
Rear axle	2.00 kN	1.10 kN	45 %				
Final evaluation static			71 %				
Deceleration service brake			32 %				
Deceleration parking brake							
				Total weight	1970 kg		

Brake and shock absorber

Car		EUROSYSTEM VTN 141		MAHA	
Name/Car:	Car	License plate:	Car	VTN 141	MAHA
Street:		Model:			
Zip code, city:		Year:			
Telephone:		Manufacturer:			
Test date:	2026/09/17	Model:			
Test time:	9:55	Year:			
Test results		Limits	Results		
Side-slip test					
Front axle	+ 6 m/min	Front axle	- 5 m/min		
Shock absorber test (MSD/MSR)					
Front axle	left	right	Difference	Weight	
Front axle	0.29	0.21	29 %	1100 kg	
Rear axle	0.20	0.24	20 %	970 kg	
Total weight				1970 kg	
Brake test					
Front axle	left	right	Difference		
Front axle	3.82 kN	3.75 kN	2 %		
Parking brake	2.00 kN	2.20 kN	10 %		
Rear axle	2.00 kN	1.10 kN	45 %		
Final evaluation static			71 %		
Deceleration service brake			32 %		
Deceleration parking brake					
		Total weight	1970 kg		

Diagnostic.

Car		EUROSYSTEM VTN 141		MAHA	
Name/Car:	Car	License plate:	Car	VTN 141	MAHA
Street:		Model:			
Zip code, city:		Year:			
Telephone:		Manufacturer:			
Test date:	2026/09/17	Model:			
Test time:	9:55	Year:			
Test results		Limits	Results		
Side-slip test					
Front axle	+ 6 m/min	Front axle	- 5 m/min		
Shock absorber test (MSD/MSR)					
Front axle	left	right	Difference	Weight	
Front axle	0.29	0.21	29 %	1100 kg	
Rear axle	0.20	0.24	20 %	970 kg	
Total weight				1970 kg	
Brake test					
Front axle	left	right	Difference		
Front axle	3.82 kN	3.75 kN	2 %		
Parking brake	2.00 kN	2.20 kN	10 %		
Rear axle	2.00 kN	1.10 kN	45 %		
Final evaluation static			71 %		
Deceleration service brake			32 %		
Deceleration parking brake					
		Total weight	1970 kg		

Diagnostic.



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WAUZZZF38R1157136



CONDITION REPORT



Report No:
2017299426
DATE
16/09/2026



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Automatic.



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WAUZZZF38R1157136



CONDITION REPORT



Report No:

2017299426

DATE

16/09/2026



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WAUZZZF38R1157136



CONDITION REPORT



Report No:
2017299426
DATE
16/09/2026



VIN PLATE OR STICKER



ENGINE 1



Undercarriage front.



Undercarriage rear.



Oil cap and dipstick.



Water level

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WAUZZZF38R1157136



CONDITION REPORT



Report No:
2017299426
DATE
16/09/2026



Front Bumper



Front Fender Left



Door Front Left



Door Rear Left



Rear Fender Left



Rear Fender Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WAUZZZF38R1157136